YOUR ONESURVEY HOME REPORT

ADDRESS

5 Gordon Road Glasgow G44 3TL

PREPARED FOR

J Cresswell

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Corum - Newton Mearns

HOME REPORT GENERATED BY:



Document Index

| Document | Status | Prepared By | Prepared On |
|------------------------|------------------|--|-------------|
| Index of Documents | | | |
| Single Survey | Final | Glasgow South - Allied Surveyors Scotland Plc | 13/10/2021 |
| Mortgage Certificate | Final | Glasgow South - Allied Surveyors Scotland Plc | 13/10/2021 |
| Property Questionnaire | Final | J Cresswell | 13/10/2021 |
| EPC | File Uploaded | Glasgow South - Allied Surveyors Scotland Plc | 13/10/2021 |

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is essential that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

PART 1.

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

| Surveyor Reference | WG/5884 |
|--------------------|---|
| | |
| Customer | J Cresswell |
| | |
| Selling address | 5 Gordon Road Glasgow G44 3TL |
| | |
| Date of Inspection | 13/10/2021 |
| | |
| Prepared by | David A Ross, BLE MRICS ACIArb Glasgow South - Allied Surveyors Scotland Plc |

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

 $\overline{\Delta}$

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3</u>: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2</u>: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities:
- ➤ *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.


| Description | The subjects comprise a one storey detached bungalow. |
|--------------------------------|--|
| Accommodation | Entrance hall, lounge, sitting room, two bedrooms, kitchen and shower room. |
| Gross internal floor area (m2) | 98 square metres approximately excluding porch. |
| Neighbourhood and location | The property is situated within an established settled residential area of similar type properties on Glasgow's south side. All main amenities and facilities available close by. |
| Age | Built 1937. |
| Weather | Dry and clear following rain. |
| Chimney stacks | Chimney stacks have been removed. There are redundant flues to sitting room and lounge in place. |
| | Visually inspected with the aid of binoculars where required. |
| Roofing including roof space | The roof is timber framed, pitched, hipped and clad with concrete tiles. The roof space inspection was undertaken albeit restricted due to insulation material and some stored items. |
| | Sloping roofs were visually inspected with the aid of binoculars where required. |
| Rainwater fittings | These are of PVC and cast iron. |

| | Visually inspected with the aid of binoculars where required. |
|-------------------------------------|---|
| Main walls | Outer walls are of traditional brick cavity construction with a painted roughcast render finish to gable and rear and reconstituted stone frontage. |
| | Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. |
| Windows, external doors and joinery | Windows are of replacement UPVC framed double glazed type. Entrance door of PVC and glass. Eaves and soffits formed in PVC. |
| | Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. |
| External decorations | Mainly PVC finishes. Paintwork finishes to roughcast. |
| | Visually inspected. |
| Conservatories / | Small rear porch of PVC construction with glazed inserts. |
| porches | Visually inspected. |
| Communal areas | None. |
| Garages and permanent outbuildings | There is a single detached garage. It is precast concrete panel construction under a shallow pitched corrugated cement asbestos roof. Visually inspected. |
| | , , |
| Outside areas and boundaries | The property occupies a good sized site sloping gently up to the rear. A mix of masonry wall, hedge and fence boundaries. |
| | Visually inspected. |
| Ceilings | Ceilings are of lath and plaster. |
| | Visually inspected from floor level. |
| Internal walls | These are mainly of brick with a plastered hard finish. |
| | Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. |

| Floors including sub floors | Floors are of suspended timber construction. | |
|--|---|--|
| | No sub floor inspection was undertaken. | |
| | Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. | |
| Internal joinery and kitchen fittings | A mix of original and replacement joinery finishes. The kitchen comprises a range of wall and floor mounted units. | |
| | Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. | |
| Chimney breasts and fireplaces | Original fireplace is no longer in use. Electric fire inserts only in lounge and sitting room. | |
| | Visually inspected. No testing of the flues or fittings was carried out. | |
| Internal decorations | Modern paint and paper finishes. | |
| | Visually inspected. | |
| Cellars | None. | |
| Electricity | The property has mains supply with 13amp circuit, visible cabling in PVC and mains switch gear in vestibule cupboard. | |
| | | |
| | Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. | |
| Gas | without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will | |
| Gas | without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. | |
| Gas Water, plumbing and bathroom fittings | without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on. Mains supply with meter in vestibule cupboard. Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will | |

| | Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. |
|-------------------------------------|---|
| Heating and hot water | Central heating and domestic hot water are provided by means of a gas fired condensing combination boiler wall mounted in the kitchen and which serves panel radiators. |
| | Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. |
| Drainage | Assumed to be to Local Authority mains sewer. |
| | Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. |
| Fire, smoke and burglar alarms | Smoke, fire and burglar alarm installed. |
| aiaiiiis | Visually inspected. No tests whatsoever were carried out to the system or appliances. |
| Any additional limits to inspection | An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive. |

Sectional Diagram showing elements of a typical house

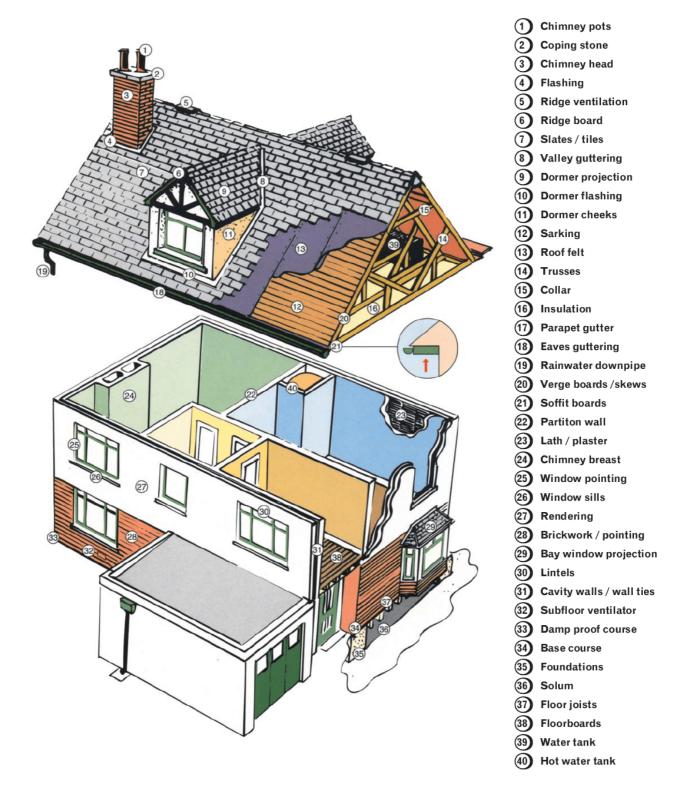

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Structural moven | nent |
|------------------|--|
| Repair category: | |
| Notes: | Historic structural movement noted however this is considered long standing and non progressive. |

| Dampness, rot a | nd infestation |
|------------------|--|
| Repair category: | 2 |
| Notes: | Higher than normal damp meter readings were noted either side of the fireplace in the lounge along with some evidence of damp to the rear elevation. External ground levels at rear are higher than considered ideal. We are aware that some deterioration and decay has been identified within the sub floor area. In addition there is a build up of some general condensation within the property and a better regime of ventilation should be undertaken. Given the issues noted a timber specialist report should be obtained to ascertain the full cost in extent of repairs. These matters have been reflected as far as is possible within the opinion of value albeit the purchaser should satisfy themselves in this regard prior to purchase. |

| Chimney stacks | |
|------------------|--|
| Repair category: | 2 |
| Notes: | Original chimney stacks have been removed. The redundant flues are obviously not in use but should be kept ventilated. It is possible there may be an asbestos content particularly to the flue at the |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| lounge. |
|---------|
|---------|

| Roofing including roof space | |
|------------------------------|---|
| Repair category: | 1 |
| Notes: | The property was re-roofed a number of years ago. Nonetheless it has been generally well maintained. Old damp staining noted within the roof space area. General ongoing maintenance should be anticipated. |

| Rainwater fittings | |
|--------------------|---|
| Repair category: | |
| Notes: | No significant defects noted albeit some general corrosion was noted to cast iron sections. |

| Main walls | |
|------------------|--|
| Repair category: | 2 |
| Notes: | External ground level to the rear is higher than considered ideal and partially covering sub floor vents. Some localised cracking noted to roughcast. Some localised patch repairs have been undertaken in the past. |

| Windows, external doors and joinery | |
|-------------------------------------|--|
| Repair category: | |
| Notes: | Windows are in fair general condition given their age and type and |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| where tested were seen to be working satisfactorily. Nonetheless |
|--|
| with the passage of time frames of this type can be prone to failure |
| of mechanisms and seals. |

| External decorations | |
|----------------------|-------------------------------|
| Repair category: | |
| Notes: | No significant defects noted. |

| Conservatories / porches | |
|--------------------------|------------------------------|
| Repair category: | |
| Notes: | Satisfactory basic standard. |

| Communal areas | |
|------------------|-----------------|
| Repair category: | |
| Notes: | Not applicable. |

| Garages and permanent outbuildings | |
|------------------------------------|--|
| Repair category: | 2 |
| Notes: | The garage is of an older style and incorporates cement asbestos roof. Care should be taken during future maintenance. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Outside areas and boundaries | |
|------------------------------|-------------------------------|
| Repair category: | 1 |
| Notes: | No significant defects noted. |

| Ceilings | |
|------------------|--|
| Repair category: | |
| Notes: | No significant defects noted albeit older plasterwork will be fragile. |

| Internal walls | |
|------------------|--|
| Repair category: | 2 |
| Notes: | No significant defects noted albeit older plasterwork will be fragile. Some condensation noted in places. Damp staining noted at the side of the lounge fireplace. |

| Floors including sub-floors | |
|-----------------------------|---|
| Repair category: | 2 |
| Notes: | Timber decay understood to exist within the sub floor area and appropriate investigation and repair should be undertaken. |

| Internal joinery and kitchen fittings | |
|---------------------------------------|--|
| Repair category: | |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| | 1 |
|--------|---|
| Notes: | No significant defects noted albeit kitchen fittings are now of an older style. |

| Chimney breasts and fireplaces | |
|--------------------------------|---|
| Repair category: | |
| Notes: | Redundant flues should be kept well ventilated. |

| Internal decorations | |
|----------------------|---|
| Repair category: | 1 |
| Notes: | The property is generally well presented. |

| Cellars | |
|------------------|-----------------|
| Repair category: | |
| Notes: | Not applicable. |

| Electricity | |
|------------------|--|
| Repair category: | 1 |
| Notes: | The system appears to be of reasonably modern nature albeit it is important to ensure that systems of this type are up to date and |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

comply with current regulation requirements. Accordingly a current test certificate should be confirmed.

| Gas | |
|------------------|---|
| Repair category: | |
| Notes: | Gas Safe certificate should be confirmed. |

| Water, plumbing and bathroom fittings | | |
|---------------------------------------|-------------------------------|--|
| Repair category: | 1 | |
| Notes: | No significant defects noted. | |

| Heating and hot water | | |
|-----------------------|--|--|
| Repair category: | 1 | |
| Notes: | The central heating boiler has recently been renewed. Current test certificate and guarantees should be confirmed. | |

| Drainage | |
|------------------|-------------------------------|
| Repair category: | |
| Notes: | No significant defects noted. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

| Structural movement | 1 |
|---------------------------------------|---|
| Dampness, rot and infestation | 2 |
| Chimney stacks | 2 |
| Roofing including roof space | 1 |
| Rainwater fittings | 1 |
| Main walls | 2 |
| Windows, external doors and joinery | 1 |
| External decorations | 1 |
| Conservatories / porches | 1 |
| Communal areas | |
| Garages and permanent outbuildings | 2 |
| Outside areas and boundaries | 1 |
| Ceilings | 1 |
| Internal walls | 2 |
| Floors including sub-floors | 2 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces | 1 |
| Internal decorations | 1 |
| Cellars | |
| Electricity | 1 |
| Gas | 1 |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water | 1 |
| Drainage | 1 |

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

<u>Unrestricted parking within 25 metres:</u> For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

| 1. Which floor(s) is the living accommodation on? | Ground floor. |
|--|---------------|
| 2. Are there three steps or fewer to a main entrance door of the property? | []YES [x]NO |
| 3. Is there a lift to the main entrance door of the property? | []YES [x]NO |
| 4. Are all door openings greater than 750mm? | []YES [x]NO |
| 5. Is there a toilet on the same level as the living room and kitchen? | [x]YES []NO |
| 6. Is there a toilet on the same level as a bedroom? | [x]YES []NO |
| 7. Are all rooms on the same level with no internal steps or stairs? | [x]YES []NO |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | [x]YES []NO |

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property has been altered in the past with the formation of French doors to the rear and construction of small conservatory and in addition an extra window was installed to the gable. These alterations are of considerable age and it would not be unreasonable to accept the position as it stands.

Cavity wall insulation has been installed and guarantees should be confirmed.

Where items of maintenance or repair have been identified, the purchaser, should, prior to purchase, satisfy themselves as to the costs and implications of these issues.

Estimated re-instatement cost (£) for insurance purposes

250,000

Two Hundred and Fifty Thousand Pounds.

Valuation (£) and market comments

350,000

Three Hundred and Fifty Thousand Pounds.

| Report author: | David A Ross, BLE MRICS ACIArb | | |
|-----------------|---|--|--|
| Company name: | Glasgow South - Allied Surveyors Scotland Plc | | |
| Address: | 246 Kilmarnock Road Glasgow G43 1TT | | |
| Signed: | Electronically Signed: 193596-C3537591-1336 | | |
| Date of report: | 13/10/2021 | | |

P A R T 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





| | | Mor | tgage Val | uation Re | port | | | |
|---|---|---|---|--|--|--|--|--|
| Property: | 5 Gordon Roa Glasgow | d Client: J Cresswell | | | | | | |
| | G44 3TL | | Tenure: Owne | ership. | | | | |
| Date of Inspection: | 13/10/2021 | | Reference: WG/5884/NM | | | | | |
| purpose of this for mortgage p should not rely Your attention service provide accordance winamed client contents. Neith | s been prepared as report is to sumrourposes. The decorrence on this report in a sister of the accept. This report should be a sister of their nominated ther the whole or a siting from the surv | marise the Single cision as to whetl making your dec dditional commer ould be read in c n – Global Stand lender. No respo ny part of this re | Survey for the pher mortgage find ision to purchase into elsewhere with the onjunction with the consibility is acception. | urpose of advision ance will be proven the but consider all thin the report with the Single Survey port is for the us ted to any third | ng your lender or ided is entirely a the documents phich set out the earth to we find the party to we arty for the whole | n the suitability o matter for the le provided in the H xtent and limitati ditions (with MVI whom it is addre: le or any part of | f the property nder. You lome Report. ions of the R). In ssed or their the reports | |
| 1.0 | LOCATION | | | | | | | |
| | is situated withir | | | ntial area of sim | nilar type proper | ties on Glasgov | w's south sid | |
| 2.0 | DESCRIPTIO | DESCRIPTION 2.1 Age: Built 1937. | | | | | | |
| The subjects | comprise a one | storey detache | d bungalow. | | | | | |
| 3.0 | CONSTRUCTION | | | | | | | |
| | re brick cavity co | | a roughcast re | nder finish to ga | able and rear ar | nd artificial ston | e finish to | |
| 4.0 | ACCOMMOD | ACCOMMODATION | | | | | | |
| Entrance hall | , lounge, sitting | room, two bedro | ooms, kitchen a | nd shower roor | n. | | | |
| 5.0 | SERVICES (N | SERVICES (No tests have been applied to any of the services) | | | | | | |
| Water: | Mains. | Electricity: | Mains. | Gas: | Mains. | Drainage: | Mains. | |
| Central Heat | leating: Gas fired to radiators. | | | | | | | |
| 6.0 | OUTBUILDIN | IGS | | | | | | |
| Garage: | Single detached. | | | | | | | |
| | | | | | | | | |

None.

Others:

GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.

During the course of the inspection the subjects were found to be in fair general condition with regards to age and type. In general terms items noted are capable of attention as part of a normal maintenance programme.

However higher than normal damp readings were noted within the property along with a high ground level to the rear. We are aware timber decay affecting concealed sub floor areas. Appropriate timber specialist report and estimates should be obtained to ascertain the full extent of the cost of the rears. We have reflected these matters as far as possible in the valuation. Nonetheless the purchaser should satisfy themselves in this regard prior to purchase.

| 8.0 | ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property) | | | | |
|---|--|--|--|--|---|
| See comments | See comments above. | | | | |
| 8.1 Retention | 3.1 Retention recommended: Not applicable. | | | | |
| 9.0 | ROADS &FOOTPATHS | | | | |
| Made up and a | Made up and adopted. | | | | |
| 10.0 | BUILDINGS INSURANCE (£): GROSS EXTERNAL 108 Square metres | | | | _ |
| This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised. | | | | | |
| 11.0 | GENERAL REMARKS | | | | |

The property has been altered in the past with the formation of French doors to the rear and construction of small conservatory and in addition an extra window was installed to the gable. These alterations are of considerable age and it would not be unreasonable to accept the position as it stands.

Cavity wall insulation has been installed and guarantees should be confirmed.

Where items of maintenance or repair have been identified, the purchaser, should, prior to purchase, satisfy themselves as to the costs and implications of these issues.

| 12.0 | VALUATION On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests. | | | |
|------|---|--|--|--|
| 12.1 | Market Value in present condition (£): | 350,000 Three Hundred and Fifty Thousand Pounds. | | |
| 12.2 | Market Value on completion of essential works (£): | | | |
| 12.3 | Suitable security for | Yes | | |

| normal mortgage purposes? | | | | | | |
|----------------------------|---|----------------|---|---------------|-------------|------------|
| 12.4 Date of Valuation: | | 13/10/2021 | | | | |
| Signature: Electronically | | Signed: 193596 | 6-C3537591-1336 | | | |
| Surveyor: | eyor: David A Ross | | BLE MRICS ACIArb Date: 13/10/202 | | | 13/10/2021 |
| Glasgow South - Allied Sur | | | veyors So | cotland Plc | | |
| Office: | office: 246 Kilmarnock Road Glasgow G43 1TT | | Tel: 0141 636 5345 Fax: email: glasgow.south@alli | edsurveyorsso | cotland.com | |

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

| Property address | 5 Gordon Road Glasgow G44 3TL |
|------------------|---|
| | |
| Customer | J Cresswell |
| | |
| Customer address | 5 Gordon Road Glasgow G44 3TL |
| | |
| Prepared by | David A Ross, BLE MRICS ACIArb Glasgow South - Allied Surveyors Scotland Plc |

Energy Performance Certificate (EPC)

Dwellings

Scotland

5 GORDON ROAD, NETHERLEE, GLASGOW, G44 3TL

Dwelling type: Detached bungalow
Date of assessment: 13 October 2021
Date of certificate: 13 October 2021

Total floor area: 98 m²

Primary Energy Indicator: 263 kWh/m²/year

Reference number: 9475-1925-0200-9419-5204 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

| Estimated energy costs for your home for 3 years* | £2,901 | See your recommendations |
|---|--------|-----------------------------|
| Over 3 years you could save* | £750 | report for more information |

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

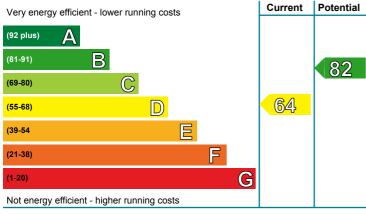


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

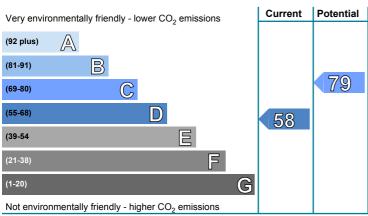

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (58)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years |
|--------------------------------------|-----------------|------------------------------|
| 1 Increase loft insulation to 270 mm | £100 - £350 | £81.00 |
| 2 Floor insulation (suspended floor) | £800 - £1,200 | £315.00 |
| 3 Low energy lighting | £25 | £147.00 |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls | Cavity wall, filled cavity | *** | *** |
| Roof | Pitched, 150 mm loft insulation | **** | ★★★★ ☆ |
| Floor | Suspended, no insulation (assumed) | _ | _ |
| Windows | Fully double glazed | *** | ★★★☆☆ |
| Main heating | Boiler and radiators, mains gas | **** | ★★★★ ☆ |
| Main heating controls | Programmer, room thermostat and TRVs | **** | ★★★★ ☆ |
| Secondary heating | None | _ | _ |
| Hot water | From main system | **** | ★★★★ ☆ |
| Lighting | Low energy lighting in 29% of fixed outlets | *** | *** |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 46 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.1 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

| | Current energy costs | Potential energy costs | Potential future savings |
|-----------|----------------------|------------------------|--------------------------|
| Heating | £2,193 over 3 years | £1,698 over 3 years | |
| Hot water | £312 over 3 years | £222 over 3 years | You could |
| Lighting | £396 over 3 years | £231 over 3 years | save £750 |
| Totals | £2,901 | £2,151 | over 3 years |


These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| D. | assumented massives | Indicative cost | Typical saving | Rating after improvement | | |
|----|---|-----------------|----------------|--------------------------|-------------|--|
| Re | commended measures | indicative cost | per year | Energy | Environment | |
| 1 | Increase loft insulation to 270 mm | £100 - £350 | £27 | D 65 | D 60 | |
| 2 | Floor insulation (suspended floor) | £800 - £1,200 | £105 | C 69 | D 65 | |
| 3 | Low energy lighting for all fixed outlets | £25 | £49 | C 70 | D 67 | |
| 4 | Solar water heating | £4,000 - £6,000 | £30 | C 72 | D 68 | |
| 5 | Replacement glazing units | £1,000 - £1,400 | £39 | C 73 | C 71 | |
| 6 | Solar photovoltaic panels, 2.5 kWp | £3,500 - £5,500 | £312 | B 82 | C 79 | |

Choosing the right improvement package

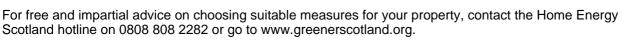



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 13,600 | (602) | N/A | N/A |
| Water heating (kWh per year) | 2,228 | | | |

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Mr. David Ross Assessor's name: Assessor membership number: EES/008238

Allied Surveyors Scotland Plc Company name/trading name:

Address: 246 Kilmarnock Road

> Shawlands Glasgow G43 1TT

Phone number: 0141 636 5345

glasgow.south@alliedsurveyorsscotland.com No related party Email address:

Related party disclosure:

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT




P A R T 4.

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



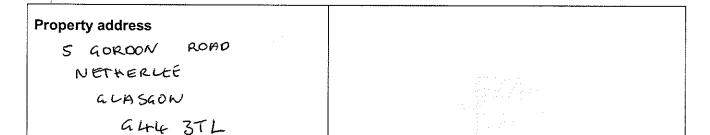

| Seller(s) | JANET E | CRESSWELL |
|-----------|---------|-----------|

Completion date of property questionnaire 13-10-21

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

| 1. | Leng | th of ov | vnersh | ip | | | | | | | | - | _ |
|----|-------|----------|----------|----------|--------|----------|--|----------------------------|---------|------|-------|------------------------|---|
| | How | long ha | ıve you | owne | d the | proper | ty? | FAMIL | y 3W | いめ | SINCE | BUILT | |
| 2. | Coun | cil tax | | | | | | | | | | | _ |
| | Whic | h Coun | cil Tax | band i | is you | ır prop | erty i | n? (Plea | se circ | ele) | | | |
| | A | В | С | D | E | E | G | Н | | | | | |
| 3. | Parki | ng | ******* | | | | | | | | | | |
| | What | are the | arrang | gemen | ts for | parkin | g at y | our pro | perty? | | V**a^ | | _ |
| | (Plea | se tick | all that | apply) |) | | | | | | | | |
| | | Garaç | je | | | | / | | | | | | |
| | | Alloc | ated pa | rking | space | . [| | | | | | | |
| | • | Drive | way | | | [| V | | | | | | |
| | | Share | d park | ing | | [| | | | | | | |
| | • | On st | reet | | | [| | | | | | | |
| | • | Resid | ent pei | rmit | | [| | | | | | | |
| | • | Meter | ed parl | king | | [| | | | | | | |
| : | • | Other | (pleas | e spec | ify): | | | | | | | | |
| 4. | Cons | ervatio | n area | | | | ······································ | | | | | | |
| | speci | | tectura | al or hi | storic | al inter | rest, 1 | ion Area the charance)? | | | | Yes/No/ Den't-know- | |

| 5. | Listed buildings | |
|----|---|--------------------|
| | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? | Yes /No |
| 6. | Alterations/additions/extensions | |
| a. | (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? | Yes/ÞÞठ |
| | If you have answered yes, please describe below the changes which you have made: | |
| | EXTRA KITCHON WINDOW 2004 | |
| | (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? | Yes/Mor |
| | If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. | |
| | If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: | |
| b. | Have you had replacement windows, doors, patio doors or double glazing installed in your property? | Yes/Mio |
| | If you have answered yes, please answer the three questions below: | |
| | (i) Were the replacements the same shape and type as the ones you replaced? TNSTALLED APPROXIMATELY 20 YERS ACO | Yes/Ner |
| | (ii) Did this work involve any changes to the window or door openings? | Yos/ No |
| | (iii) Please describe the changes made to the windows doors, or patio doo approximate dates when the work was completed): | rs (with |
| | Please give any guarantees which you received for this work to your solic agent. | itor or estate |

| 7. | Central heating | |
|------|---|--|
| a. | Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). | Yes /No/ P artial |
| | If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). | NEW BOILE 1 2021 |
| | If you have answered yes, please answer the three questions below: | |
| | i) When was your central heating system or partial central heating system installed? | 1980 |
| | (ii) Do you have a maintenance contract for the central heating system? | Yes/No |
| | If you have answered yes, please give details of the company with which you have a maintenance contract: | |
| | (iii) When was your maintenance agreement last renewed? (Please provide the month and year). | NIA |
| 8. | Energy Performance Certificate | |
| | Does your property have an Energy Performance Certificate which is less than 10 years old? | Yes/No |
| 9. | Issues that may have affected your property | |
| a. | Has there been any storm, flood, fire or other structural damage to you property while you have owned it? | r ¥es/ No |
| | If you have answered yes, is the damage the subject of any outstanding insurance claim? | Yes/No |
| b. | Are you aware of the existence of asbestos in your property? | Yes# Nő |
| | If you have answered yes, please give details: GARAGE ROF FLUE | |
| ···· | | |

| 10. | Services |
|-----|----------|
| | |

a. Please tick which services are connected to your property and give details of the supplier:

| Services | Connected | Supplier |
|-------------------------------------|-----------|----------------|
| Gas or liquid petroleum gas | / | SHELL ENERGY |
| Water mains or private water supply | V | SCOTTISH WATER |
| Electricity | V | SHELL ENERGY |
| Mains drainage | ~ | SUTTISH WATER |
| Telephone | V | ВТ |
| Cable TV or satellite | NIA | |
| Broadband | / | ВТ |

| Yes/No |
|---------------------------------------|
| |
| tic Yes/ No/ Den't know |
| Yes/No |
| ich |
| |
| |
| |

| 11. | Responsibilities for shared or common areas | |
|-----|---|---------------------------|
| a. | Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: | Yes/No/ Don't know |
| b. | Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: | Yes/No/ Not applicable |
| C. | Has there been any major repair or replacement of any part of the roof during the time you have owned the property? | Yesthe REROOFEN C 1980 |
| d. | Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: | Ye s/No |
| e. | As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details: | Yes /No |
| f. | As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details: | ¥€S/No |
| 12. | Charges associated with your property | |
| a. | Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: | Yes /No |

| L | La than a same hall the same a same hall the same as a same a | Tx /84 / |
|----------|---|-----------------------|
| b. | Is there a common buildings insurance policy? | Yes/No/ |
| | If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges? | Yes/No/ Don't know |
| C. | Please give details of any other charges you have to pay on a regula upkeep of common areas or repair works, for example to a residents maintenance or stair fund. | |
| 13. | Specialist works | |
| a. | As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? | Yes/No |
| | If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property. | |
| b. | As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details: | Yas /No |
| C. | If you have answered yes to 13(a) or (b), do you have any | ¥≅5/ No |
| . | guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. | TOSHIO |
| | Guarantees are held by: | |

| 14. | Guarantees | | | | | |
|-------|---|------|-----|---------------|------------------------------|------|
| a. | Are there any guarantees or warranties for any of the following: | | | | | |
| (i) | Electrical work | Ng | Yes | Don't know | With title deeds | Lost |
| (ii) | Roofing | No) | Yes | Don't know | With title deeds | Lost |
| (iii) | Central heating | -No | Yes | Don't know | With title deeds | Lost |
| (iv) | National House Building Council (NHBC) | No | Yes | Don't know | With title deeds | Lost |
| (v) | Damp course | (No) | Yes | Don't know | With title deeds | Lost |
| (vi) | Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) | No | Yes | Don't know | With title deeds | Lost |
| b. | If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): | | | | | |
| c. | Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: | | | | | |
| 15. | Boundaries | | | | | |
| | So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details: | | | | Yes/ No/ Don't knew | |

| 16. | Notices that affect your property | | | |
|-----|---|--------------------|--|--|
| | In the past three years have you ever received a notice: | | | |
| а. | advising that the owner of a neighbouring property has made a planning application? | ¥ac /No | | |
| b. | that affects your property in some other way? | Yes/ No | | |
| c. | that requires you to do any maintenance, repairs or improvements to your property? | Yes/No | | |
| | If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property. | | | |

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

| Signature(s) : | Janet & Gresswell | |
|----------------|-------------------|--|
| Date: | 13-10-21 | |