

2/6 27 Broomhill Avenue,
Broomhill,
Glasgow,
G11 7BF

Home Report



DM HALL

2/6 27 Broomhill Avenue,
Broomhill,
Glasgow,
G11 7BF

Single Survey



DM HALL

Survey Report on:

Property Address	2/6 27 Broomhill Avenue, Broomhill, Glasgow, G11 7BF
Reference	1626292
Customer Name	Ryan Metcalfe
Date of Inspection	11th June 2026
Surveyor's name, qualifications and office	Paul Reilly BSc, MRICS DM Hall LLP Chartered Surveyors 3 Centura Court, Hillington Park Glasgow G52 4PR Tel: 0141 636 4141 email: glasgowresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2- DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

“Market value” The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm’s length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property forms part of 'The Atrium' residential development. The subjects comprise a duplex apartment occupying a second and third floor position set within a Grade "C" listed former school building now converted into 32 residential apartments. The building is set over four levels which also incorporates modern sections at upper floor levels. The subject property is accessed from communal entrance hallways leading into a central atrium which incorporates a lift. There is also stair access within the building.
Accommodation	Second Floor: Entrance hallway, open plan lounge, kitchen and W.C. Upper Floor: Landing, bedroom and bathroom.
Gross Internal Floor Area (m2)	Approximately 76 sqm or thereby.
Neighbourhood and Location	The subjects form part of an established and long-standing mixed area of mixed residential and commercial area located within the popular Broomhill district of Glasgow. The property is conveniently positioned for local shopping, educational, transport and social facilities. I understand that the property is located in a Conservation Area.

Age	<p>Originally built circa 1904. I understand that the building was redeveloped circa 2016/2017.</p>
Weather	<p>Overcast with rainfall.</p>
Chimney Stacks	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>The original building incorporates a number of chimney stacks. These are of stone construction with a pointed finish.</p>
Roofing including Roof Space	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</p> <p>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>Roof: The original main roof to the building was removed as part of the conversion. The roof to the building is of a complex pitched/flat design. The main roof over the central atrium to the building is of steel frame construction incorporating glass panels.</p> <p>Flat roof details to the building were not visible for inspection, however it is assumed that these will be overlaid with a Sarnafill roof membrane or metal roof covering.</p> <p>Roof Space: There is no access to a roof void in the building.</p>
Rainwater Fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Rainwater units are of a cast iron and aluminium design. There would appear to be concealed parapet gutters to the building.</p>
Main Walls	<p>Visually inspected with the aid of binoculars where appropriate.</p>

	<p>Foundations and concealed parts were not exposed or inspected.</p> <p>Main walls to the original building are of stone construction with pointed finish. The building incorporates modern sections at upper floor levels, finished externally with cladding.</p>
<p>Windows, External Doors and Joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Windows: Timber design incorporating sealed unit double glazing.</p> <p>External Door: The main entrance door is of timber panel design.</p>
<p>External Decorations</p>	<p>Visually inspected.</p> <p>External joinery is paint finished. Cast iron/metal rainwater units are paint finished. Low maintenance self-coloured aluminium finishes.</p>
<p>Conservatories and Porches</p>	<p>There are no conservatories or porches.</p>
<p>Communal Areas</p>	<p>Circulation areas visually inspected.</p> <p>The building incorporates communal entrance hallways and there is stair and lift access within the building.</p> <p>External doors are of aluminium framed design incorporating sealed unit double glazing. The building incorporates a secure entry system. Windows to common areas are of timber casement design incorporating sealed unit double glazing.</p> <p>The building incorporates a central atrium with residents' seating area. There are two staircases within the building leading upper walkways. Floors, stairs and walkways are generally overlaid with carpet. Walls and ceilings are generally plastered and have a paint finish.</p>
<p>Garages and Permanent Outbuildings</p>	<p>Visually inspected.</p> <p>At ground floor level in the building, there is a residents'</p>

	<p>communal room where gas and electric meters serving flats within the building are located.</p> <p>There is a residents bin compound and a residents bike store.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>There are landscaped communal garden grounds and residents' parking facilities pertaining to the development.</p> <p>Boundaries are generally defined by timber fencing, stone walling and metal railings.</p> <p>It has been advised by the vendor that there is one allocated parking space pertaining to the property. This can be verified by the Title Deeds.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>Plasterboard design.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Plasterboard design.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>Flooring would appear to be of a solid and suspended timber joists overlaid with a range of fitted floor coverings.</p> <p>Sub-floor: Given the position of the subject property in the building, there is no access to sub- floors.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored items were moved.</p>

	<p>Kitchen units were visually inspected excluding appliances.</p> <p>Door facings and skirtings are of timber design.</p> <p>Internal doors are of timber panel design or timber frame and glass panel design.</p> <p>Kitchen fittings comprise a range of modern base and wall mounted units incorporating a sink unit and integral appliances.</p> <p>Within the bedroom there are fitted wardrobes incorporating sliding glass panel doors.</p>
Chimney Breasts and Fireplaces	<p>There are no chimney breasts/fireplaces.</p>
Internal Decorations	<p>Visually inspected.</p> <p>Plaster wall and ceilings linings are generally paint finished.</p> <p>Within the bathroom apartment there are wall tile and mirrored panel wall finishes. Within the W.C. apartment there are wall tile finishes.</p>
Cellars	<p>There are no cellars.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The consumer unit is located within a wall cupboard off the Lounge.</p> <p>The electric meter is located in a communal room at ground floor in the building.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor</p>

	<p>will state that in the report and will not turn them on.</p> <p>Mains supply. The gas meter is located is located in a communal room at ground floor in the building</p>
<p>Water, Plumbing and Bathroom Fittings</p>	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains water supply. Visible plumbing pipework is run in metal and PVC materials.</p> <p>The bathroom comprises a three piece suit with WC, wash hand basin and panelled bath with mixer shower unit over.</p> <p>The W.C. facilities a comprise a WC. and wash hand basin.</p>
<p>Heating and Hot Water</p>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a Vokera gas fired boiler located within a fitted wardrobe in the bedroom. This serves a system of radiators within the property. This system also provides domestic hot water.</p>
<p>Drainage</p>	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is connected to the main sewer.</p>
<p>Fire, Smoke and Burglar Alarms</p>	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke alarms installed.</p> <p>Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise</p>

themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

There is a sprinkler system installed to the building.

Any Additional Limits to Inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation we have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to

concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

The property was unoccupied, furnished and floors were covered. I have not disturbed any furniture, personal effects (particularly within cupboards) and fitted floor coverings have not been moved.

There is no access to a roof void within the building.

No access was obtained to sub-floors due to the position of the property in the building.

Externally, parapet gutter details were not visible for inspection.

My inspection of the main roof coverings to the building and chimney stacks were observed from ground level only. This was severely restricted due to the height of the building and complex roof design.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural Movement	
Repair Category	1
Notes	No obvious evidence of significant movement noted within the limitations of the inspection.

Dampness, Rot and Infestation	
Repair Category	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney Stacks	
Repair Category	1
Notes	There is some weathering to chimney stacks.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including Roof Space	
Repair Category	1
Notes	<p>Roof: No obvious significant defects were identified within the limitations of the inspection.</p> <p>The main roof to the building is of a complex pitched and flat design. Given the design of the roof, ongoing repair and expenditure should be anticipated.</p>

Rainwater Fittings	
Repair Category	1
Notes	<p>No obvious significant defects identified within the limitations of the inspection.</p> <p>Parapet gutters require above average maintenance and periodic clearing and inspection to ensure they remain free from defect.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main Walls	
Repair Category	2
Notes	<p>There is some weathering to stonework to external walls and selective pointing is loose/weathered.</p> <p>The Government has issued advice on multi-storey properties where there is cladding or other elements within the external wall system or attachments which may contain combustible material. We suggest the property owners, and/or their agents, produce a written report (EWS1 form), prepared by a suitably qualified independent professional advisor, who is a member of one of the professional bodies approved in Government guidance, to confirm that the subject property meets the relevant requirements.</p> <p>The valuation assumes that the EWS1 form will satisfy both the purchaser and the purchaser's lender and that no significant expenditure will be incurred in terms of recommended remedial action.</p> <p>Please note that the surveyor does not warrant the EWS1 form and is not in a position to comment on the EWS1 form or its content.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery	
Repair Category	1
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p> <p>No obvious significant defects identified.</p> <p>It is assumed that windows have been installed in accordance with good working practise and complied with regulations in force at the time of installation.</p>

External Decorations	
Repair Category	1
Notes	No significant defects evident.

Conservatories and Porches	
Repair Category	N/A
Notes	Not applicable.

Communal Areas	
Repair Category	1
Notes	No significant defects evident.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Garages and Permanent Outbuildings	
Repair Category	1
Notes	No significant defects evident.

Outside Areas and Boundaries	
Repair Category	1
Notes	There are trees located within close proximity. General advice suggests that no trees should be planted any closer to a building than its mature height and regular maintenance is desirable.

Ceilings	
Repair Category	1
Notes	No significant defects evident.

Internal Walls	
Repair Category	1
Notes	No significant defects evident.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including Sub-floors	
Repair Category	1
Notes	It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. No significant defects evident.

Internal Joinery and Kitchen Fittings	
Repair Category	1
Notes	No significant defects evident.

Chimney Breasts and Fireplaces	
Repair Category	N/A
Notes	Not applicable.

Internal Decorations	
Repair Category	1
Notes	The property was well presented at the time of our inspection.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not applicable.

Electricity	
Repair Category	1
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>No significant defects evident.</p>

Gas	
Repair Category	1
Notes	<p>No significant defects evident.</p> <p>Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings

Repair Category	1
Notes	No significant defects evident.

Heating and Hot Water

Repair Category	1
Notes	<p>No significant defects evident.</p> <p>It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis. A copy of any relevant documentation in this regard should be obtained.</p> <p>It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p> <p>Informed opinion suggests that many boilers have a life expectancy of between 10 and 20 years. A suitably qualified heating engineer will be able to advise further on repairing requirements or whether replacement is likely to be a more viable solution.</p>

Drainage

Repair Category	1
Notes	No significant surface defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	1
Chimney Stacks	1
Roofing including Roof Space	1
Rainwater Fittings	1
Main Walls	2
Windows, External Doors and Joinery	1
External Decorations	1
Conservatories and Porches	N/A
Communal Areas	1
Garages and Permanent Outbuildings	1
Outside Areas and Boundaries	1
Ceilings	1
Internal Walls	1
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	1
Chimney Breasts and Fireplaces	N/A
Internal Decorations	1
Cellars	N/A
Electricity	1
Gas	1
Water, Plumbing and Bathroom Fittings	1
Heating and Hot Water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

The property is a listed building and located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Scotland.

The subject property comprises converted flat, set within a former Grade "C" listed school house, now converted into approximately 32 separate residential apartments. I understand that the redevelopment was undertaken circa 2016/2017. In this regard, it is assumed that all necessary Local Authority consents and approvals have been obtained for the construction of the property and appropriate documentation, including Warrants and Completion Certificates, issued. It should be confirmed whether there is a 10 year NHBC warranty or equivalent. It is further assumed that any listed building consents were obtained as part of the conversion.

I have been advised by the vendor that there is one allocated parking space pertaining to the subject property. This can be verified with the Title Deeds.

The Government has issued advice on multi-storey properties where there is cladding or other elements within the external wall system or attachments which may contain combustible material. We suggest the property owners, and/or their agents, produce a written report (EWS1 form), prepared by a suitably qualified independent professional advisor, who is a member of one of the professional bodies approved in Government guidance, to confirm that the subject property meets the relevant requirements.

The valuation assumes that the EWS1 form will satisfy both the purchaser and the purchaser's lender and that no significant expenditure will be incurred in terms of recommended remedial action.

Please note that the surveyor does not warrant the EWS1 form and is not in a position to comment on the EWS1 form or its content.

Estimated Reinstatement Cost (£) for Insurance Purposes

Four Hundred and Fifty-Five Thousand Pounds:
£455,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

It is prudent to keep the Estimated Reinstatement Cost for insurance under regular review to reflect inflationary effects. RICS guidance recommends that a reassessment be undertaken every three years, or sooner if significant alterations are made to the property.

Valuation (£) and Market Comments

Two Hundred and Twenty-Five Thousand Pounds:
£225,000

The opinion of Market Value is provided on the basis that the comments under walls and valuation and conveyancer issues have been satisfied. Where remedial works are recommended to the building we reserve the right to reconsider the Market Value.

Report author:	Paul Reilly BSc, MRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors 3 Centura Court, Hillington Park Glasgow G52 4PR Tel: 0141 636 4141 email: glasgowresidential@dmhall.co.uk
Signed:	
Date of report:	11th June 2026

2/6 27 Broomhill Avenue,
Broomhill, Glasgow, G11 7BF

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: 2/6 27 Broomhill Avenue, Broomhill, Glasgow, G11 7BF

Date of Inspection: 11th June 2026

Reference: 1626292

Location & Description

1. Location:

The subjects form part of an established and long-standing mixed area of mixed residential and commercial area located within the popular Broomhill district of Glasgow.

The property is conveniently positioned for local shopping, educational, transport and social facilities.

I understand that the property is located in a Conservation Area.

2. Description:

The property forms part of 'The Atrium' residential development. The subjects comprise a duplex apartment occupying a second and third floor position set within a Grade "C" listed former school building now converted into 32 residential apartments. The building is set over four levels which also incorporates modern sections at upper floor levels. The subject property is accessed from communal entrance hallways leading into a central atrium which incorporates a lift. There is also stair access within the building.

3. Age:

Originally built circa 1904. I understand that the building was redeveloped circa 2016/2017.

4. Main Construction:

Walls: Main walls to the original building are of stone construction with pointed finish. The building incorporates modern sections at upper floor levels, finished externally with cladding.

Roof: The original main roof to the building was removed as part of the conversion. The roof to the building is of a complex pitched/flat design. The main roof over the central atrium to the building is of steel frame construction incorporating glass panels.

5. Accommodation:

Second Floor: Entrance hallway, open plan lounge, kitchen and W.C.

Upper Floor: Landing, bedroom and bathroom.

Mortgage Valuation Report

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 76

Gross external floor area: 91

7. Garage and Outbuildings:

Residents bin/bike store and bin compounds within the development.

Services / Roads

8 Main Service:

Water: Yes: No:

Electricity: Yes: No:

Gas: Yes: No:

Drainage: Yes: No:

For comments on non-mains services, see section 15.

8a. Heating:

Gas fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

None apparent.

Retention: Yes: No:

Retention amount:

11. Subsidence, Settlement and Landslip:

No obvious evidence of significant movement noted within the limitations of the inspection.

12. General Condition:

The property was unoccupied, furnished and all floors were covered. My inspection of the main roof covering to building was restricted due to the height of the building and roof design.

Mortgage Valuation Report

The property appears to have been well maintained. No obvious significant defects were identified within the limitations of the inspection.

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes:

No:

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes:

No:

15. General Remarks:

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

The property is a listed building and located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Scotland.

The subject property comprises converted flat, set within a former Grade "C" listed school house, now converted into approximately 32 separate residential apartments. I understand that the redevelopment was undertaken circa 2016/2017. In this regard, it is assumed that all necessary Local Authority consents and approvals have been obtained for the construction of the property and appropriate documentation, including Warrants and Completion Certificates, issued. It should be confirmed whether there is a 10 year NHBC warranty or equivalent. It is further assumed that any listed building consents were obtained as part of the conversion.

I have been advised by the vendor that there is one allocated parking space pertaining to the subject property. This can be verified with the Title Deeds.

The Government has issued advice on multi-storey properties where there is cladding or other elements within the external wall system or attachments which may contain combustible material. We suggest the property owners, and/or their agents, produce a written report (EWS1 form), prepared by a suitably qualified independent professional advisor, who is a member of one of the professional bodies approved in Government guidance, to confirm that the subject property meets the relevant requirements.

The valuation assumes that the EWS1 form will satisfy both the purchaser and the purchaser's lender and that no significant expenditure will be incurred in terms of recommended remedial action.

Mortgage Valuation Report

Please note that the surveyor does not warrant the EWS1 form and is not in a position to comment on the EWS1 form or its content.

16. Comments on Mortgageability:

The property will form suitable security for mortgage purposes depending on the purchasers chosen lender and their lending criteria, further reports may be requested by a lender to satisfy themselves on fire safety requirements. Accordingly subsequent reporting to a lender may differ from the Home Report content. Should this be required, our valuation assumes that satisfactory Fire Safety Reports will be acceptable to both the purchaser and the purchaser's lender.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Two Hundred and Twenty-Five Thousand Pounds: £225,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

17.3 Insurance reinstatement: Approximate current reinstatement cost including site clearance and professional fees, excluding VAT except on fees. (words and figures):

Four Hundred and Fifty-Five Thousand Pounds: £455,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Paul Reilly BSc, MRICS 0849273

Date: 11th June 2026

Office Address: DM Hall LLP Chartered Surveyors
3 Centura Court,
Hillington Park
Glasgow
G52 4PR

Tel: 0141 636 4141

email: glasgowresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

2/6 27 Broomhill
Avenue, Broomhill,
Glasgow, G11 7BF

Property Questionnaire

Property Questionnaire

Property Address:

2/6 27 Broomhill Avenue, Broomhill, Glasgow, G11 7BF

Seller(s):

Ryan Metcalfe

Completion Date of Property Questionnaire: 10/06/2026

Note for sellers.

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

Property Questionnaire

1. Length of ownership

How long have you owned the property? 5 Years

2. Council Tax

Which Council Tax band is your property in? D

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	No	Allocated parking space	Yes	Driveway	No
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:			

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? Don't know

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)? No

If you have answered yes, please describe the changes which you have made:

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property? No

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

(ii) Did this work involve any changes to the window or door openings?

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

7. Central Heating

A. Is there a central heating system in your property?

Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

Gas Fired

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed?

8.5 years

C. Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

Property Questionnaire

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	Scottish Power
Water mains/private water supply	Yes	Scottish Water
Electricity	Yes	Scottish Power
Mains Drainage	Yes	Don't Know
Telephone	No	
Cable TV/Satellite	No	
Broadband	Yes	EE

Property Questionnaire

- b. **Is there a septic tank system at your property?** No

If you have answered yes, please answer the two questions below:

- c. **Do you have appropriate consents for the discharge from your septic tank?**
- d. **Do you have a maintenance contract for your septic tank?**

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for a Shared or Common Areas

- a. **Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?** Yes

If you have answered yes, please give details:

Communal Areas, Gardens, Building

- b. **Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?** Yes

If you have answered yes, please give details:

Shares between 33 property owners

- c. **Has there been any major repair or replacement of any part of the roof during the time you have owned the property?** Don't know

- d. **Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?** No

Property Questionnaire

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** No

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** No

If you have answered yes, please give details:

12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** Yes

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

Taylor Martin 4 Berkeley Street, Glasgow, G3 7DW. Deposit held £300. The approximate charges for the last 12 months have been £145 a month.

- b. **Is there a common buildings insurance policy?** Yes

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

Yes

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.** Garden upkeep and wear and tear

Property Questionnaire

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? No

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	Don't know
(ii)	Roofing	Don't know
(iii)	Central heating	No
(iv)	NHBC	Don't know
(v)	Damp course	Don't know

Property Questionnaire

(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	Don't know
------	--	------------

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** Don't know

If you have answered yes, please give details:

15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. **Advising that the owner of a neighbouring property has made a planning application?** No
- b. **That affects your property in some other way.** No
- c. **That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Scotland

Dwellings

Flat 2/6 , 27 Broomhill Avenue, Glasgow, G11 7BF

Dwelling type: Mid-floor maisonette
Date of assessment: 11 June 2026
Date of certificate: 12 June 2026
Total floor area: 76 m²
Primary Energy Indicator: 96 kWh/m²/year

Reference number: 0112-2049-5563-2696-3071
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years*

£1,932

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

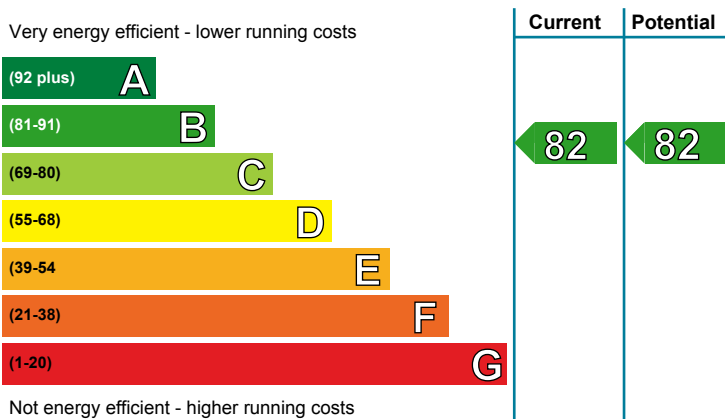


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (82)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

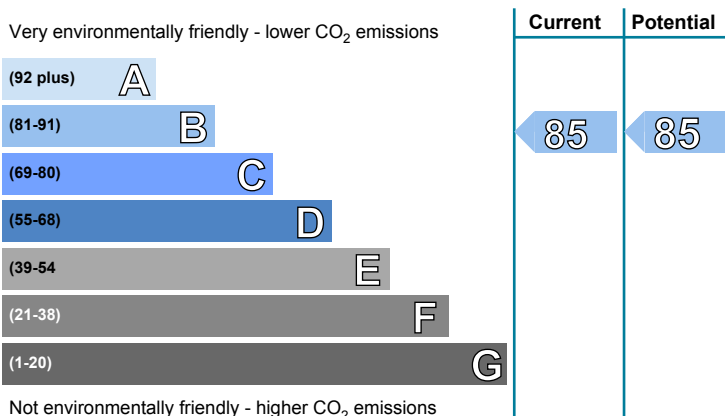

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (85)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, insulated (assumed) System built, as built, insulated (assumed)	★★★★★ ★★★★★	★★★★★ ★★★★★
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 17 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.3 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,230 over 3 years	£1,230 over 3 years	Not applicable
Hot water	£552 over 3 years	£552 over 3 years	
Lighting	£150 over 3 years	£150 over 3 years	
Totals	£1,932	£1,932	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

None

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	3,134.03	N/A	N/A	N/A
Water heating (kWh per year)	2,212.21			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Paul Reilly
Assessor membership number: EES/009388
Company name/trading name: D M Hall Chartered Surveyors LLP
Address: 3 Centura Court
Hillington Park
Glasgow
G52 4PR
Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL