

Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION /





Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

17 LUGAR PLACE, TROON, KA10 7EA

Dwelling type: Detached house

Date of assessment: 03 November 2021

Date of certificate: 03 November 2021

Total floor area: 116 m²

Primary Energy Indicator: 310 kWh/m²/year

Reference number: 9150-2377-7190-2809-7781 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,897	See your recommendations
Over 3 years you could save*	£1,539	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

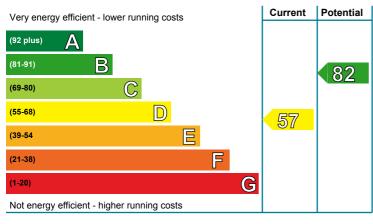


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (57)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

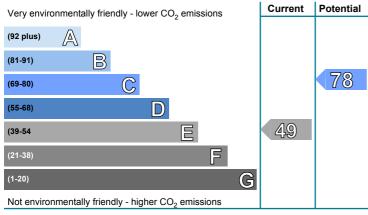

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (49)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£153.00
2 Cavity wall insulation	£500 - £1,500	£426.00
3 Floor insulation (suspended floor)	£800 - £1,200	£276.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed) Cavity wall, as built, insulated (assumed)	***** ****	**** ***
Roof	Pitched, 50 mm loft insulation Pitched, 100 mm loft insulation	***** ***	★★☆☆☆ ★★★☆☆
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, mains gas	****	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system, no cylinder thermostat	***	***
Lighting	No low energy lighting	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 55 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 6.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,646 over 3 years	£1,860 over 3 years	
Hot water	£738 over 3 years	£240 over 3 years	You could
Lighting	£513 over 3 years	£258 over 3 years	save £1,539
Total	£3,897	£2,358	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Increase loft insulation to 270 mm	£100 - £350	£51	D 59	E 51
2	Cavity wall insulation	£500 - £1,500	£142	D 64	D 58
3	Floor insulation (suspended floor)	£800 - £1,200	£92	D 67	D 62
4	Low energy lighting for all fixed outlets	£75	£77	C 69	D 63
5	Solar water heating	£4,000 - £6,000	£152	C 74	C 71
6	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£337	B 82	C 78

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

External insulation with cavity wall insulation

Choosing the right improvement package

saving trust

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

5 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	17,303	(1,169)	(3,267)	N/A
Water heating (kWh per year)	5,312			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:

Assessor membership number:

Company name/trading name:

Address:

Mr. Kenneth Behan

EES/016119

J & E Shepherd

22 Miller Road

22 Miller Ro Ayrshire Ayr

Phone number: 01292 267 987
Email address: ayr@shepherd.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Scottish Single Survey



survey report on:

Property address	17 LUGAR PLACE TROON KA10 7EA		
Customer			
Customer address			
Prepared by	J & E Shepherd		
Date of inspection	3rd November 2021		



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise an extended detached house.
Accommodation	Ground Floor - Entrance Porch, Internal Hallway, Living Room, Dining Room, Kitchen, Sitting Room and Shower Room with WC. First Floor - Three Bedrooms and Bathroom with WC.
Gross internal floor area (m²)	119
Neighbourhood and location	Similar style private built dwellings within the town of Troon and convenient for local amenities.
Age	Circa 1970.
Weather	Dry and sunny.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. None.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

	The roof is pitched and overlaid with concrete tiles with the rear extension being of similar construction. Access to the main roof space was via a ceiling hatch and was found to be of timber framed construction overlaid with plasterboard. Access to a small area of roof space above the rear extension revealed the roof to be of pre-fabricated timber framed construction overlaid with plyboard.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	PVC gutters and downpipes.
	The gallote and demipipeer
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are of cavity brick/block construction finished with a roughcast render. The rear extension is of cavity blockwork construction.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Windows are mainly aluminium framed sealed unit double glazing with similar doors. There are PVC and timber fascias at gutter level.
External decorations	Visually inspected.
	Painted joinery.
Conservatories / porches	Visually inspected.
	Brick entrance porch to the front of the building with timber framed double glazed windows and a pitched tile clad roof.
	N/A
Communal areas	N/A
Garages and permanent outbuildings	Visually inspected.
	Single attached garage of brick construction. The roof is a combination of flat profile overlaid with felt and pitched/ overlaid with concrete tiles. The garage is accessed via a metal up and over door (not tested) and a rear timber door.

Outside areas and boundaries	Visually inspected.
	Private gardens to the front, side and rear of the building overlaid in a mixture of lawn, concrete paving and mono block driveway providing off street parking. Boundaries are defined with where seen with timber fencing.
Ceilings	Visually inspected from floor level.
	Plaster lined.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Plaster lined.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Suspended timber flooring.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Internal joinery comprises timber skirting and door surrounds, a timber tread and riser staircase and internal doors are timber panel units. Kitchen fittings comprise basic wall and floor mounted units.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	Within the living room there is a fireplace housing an electric fire.
Internal decorations	Visually inspected.
	Paper, paint and tile.
0.11	None
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Electricity is from the mains grid with the meter and fuse box located in an under stair cupboard.

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Gas appears to be from the mains supply.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Cold water is from the mains supply and where seen plumber fittings are of copper and PVC pipework. The sanitary arrangements comprise three piece coloured suites within the shower room and bathroom.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Gas central heating via radiators. The gas boiler also appears to provide hot water on demand and is located within the garage.
Drainage	Drainage covers etc. were not lifted.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested.
Drainage	
Pire, smoke and burglar alarms	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main
	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.
	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. Visually inspected. No tests whatsoever were carried out to the system or
	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. Visually inspected. No tests whatsoever were carried out to the system or appliances.
	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. Visually inspected. No tests whatsoever were carried out to the system or appliances.
Fire, smoke and burglar alarms	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke alarm present.
Fire, smoke and burglar alarms	Neither drains nor drainage systems were tested. All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested. Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke alarm present. For flats / maisonettes Only the subject flat and internal communal areas giving

condition and standard of maintenance.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.


Windows and external doors were not all fully opened or tested.

No access was available to any sub-floor areas.

Our inspection of the roof void was limited to a head and shoulders inspection only which was further restricted by storage items and insulating material.

The garage door was not opened or tested.

Sectional Diagram showing elements of a typical house

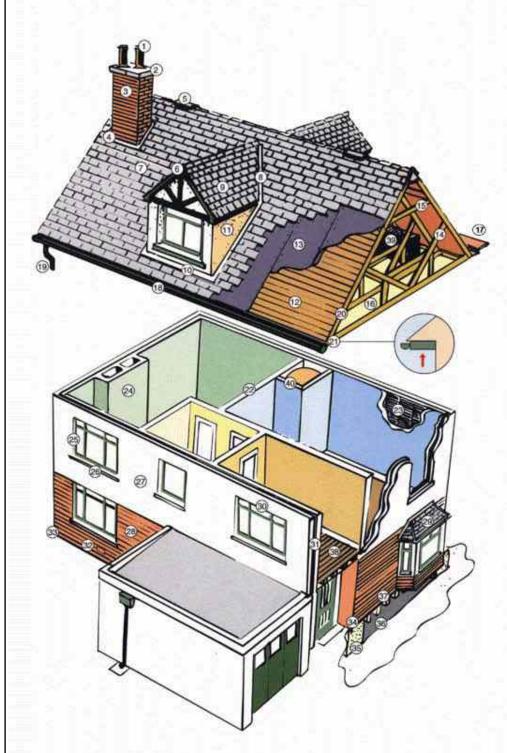

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- (2) Coping stone
- 3) Chimney head
- 4) Flashing
- 5) Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 17) Parapet gutter
- (18) Eaves guttering
- 19) Rainwater downpipe
- Verge boards /skews
- (21) Soffit boards
- (22) Partition wall
- 23 Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- (6) Window sills
- (27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
 - Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	Evidence of settlement/movement has affected the building reflected by flooring and door frames being slightly off level. On the basis of a single inspection this appears longstanding with no evidence of recent movement apparent.

Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

Chimney stacks	
Repair category	-
Notes	N/A

Roofing including roof space	
Repair category	2
Notes	Roof coverings are original and worn. Regular routine maintenance expenditure/more extensive overhaul work should be anticipated. One or two tiles were noted to be cracked.

Rainwater fittings	
Repair category	1
Notes	Within the limitations of our inspection rainwater goods were seen to be free from significant defect.

Main walls	
Repair category	2
Notes	Corrosion to metal window lintels. Several render cracks were noted in particular to the rear extension which should be monitored as a precaution and filling of the cracks is now required.

Windows, external doors and joinery	
Repair category	2
Notes	Aluminium framed windows are of an age and style where upgrading should now be anticipated. Several failed double glazed units were noted. Decay was also noted to timber window and door surrounds.

External decoration	s
Repair category	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches	
Repair category	2
Notes	Failed double glazed seal.

Communal areas	
Repair category	-
Notes	N/A

Garages and permanent outbuildings	
Repair category	2
Notes	Flat roof coverings will have a limited life span only. Decay to timber entrance door.

Outside areas and boundaries	
Repair category	1
Notes	One or two cracked concrete tiles. Slight render damage at entrance steps.

Ceilings	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Kitchen fittings are of an age and style where upgrading should now be anticipated.

Chimney breasts and fireplaces	
Repair category	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.

Internal decorations	
Repair category	1
Notes	Normal decoration required.

Cellars	
Repair category	-
Notes	N/A

Electricity	
Repair category	2
Notes	The electrical system is along dated lines and re-wiring should now be anticipated. No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.

Gas	
Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings				
Repair category	2			
Notes	Sanitary fittings are of an older style and upgrading may now be required.			

Heating and hot water		
Repair category	2	
Notes	There is a modern gas fired boiler however radiators are of an older style and pipework was microbore. Future upgrading in this respect may be required. There was no view of any hot water storage tanks.	

Drainage	
Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	2
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and first
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The subjects have been altered and extended over the years to form the current accommodation including a large single store extension to the rear and the addition of a front porch and garage. Our valuation assumes that all necessary consents and documentation are available in this respect.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £310000 (Three Hundred and Ten Thousand Pounds) This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £225000 (Two Hundred and Twenty Five Thousand Pounds)

Signed	Security Print Code [492258 = 7638] Electronically signed
Report author	Kenneth Behan
Company name	J & E Shepherd
Address	22 Miller Road, Ayr, Ayrshire, KA7 2AY
Date of report	5th November 2021



Property Address	
Address	17 LUGAR PLACE, TROON, KA10 7EA
Seller's Name Date of Inspection	3rd November 2021
Property Details	
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	X Detached Semi detached Mid terrace End terrace
	Back to back High rise block Low rise block Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No ilitary, police?
Flats/Maisonettes only	y Floor(s) on which located No. of floors in block Lift provided? Yes No
Approximate Year of	No. of units in block Construction 1970
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	3 Living room(s) 3 Bedroom(s) 1 Kitchen(s)
Crass Floor Area (ave	2 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)
•	cluding garages and outbuildings) 119 m² (Internal) m² (External)
Residential Liement (greater than 40%) X Yes No
Garage / Parking / (Outbuildings
X Single garage	□ Double garage □ Parking space □ No garage / garage space / parking space
Available on site?	X Yes No
Permanent outbuilding	gs:
None.	

Construction							
Walls	X Brick	Stone	Concrete	Timber frame	Othe	er (specify in Ger	neral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Othe	er (specify in Ger	neral Remarks)
Special Risks							
Has the property s	suffered struc	ctural movem	ent?			X Yes	☐ No
If Yes, is this recei	nt or progres	sive?				Yes	X No
Is there evidence, immediate vicinity	•	eason to antic	ipate subsidence	, heave, landslip	or flood in th	e Yes	X No
If Yes to any of the	e above, pro	vide details in	General Remark	KS.			
Service Connec	tions						
Based on visual in of the supply in Ge			ices appear to be	e non-mains, plea	se comment	on the type a	and location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description o	f Central Hea	ating:					
Gas central heati	ing via radiat	ors- not teste	d.				
Site							
Apparent legal iss	ues to be ve	rified by the c	onveyancer. Ple	ase provide a brie	of description	n in General R	lemarks.
Rights of way	Shared dri	ves / access	Garage or other	amenities on separate	e site Sha	ared service conr	nections
Ill-defined boundari	ies	Agricu	tural land included w	ith property	Oth	er (specify in Ge	neral Remarks)
Location							
X Residential suburb	Re	esidential within to	own / city Mixe	ed residential / comme	ercial Ma	inly commercial	
Commuter village	Re	emote village	Isola	ated rural property	Oth	er (specify in Ge	neral Remarks)
Planning Issues	;						
Has the property b	een extende	ed / converted	/ altered? X	Yes No			
If Yes provide deta	ails in Gener	al Remarks.					
Roads							
Made up road	Unmade roa	ad Partly	completed new road	Pedestrian a	access only	X Adopted	Unadopted

General Remarks
The subjects are located within an established residential area of similar style private built dwellings within the town of Troon and convenient for local amenities.
At the time of inspection the property was found to be in need of a degree of internal modernisation/re-decoration. Several items of repair and maintenance were noted most of which are generally thought to be manageable through a course of routine maintenance expenditure.
Extended to the side and rear.
Essential Repairs
None.

Retention recommended? Yes X No

Estimated cost of essential repairs £

Amount £

Comment on Mortgageability				
The property forms suitable mortgage provider.	le security for mortgage purposes subject to the specific lending criteria o	f any		
Valuations				
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?				
Buy To Let Cases				
month Short Assured Tenai	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? here there is a steady demand for rented accommodation of this type?	£ Yes No		
Declaration	nore there is a steady demand for remod decembroaction of this type.			
Deciaration				
Signed	Security Print Code [492258 = 7638] Electronically signed by:-			
Surveyor's name	Kenneth Behan			
Professional qualifications	BSc MRICS			
Company name	J & E Shepherd			
Address	22 Miller Road, Ayr, Ayrshire, KA7 2AY			
Telephone	01292 267987			
Fax 01292 611521				
Report date 5th November 2021				





Property address	17 LUGAR PLACE TROON KAID TEA.
Seller(s)	
Completion date of property questionnaire	

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Leng	th of ov	wnersh	ip						
	How	long ha	ıve you	owne	d the	prope	rty?			
	Cour	cil tax								
	Whic	h Coun	cil Tax	band i	s you	prop	erty in	? (Pleas	se circle)	
	A	В	С	D	E	F	G	Н		
	Parki	ng								
	What	are the	arran	gemen	ts for	parkir	ng at y	our pro	perty?	
	(Pleas	se tick a	all that	apply));					
	•	Garag	je							
	•	Alloca	ited pa	rking s	space					
	•	Drive	vay						п	
	•	Share	d parki	ing						
	•	On str	eet			[
	•	Reside	ent per	mit		[
	•	Meter	ed parl	cing		[
	•	Other	(please	speci	ify):					
	Conse	rvation	area					· · · · · · · · · · · · · · · · · · ·		
	specia	r prope Il archit ch it is	ectura	l or his	storica	ıl inter	est, th	e chara	(that is an area of acter or appearanc	Yes/No/ e Don't know

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes/No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes/No
	If you have answered yes, please describe below the changes which you have made: Extra lexing room, letelity area and Shower room added to back of property	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	(Yes)No
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
).	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes/No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No
	(ii) Did this work involve any changes to the window or door openings?	Yes.(No
	(iii) Please describe the changes made to the windows doors, or patio doo approximate dates when the work was completed):	rs (with
	Please give any guarantees which you received for this work to your solicit agent.	tor or estate

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes/No/ Partial
	If you have answered yes or partial – what kind of central heating is there?	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	If you have answered yes, please answer the three questions below:	
	i) When was your central heating system or partial central heating system installed?	Boiler apple
	(ii) Do you have a maintenance contract for the central heating system?	(Yes/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	John Moffet	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year). - January 2021 -	
	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes (No)
	Issues that may have affected your property	
	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes/(No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes(No
	Are you aware of the existence of asbestos in your property?	Yes/No)
	If you have answered yes, please give details:	

10.	Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas	V	Scottish GAS
Water mains or private water supply	/	Scottish
Electricity	/	Scottish Electricity
Mains drainage	/	MA
Telephone	/	Virgin media
Cable TV or satellite	~	Virgin media
Broadband		Virgin media

		parante.
b.	Is there a septic tank system at your property?	Yes(No
	If you have answered yes, please answer the two questions below:	
	(i) Do you have appropriate consents for the discharge from your septic tank?	Yes/No/ Don't know
	(ii) Do you have a maintenance contract for your septic tank?	Yes/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	

common areas	
ibility to contribute to the costhe repair of a shared drive, pa? ase give details:	
stribute to repair and mainten or other common areas? ase give details:	ance Yes/No/ Not applicable
air or replacement of any part ave owned the property?	t of Yes/No
over any of your neighbours' out your rubbish bin or to ase give details:	Yes(No)
ny of your neighbours have the example to put out their rubbaries?	
re a public right of way acros blic right of way is a way over pass, whether or not the land ase give details:	r
property	
ć	ase provide the name and addit held and approximate charg

b.	Is there a common buildings insurance policy?	Yes/No/ Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes/No/ Don't know
C.	Please give details of any other charges you have to pay on a regular upkeep of common areas or repair works, for example to a reside maintenance or stair fund.	
13.	Specialist works	8.
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes/No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	Yes/No
	If you have an every seed to a decide of the seed have a seed of the seed of t	Very (b) o
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	Yes/No

	Guarantees					
a.	Are there any guarantees or warrantie	es for any	of the follo	wing:		
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost
(ii)	Roofing	No	Yes	pon't know	With title deeds	Lost
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost
(iv)	National House Building Council (NHBC)	No	Yes	Don't know	With title deeds	Lost
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost
b.	If you have answered 'yes' or 'with title installations to which the guarantee(s			e details of t	he work o	r
c.	Are there any outstanding claims und		the guaran	tees listed a	bove?	Yes/No
-4 100	Boundaries					
15.	So far as you are aware, has any bour			v 1		Yes/

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	(Yes)No
b.	that affects your property in some other way?	Yes No
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No
	If you have answered yes to any of a-c above, please give the notices to your estate agent, including any notices which arrive at any time before the date of the purchaser of your property.	solicitor or f entry of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): Signature(s): 3/11/2021

