

HOME REPORT

5 BARR CRESCENT
LARGS
KA30 8PX



DM HALL
CHARTERED SURVEYORS

ENERGY PERFORMANCE CERTIFICATE



DM HALL
CHARTERED SURVEYORS

Energy Performance Certificate (EPC)

Scotland

Dwellings

5 BARR CRESCENT, LARGS, KA30 8PX

Dwelling type: Detached house
Date of assessment: 08 February 2022
Date of certificate: 09 February 2022
Total floor area: 124 m²
Primary Energy Indicator: 381 kWh/m²/year


Reference number: 1812-3522-1100-0328-3202
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,704	See your recommendations report for more information
Over 3 years you could save*	£1,650	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

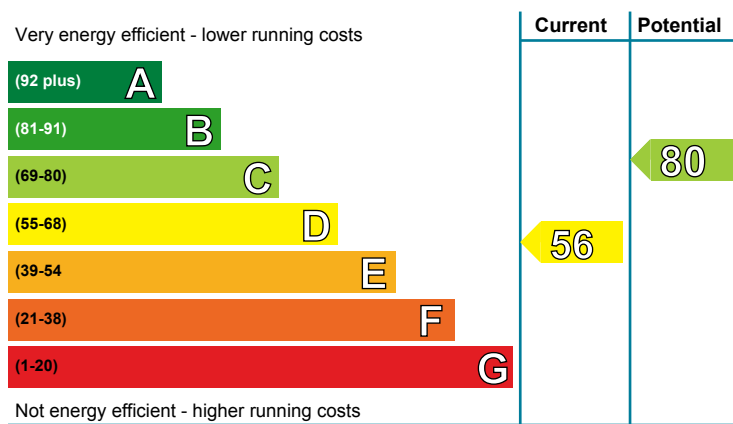


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (56)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

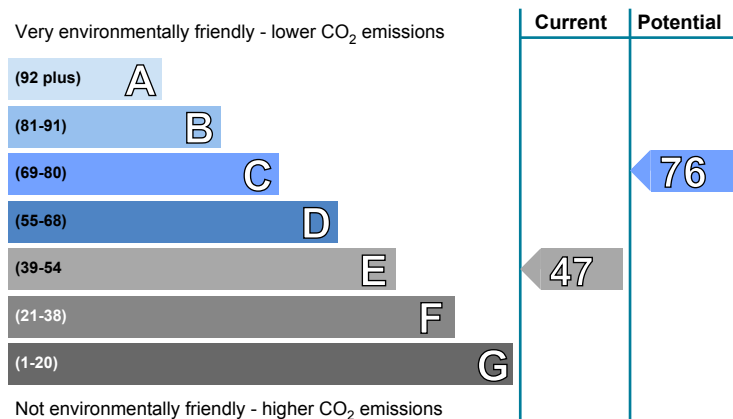

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£852.00
2 Cavity wall insulation	£500 - £1,500	£339.00
3 Floor insulation (suspended floor)	£800 - £1,200	£375.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, partial insulation (assumed)	★★★☆☆	★★★☆☆
Roof	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 85% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 67 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 4.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£4,101 over 3 years	£2,532 over 3 years	
Hot water	£288 over 3 years	£207 over 3 years	
Lighting	£315 over 3 years	£315 over 3 years	
Totals	£4,704	£3,054	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Room-in-roof insulation	£1,500 - £2,700	£284		
2 Cavity wall insulation	£500 - £1,500	£113		
3 Floor insulation (suspended floor)	£800 - £1,200	£125		
4 Solar water heating	£4,000 - £6,000	£27		
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£326		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	30,907	(362)	(2,758)	N/A
Water heating (kWh per year)	2,295			

Addendum

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Kevin Masson
Assessor membership number:	EES/020018
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	45 Bank Street Irvine KA12 0LL
Phone number:	01294 311070
Email address:	enquiries@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



DM HALL
CHARTERED SURVEYORS

Single Survey

survey report on:

Property address	5 BARR CRESCENT LARGS KA30 8PX
Customer	MRS HAZEL WALKER
Customer address	
Prepared by	DM Hall LLP
Date of inspection	8th February 2022



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	A detached single storey and attic chalet styled villa.
Accommodation	GROUND FLOOR: Entrance Vestibule, Hallway, Lounge, Inner Stairwell, Family Room, Shower Room, Two Bedrooms and Kitchen/Dining Room. FIRST FLOOR: Landing, Two Bedrooms and WC.
Gross internal floor area (m²)	Approximately 124 square metres.
Neighbourhood and location	The property is situated within an established residential area where surrounding properties are of a similar age and style. Local amenities can be found within a reasonable commute.
Age	Built circa 1935 (approximately 87 years old).
Weather	Overcast with intermittent rain showers. Weather over recent weeks has been unsettled.
Chimney stacks	None.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Single Survey

	<p>The roof is of pitched/hipped design and is overlaid with tiles with a tiled ridge. There are also sections of flat roof which appear to be overlaid with felt or a similar material and tiled hung features at the dormer projections.</p> <p>I was able to gain a partial view of the roof structure via an eaves hatch within the upstairs bedrooms. The roof is of timber truss construction with timber sarking boards. Glasswool insulation has been laid in between the ceiling joists.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Gutters and downpipes are formed in cast iron and PVC materials.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The outer walls are assumed to be of cavity brick construction with a rendered finish. The rear extension is assumed to be of timber frame/brick construction with a rendered finish.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Access to the property is via PVC and glazed doors to the entrance vestibule and kitchen/diner. There is also a PVC glazed door between the entrance vestibule and hallway.</p> <p>The subjects are fitted with UPVC double glazed windows and timber velux windows.</p> <p>Fascia and soffit boards are formed in PVC materials and timber.</p>
External decorations	<p>Visually inspected.</p> <p>Generally painted/varnished.</p>
Conservatories / porches	None.
Communal areas	None.

Single Survey

Garages and permanent outbuildings	Visually inspected. There is a single detached garage within the rear garden. This appears to be of concrete panel construction under a flat roof overlaid with felt or a similar material.
Outside areas and boundaries	Visually inspected. Garden grounds are hard landscaped and laid to lawn. These are bounded by hedging, timber fencing and brick walls.
Ceilings	Visually inspected from floor level. Assumed to be of lath and plaster materials with other areas dry lined with plasterboard sheets.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Plastered on the hard with other areas dry lined with plasterboard sheets.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Flooring appears to be of suspended timber overlaid with what I have assumed to be tongue and groove boarding.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. There are floor and wall mounted units within the kitchen. Internal doors are of timber and glazed design.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There are electric fires within the lounge and family room. All other fireplaces appear to have been removed and boarded over.
Internal decorations	Visually inspected. Generally painted and papered with tiling and timber cladding in the kitchen/diner and wet wall and a PVC ceiling in the shower room.

Single Survey

Cellars	None.
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The consumer unit and meter and located within the entrance vestibule. Visible wiring is of PVC coated cabling and there are electrical sockets throughout.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply. The meter is assumed to be located in an external box.</p>
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply. Visible pipework is of copper and PVC materials.</p> <p>The shower room comprises of a mains shower cubicle, wc and sink.</p> <p>The wc consists of a low level wc and sink.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Space heating is provided by a gas fired system of radiators throughout. The system is fired by the 'Vaillant' boiler which is located within the study/stairwell.</p>
Drainage	<p>Drainage covers etc. were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is assumed to be connected to the main sewer.</p>

Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke detectors and a burglar alarm have been installed but not tested.
Any additional limits to inspection	<p>At the time of inspection the property was vacant although fully furnished with a variety of fitted and fixed floor coverings in place. Furnishings, personal items (particularly in cupboards) and floor coverings have not been moved.</p> <p>Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate, however this was limited due to furnishings restricting access.</p> <p>Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>My inspection of the eaves areas was limited to a head only inspection and was generally limited to the area around the access hatch only. My overall inspection was further restricted due to a high volume of stored items and insulation materials. These have not been disturbed.</p> <p>I was unable to open the ceiling hatch within an upstairs bedroom due to pipes restricting access.</p> <p>I was unable to view flat sections of roof.</p> <p>My inspection of the garage was severely limited due to a high volume of stored items within.</p> <p>I was unable to view the garage roof.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.</p> <p>The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.</p>

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Legislation by the Scottish Government, due to take effect from February 2022, requires residential properties to have a system of inter-linked smoke alarms, carbon monoxide detectors and heat detectors. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey

2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.


 Structural movement	
Repair category	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.


 Dampness, rot and infestation	
Repair category	2
Notes	<p>There is evidence of condensation in various locations. This may be alleviated by a proper balance of heating and ventilation.</p> <p>Elevated moisture readings were recorded to some sections of chimney breasts within the property and there is a risk of further dampness in concealed parts of the building. Prolonged dampness increases the risk of timber defects. It is important to remedy water ingress timeously to prevent deterioration of the building fabric.</p> <p>There is evidence of a wood boring insect infestation to visible timbers in the roof space and there is a risk of further infestation in concealed parts of the building. This can be treated by a timber/specialist contractor.</p>


 Chimney stacks	
Repair category	-
Notes	N/A.


 Roofing including roof space	
Repair category	2
Notes	There are a number of chipped and missing tiles. A licensed roofing contractor can inspect and advise further. Rosemary roof tiles can become brittle and delaminate as a result of frost, weathering or chemical damage. Inspection at close quarters may reveal further deterioration/damage to roofing materials,

	<p>especially where these are original.</p> <p>Flat roofs are often overlaid with a material that has a limited life expectancy and can fail without warning. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. A reputable roofing contractor will be able to provide further advice.</p> <p>Water staining/decay was evident to visible timbers in the roof space.</p> <p>There is evidence of a wood boring insect infestation to visible timbers in the roof space (see section dampness, rot and infestation). This can be treated by a timber/specialist contractor.</p>
--	--

 Rainwater fittings	
Repair category	2
Notes	Staining was evident around joints and corrosion was evident to cast iron sections.


 Main walls	
Repair category	2
Notes	General weathering and loose, cracked and damaged render was noted.


 Windows, external doors and joinery	
Repair category	2
Notes	<p>The window units are of mixed ages and some appear to be of an older type. Wear and tear was noted to mechanisms. The seals to double glazed units can often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.</p> <p>The seals to some of the double glazed window units have already failed resulting in condensation between the panes of glass.</p> <p>General weathering and timber decay was noted to timber fascia boards.</p>


 External decorations	
Repair category	1
Notes	No significant defects evident.


Single Survey


 Conservatories/porches	
Repair category	-
Notes	N/A.







 Communal areas	
Repair category	-
Notes	N/A.

 Garages and permanent outbuildings	
Repair category	2
Notes	<p>A degree of general repair and maintenance is required to the garage.</p> <p>Flat sections of roofing are clad with materials of a limited life expectancy. From ground level damaged/weathered roofing material indicates that repair/replacement may be required. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. A reputable roofing contractor can provide further advice.</p> <p>Water staining was evident to internal ceiling and wall linings within the garage.</p>

 Outside areas and boundaries	
Repair category	2
Notes	<p>Cracked and damaged render was noted to boundary walls.</p> <p>There are mature trees growing within influencing distance of the boundaries. A tree surgeon will be able to provide further advice.</p>

 Ceilings	
Repair category	2
Notes	<p>Surface cracking was noted. Water staining was also evident, however, I was unable to test these areas and the situation will require to be monitored.</p> <p>The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.</p>

 Internal walls	
Repair category	1
Notes	<p>The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.</p>

 Floors including sub-floors	
Repair category	1
Notes	<p>Creaking was noted within some apartments.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p>
 Internal joinery and kitchen fittings	
Repair category	2
Notes	<p>A degree of wear and tear was noted.</p> <p>Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.</p> <p>The staircase may not comply with current day Building Standards. The prospective purchaser should fully satisfy themselves in that regard.</p>
 Chimney breasts and fireplaces	
Repair category	2
Notes	Damp staining and elevated moisture readings were recorded. See section Dampness, rot and infestation.
 Internal decorations	
Repair category	1
Notes	A degree of general wear and tear was noted.
 Cellars	
Repair category	-
Notes	N/A.
 Electricity	
Repair category	2
Notes	<p>There are aspects of the electrical installation which may not satisfy current day needs with there being skirting mounted sockets. The fuse box may also no longer comply with current day regulations.</p> <p>It is recommended that all electrical installations be checked every five years or</p>

Single Survey

	on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.
--	---



Gas

Repair category	1
Notes	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.



Water, plumbing and bathroom fittings

Repair category	1
Notes	No significant defects evident. It should be appreciated that seals around shower areas and sanitary fittings can be troublesome and do require regular maintenance. Failure to seals can result in dampness/decay to adjoining/underlying areas.



Heating and hot water

Repair category	2
Notes	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation. There are older style radiators which may not satisfy current day needs.



Drainage

Repair category	1
Notes	No significant defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	1
Cellars	-
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Single Survey

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

I am not aware of any recent alterations or extension which have taken place. The property may have been altered in the past with the formation of bedroom accommodation within the roof space and a small extension to the rear. However this work appears to be of a historic nature. A prospective purchaser may wish to fully satisfy themselves in this regard.

There appears to be an area of shared garden grounds to the rear of the property and this should be confirmed.

Estimated reinstatement cost for insurance purposes

£290,000 (TWO HUNDRED AND NINETY THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments

£325,000 (THREE HUNDRED AND TWENTY FIVE THOUSAND POUNDS).

Demand in line with prevailing market conditions is anticipated.

The market presently demonstrates an imbalance between supply and demand generally across all price sectors. As a result competition between buyers is often leading to premium prices being paid that reflect the prevailing market conditions but may not be sustainable. The reported valuation figure reflects these market conditions but equally may not be sustainable if and when market conditions change.

Signed	Security Print Code [431323 = 8375] Electronically signed
Report author	Kevin Masson
Company name	DM Hall LLP
Address	45 Bank Street, Irvine, KA12 0LL
Date of report	10th February 2022

Mortgage Valuation Report



Property Address

Address 5 BARR CRESCENT, LARGS, KA30 8PX
Seller's Name MRS HAZEL WALKER
Date of Inspection 8th February 2022

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None
Electricity Mains Private None
Central Heating Yes Partial None
Water Mains Private None
Gas Mains Private None

Brief description of Central Heating:

Gas fired system to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

In general the property was found to be in fair order having regard to age and style of construction. No obvious significant defects which would affect value or security were in evidence.

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

I am not aware of any recent alterations or extension which have taken place. The property may have been altered in the past with the formation of bedroom accommodation within the roof space and a small extension to the rear. However this work appears to be of a historic nature. A prospective purchaser may wish to fully satisfy themselves in this regard.

There appears to be an area of shared garden grounds to the rear of the property and this should be confirmed.

Essential Repairs

None apparent.

Estimated cost of essential repairs £

Retention recommended? Yes No

Amount £

Mortgage Valuation Report

Comment on Mortgageability

The subjects should form suitable security for normal mortgage lending subject to individual lenders guidelines and criteria.

The market presently demonstrates an imbalance between supply and demand generally across all price sectors. As a result competition between buyers is often leading to premium prices being paid that reflect the prevailing market conditions but may not be sustainable. The reported valuation figure reflects these market conditions but equally may not be sustainable if and when market conditions change.

Valuations

Market value in present condition	£	<input type="text" value="325,000"/>
Market value on completion of essential repairs	£	<input type="text" value="-"/>
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£	<input type="text" value="290,000"/>
Is a reinspection necessary?	<input type="checkbox"/> Yes	<input checked="" type="checkbox"/> No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£	<input type="text" value="-"/>
Is the property in an area where there is a steady demand for rented accommodation of this type?	<input type="checkbox"/> Yes	<input type="checkbox"/> No

Declaration

Signed	Security Print Code [431323 = 8375] Electronically signed by:-
Surveyor's name	Kevin Masson
Professional qualifications	BSc (Hons) MRICS
Company name	DM Hall LLP
Address	45 Bank Street, Irvine, KA12 0LL
Telephone	01294 311070
Fax	01294 311077
Report date	10th February 2022

PROPERTY QUESTIONNAIRE



DM HALL
CHARTERED SURVEYORS

property questionnaire

Property Address	5 Barr Crescent Largs Ayrshire KA30 8PX
-------------------------	--

Seller(s)	Execs of Mrs N Baptie
------------------	-----------------------

Completion date of Property Questionnaire	05/02/2022
--	------------

Note for sellers

- Please complete this form carefully. It is important your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell you solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of Ownership
	How long have you owned the property? 30 years
2.	Council Tax
	Which Council Tax band is your property in? <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input checked="" type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage <input checked="" type="checkbox"/> Allocated parking space <input type="checkbox"/> Driveway <input checked="" type="checkbox"/> On street <input type="checkbox"/> Resident Permit <input type="checkbox"/> Metered parking <input type="checkbox"/> Shared parking <input type="checkbox"/> Other (please specify)

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/Additions/Extensions	
a.	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example provision of an extra bath/shower room, toilet or bedroom)? <u>If you have answered yes</u>, please describe below the changes which you have made:</p> <p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</p>	<p>No</p> <p>Please select</p>
b.	<p>Have you had replacement windows, doors, patio doors or double-glazing installed in your property? If you have answered yes, please answer the three questions below:</p> <p>(i) Were the replacements the same shape and type as the ones you replaced?</p> <p>(ii) Did this work involve any changes to the window or door openings?</p> <p>(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):</p>	<p>Yes</p> <p>Yes</p> <p>No</p>
7.	Central heating	

property questionnaire

	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).</p> <p><u>If you have answered yes or partial</u> – what kind of central heating is there?</p> <p>gas</p> <p>(examples: gas-fired, solid fuel, electric storage heating, gas-warm air).</p> <p>If you have answered yes, please answer the three questions below:</p>	<p>Yes</p>
	<p>(i) When was your central heating system or partial central heating system installed?</p> <p>replacement boiler 2 to 3 years ago</p> <p>(ii) Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p> <p>British Gas</p> <p>(iii) When was your maintenance agreement last renewed? (Please provide the month and year).</p> <p>2/10/21</p>	<p>Yes</p>
<p>8.</p>	<p>Energy Performance Certificate</p>	
	<p>Does your property have an Energy Performance Certificate, which is less than 10 years old?</p>	<p>No</p>
<p>9.</p>	<p>Issues that may have affected your property</p>	
<p>a.</p>	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p><u>If you have answered yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p>No</p> <p>Please select</p>
<p>b.</p>	<p>Are you aware of the existence of asbestos in your property?</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>No</p>
<p>10.</p>	<p>Services</p>	

<p>a.</p>	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="0"> <thead> <tr> <th style="text-align: left;">Services</th> <th style="text-align: center;">Connected</th> <th style="text-align: left;">Supplier</th> </tr> </thead> <tbody> <tr> <td>EON</td> <td></td> <td></td> </tr> <tr> <td>Gas or liquid petroleum gas</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td></td> </tr> <tr> <td>Scottish Water</td> <td></td> <td></td> </tr> <tr> <td>Water mains or private water supply</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td></td> </tr> <tr> <td>EON</td> <td></td> <td></td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td></td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td></td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;"><input checked="" type="checkbox"/></td> <td></td> </tr> <tr> <td>BT</td> <td></td> <td></td> </tr> <tr> <td>Cable TV or satellite</td> <td style="text-align: center;"><input type="checkbox"/></td> <td></td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;"><input type="checkbox"/></td> <td></td> </tr> </tbody> </table>	Services	Connected	Supplier	EON			Gas or liquid petroleum gas	<input checked="" type="checkbox"/>		Scottish Water			Water mains or private water supply	<input checked="" type="checkbox"/>		EON			Electricity	<input checked="" type="checkbox"/>		Mains drainage	<input checked="" type="checkbox"/>		Telephone	<input checked="" type="checkbox"/>		BT			Cable TV or satellite	<input type="checkbox"/>		Broadband	<input type="checkbox"/>		
Services	Connected	Supplier																																				
EON																																						
Gas or liquid petroleum gas	<input checked="" type="checkbox"/>																																					
Scottish Water																																						
Water mains or private water supply	<input checked="" type="checkbox"/>																																					
EON																																						
Electricity	<input checked="" type="checkbox"/>																																					
Mains drainage	<input checked="" type="checkbox"/>																																					
Telephone	<input checked="" type="checkbox"/>																																					
BT																																						
Cable TV or satellite	<input type="checkbox"/>																																					
Broadband	<input type="checkbox"/>																																					
<p>b.</p>	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p> <p>(i) Do you have appropriate consents for the discharge from your septic tank?</p> <p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<p>No</p> <p>Please select</p> <p>Please select</p>																																				

11.	Responsibilities for shared or common areas	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes</u>, please give details:</p>	No

property questionnaire

f.	<p>As far as you are aware, is there a public right of way across any part of your property (public right of way is a way over privately-owned)?</p> <p><u>If you have answered yes</u>, please give details:</p>	<p>No</p>
<p>12. Charges associated with your property</p>		
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes</u>, please provide the name and address, and give details of any deposit held and approximate charges:</p>	<p>No</p>
b.	<p>Is there a common buildings insurance policy?</p> <p><u>If you have answered yes</u>, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>No</p> <p>Please select</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	

13.	Specialist works	
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	No
b.	<p>As far as you were aware, has any preventative work for dry rot, wet rot, or damp, ever been carried out to your property? <u>If you have answered yes</u>, please give details:</p>	No
c.	<p><u>If you have answered yes</u> to 13(a) or (b), do you have any guarantees relating to this work? <u>If you have answered yes</u> these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:</p>	Please select

14.	Guarantees	
a.	<p>Are there any guarantees or warranties for any of the following:</p> <ul style="list-style-type: none"> (i) Electrical work (ii) Roofing (iii) Central heating (iv) National House Building Council (NHBC) (v) Damp course (vi) Any other work or installations (for example, cavity wall insulation, underpinning, indemnity policy) 	<p>No</p> <p>Don't Know</p> <p>Don't Know</p> <p>No</p> <p>No</p> <p>No</p>
b.	<p>If you have answered yes or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</p>	
c.	<p>Are there any outstanding claims under any of the guarantees listed above?</p> <p><u>If you have answered yes</u>, please give details:</p>	No
15.	Boundaries	
	<p>So far as you are aware, has any boundary of your property been moved in the last 10 years?</p> <p><u>If you have answered yes</u>, please give details:</p>	No

16.	Notices that affect your property	
<p>a. advising that the owner of a neighbouring property has made a planning application?</p> <p>b. that affects your property in some other way?</p> <p>c. that requires you to do any maintenance, repairs or improvements to your property?</p>	<p>In the past three years have you ever received a notice:</p>	<p>No</p> <p>No</p> <p>No</p>
<p><u>If you have answered yes to any of a–c above</u>, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</p>		

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): _____

Date: _____

DM Hall Offices

Aberdeen
01224 594172

Ayr
01292 286974

Cumbernauld
01236 618900

Cupar
01334 844826

Dumfries
01387 254318

Dundee
01382 873100

Dunfermline
01383 621262

Edinburgh
0131 477 6000

Elgin
01343 548501

Falkirk
01324 628321

Galashiels
01896 752009

Glasgow (North)
0141 332 8615

Glasgow (South)
0141 636 4141

Hamilton
01698 284939

Inverness
01463 241077

Inverurie
01467 624393

Irvine
01294 311070

Kirkcaldy
01592 598200

Livingston
01506 490404

Musselburgh
0131 665 6782

Oban
01631 564225

Paisley
0141 887 7700

Perth
01738 562100

Peterhead
01779 470220

Stirling
01786 475785

DMHALL.CO.UK

