



HARVEY
DONALDSON
& GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot



HOME
report

SINGLE SURVEY
ENERGY REPORT
PROPERTY QUESTIONNAIRE
VALUATION REPORT



Home Report Index

1. Single Survey
2. Energy Report
3. Property Questionnaire

Single Survey

survey report on:

| | |
|------------------|---|
| Property address | Flat 3/1, 74 Dundrennan Road, Glasgow, G42 9SG |
|------------------|---|

| | |
|----------|---------------------------|
| Customer | Mr D Farrell, Miss H Dunn |
|----------|---------------------------|

| | |
|------------------|--|
| Customer address | 3/1 74 Dundrennan Road, GLASGOW, G42 9SG |
|------------------|--|

| | |
|-------------|-----------------------------|
| Prepared by | Harvey Donaldson And Gibson |
|-------------|-----------------------------|

| | |
|--------------------|-------------------|
| Date of inspection | 18th October 2023 |
|--------------------|-------------------|



HARVEY
DONALDSON
& GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

Terms and Conditions

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

Terms and Conditions

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

| | |
|--|--|
| Description | The subjects comprise a purpose built third/top floor flat which forms part of a traditional four storey mid-terraced tenement building containing eight flats in all. The front of the property faces approximately North East. |
| Accommodation | On one floor Top Floor - Third floor: hall, living room, two bedrooms, kitchen and bathroom. |
| Gross internal floor area (m²) | 83 |
| Neighbourhood and location | The neighbourhood is mainly residential. The location is urban. The property is located in the Battlefield district of Glasgow. The site is relatively level. |
| Age | 123 years. |
| Weather | Dry and overcast. |
| Chimney stacks | The chimneys are stone with some brick. Flashings are formed in sheet lead. |
| Roofing including roof space | The roof is pitched, timber framed and covered with concrete interlocking tiles. There are flat roofs over the front bay projections assumed to be covered in lead. |
| Rainwater fittings | The rainwater fittings are a mixture of plastic and iron/steel. |

Single Survey

| | |
|--|---|
| Main walls | <p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls are of traditional Scottish construction having 600mm solid sandstone outer walls, lath and plastered internally.</p> |
| Windows, external doors and joinery | <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of a double glazed upvc. plastic replacement type. The doors are timber storm doors and an internal timber and glazed unit.</p> |
| External decorations | <p>The external joinery is painted.</p> |
| Conservatories / porches | <p>None.</p> |
| Communal areas | <p>There is a common close and staircase. There are stone stairs and communal lighting is provided. Windows are of a single glazed timber framed type.</p> |
| Garages and permanent outbuildings | |
| Outside areas and boundaries | <p>There are garden grounds to the front and rear of the property. They are suitably bounded by brick walls and railings.</p> <p>Trees are often related with foundation movement. Generally speaking this is only a significant risk if the sub soil is shrinkable clay and when the weather is dry. Damage can however be caused by large trees growing so close to a house that the tree roots can actually get under the foundations. When trees are so close to a property there is also the risk that branches may also fall off causing direct damage.</p> |
| Ceilings | <p>Visually inspected from floor level.</p> <p>The ceilings are lath & plaster.</p> |
| Internal walls | <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls are of masonry construction plastered on hard.</p> |


Single Survey

| | |
|--|---|
| Floors including sub floors | The floors are of a suspended timber type with timber joists and covered with floorboards. |
| Internal joinery and kitchen fittings | The internal doors are timber panelled. The skirting boards and door surrounds are timber. The kitchen fittings are of a modern contemporary design and consist of a range of floor and wall mounted units. |
| Chimney breasts and fireplaces | The fireplace surround is timber and marble, utilised by a living flame gas fire. |
| Internal decorations | Visually inspected. The ceilings are painted. The walls are papered and painted. |
| Cellars | None. |
| Electricity | Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains electricity is installed. The meter and consumer unit are located in the hall. The system appears to be of a modern 13 amp type and design. The switch and socket outlets are plastic and the wiring is sheathed with PVC, where visible. |
| Gas | Gas is supplied from the mains. The meter is located in the hall. |
| Water, plumbing, bathroom fittings | Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is supplied from the mains. The rising main is not visible. The distribution pipes are a mixture of copper and plastic. The bathroom contains a bath with electric shower, basin and w.c. |
| Heating and hot water | Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. The property is heated by a gas fired boiler. The boiler is a combination boiler also providing hot water direct to taps. Heating to the rooms is provided by water filled radiators. |

Single Survey

| | |
|--|---|
| Drainage | <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>The property is believed to be connected to mains drainage.</p> |
| Fire, smoke and burglar alarms | <p>Scottish government regulations came into effect on 1st February 2022 which requires each property to have linked smoke and heat detectors and if gas/carbon burning appliances are present then a carbon monoxide alarm fitted. Purchasers should satisfy themselves with regards to compliance.</p> |
| Any additional limits to inspection | <p>It was over cast and dry at the time of the inspection. Preceding the inspection the weather was dry. The property was occupied. The property was furnished. The floors were covered with fixed coverings. In this context the tiled floor finishes are considered as a covering to the structure of the floor. In this context the laminate board floor finishes are considered as a covering to the structure of the floor. Stored goods restricted the inspection. The insulation at ceiling level restricted inspection of the ceiling and joists in the roof space.</p> |

Sectional Diagram showing elements of a typical house

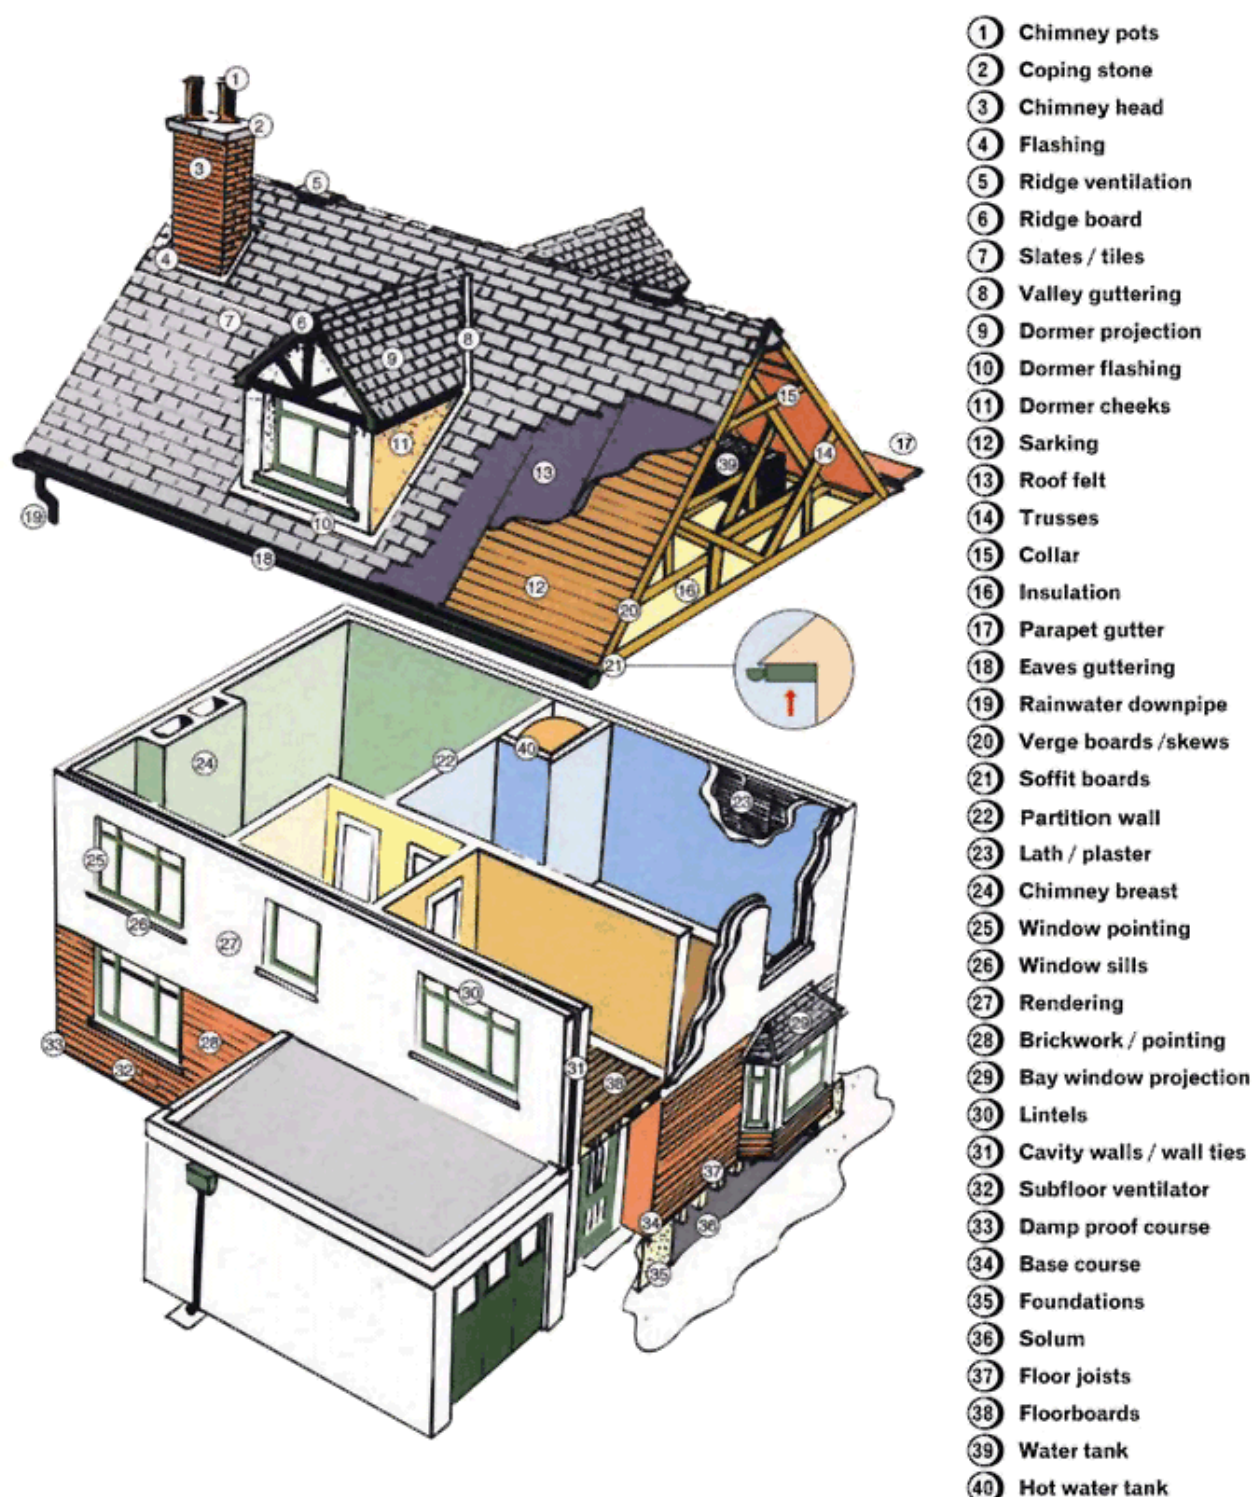

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |



Structural movement

| | |
|-----------------|--|
| Repair category | 1 |
| Notes | There is evidence of movement in the form of cracking to walling, off level flooring and doors. On the basis of a single visual inspection the movement appears to be longstanding in nature. The opinion provided is given within the limitations of a single visual inspection. It was noted that steel channels have been installed to the rear wall. It would be advisable to have the old iron bars below cracked lintels replaced with galvanised steel angles as a precaution against any further movement. |



Dampness, rot and infestation

| | |
|-----------------|---|
| Repair category | 1 |
| Notes | Dampness : None noted within the limitations of the inspection. The walls were checked using a Protimeter moisture meter. |



Chimney stacks

| | |
|-----------------|--|
| Repair category | 1 |
| Notes | The chimneys are generally satisfactory allowing for normal weathering commensurate with age. Ongoing attention should be anticipated. |



Roofing including roof space

| | |
|-----------------|--|
| Repair category | 2 |
| Notes | <p>Roof tiling, as viewed from ground level, appears to have been laid to generally even courses with no obvious significant defects noted. Concrete tiled roofs typically have an anticipated lifespan of at least 40 years, and as most tenemental stock was refurbished in the 1980's this is particularly relevant.</p> <p>It is understood that the front club skews and flat bay projection roof have been repaired/renewed and any guarantee should be transferred.</p> |



Rainwater fittings

| | |
|-----------------|---|
| Repair category | 1 |
| Notes | The rainwater goods are satisfactory allowing for normal weathering. The front gutters are choked and require to be cleaned out to ensure the proper run off of rainwater. Downpipes are corroded. It was not raining at the time of the inspection and it is therefore not possible to confirm that all joints are completely water tight. |



Main walls

| | |
|-----------------|--|
| Repair category | 2 |
| Notes | <p>The sandstone is weathered and eroded in places and patch repairs and repointing are required</p> <p>There is evidence of movement in the form of cracking to walling, off level flooring and doors. On the basis of a single visual inspection the movement appears to be longstanding in nature. The opinion provided is given within the limitations of a single visual inspection. It was noted that steel channels have been installed to the rear wall. It would be advisable to have the old iron bars below cracked lintels replaced with galvanised steel angles as a precaution against any further movement.</p> |



Windows, external doors and joinery

| | |
|-----------------|--|
| Repair category | 1 |
| Notes | The windows and doors are in reasonable condition consistent with their age. |



External decorations

| | |
|-----------------|--|
| Repair category | 1 |
| Notes | The external decorations are in reasonable condition but are beginning to deteriorate. |



Conservatories/porches

| | |
|-----------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |



Communal areas

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | The common close and staircase are in an average condition for age and type with only minor defects noted. Floors and stairs are cracked and off level due to past structural movement. |



Garages and permanent outbuildings

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | |



Outside areas and boundaries

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | The outside areas and boundaries are satisfactory for age and type. No evidence of any root action damage was noted but regular pruning should be carried out. |



Ceilings

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | The ceilings are cracked but reasonably sound allowing for their age. However, given the age of ceilings some loose and defective plaster may be found on redecoration which will require to be replaced. |



Internal walls

| | |
|------------------------|--------------------------------------|
| Repair category | 1 |
| Notes | The internal walls are satisfactory. |



Floors including sub-floors

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | The floors where visible are generally satisfactory allowing for its age and normal wear. |



Internal joinery and kitchen fittings

| | |
|-----------------|---|
| Repair category | 1 |
| Notes | The internal joinery and kitchen units are satisfactory. The skirting boards and door surrounds are satisfactory. |



Chimney breasts and fireplaces

| | |
|-----------------|---|
| Repair category | 1 |
| Notes | The appliance and flue were not tested. |



Internal decorations

| | |
|-----------------|--|
| Repair category | - |
| Notes | The internal decorations are generally satisfactory. All rooms are well presented. |



Cellars

| | |
|-----------------|-----------------|
| Repair category | - |
| Notes | Not applicable. |



Electricity

| | |
|-----------------|---|
| Repair category | 1 |
| Notes | It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check. The electrical installation appears to be generally commensurate with the age of the installation. |



Gas

| | |
|-----------------|--|
| Repair category | 1 |
| Notes | The gas installation appears to be generally commensurate with the age of the installation. The gas meter and supply should be checked on an annual basis. |



Water, plumbing and bathroom fittings

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | The plumbing installation appeared satisfactory. The sanitary fittings appeared satisfactory. |



Heating and hot water

| | |
|------------------------|---|
| Repair category | 1 |
| Notes | The system was running at the time of the inspection but is an older model and replacement parts may be difficult to source. It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person. |



Drainage

| | |
|------------------------|--|
| Repair category | 1 |
| Notes | The above ground drainage pipes appeared satisfactory. |

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

| | |
|---------------------------------------|---|
| Structural movement | 1 |
| Dampness, rot and infestation | 1 |
| Chimney stacks | 1 |
| Roofing including roof space | 2 |
| Rainwater fittings | 1 |
| Main walls | 2 |
| Windows, external doors and joinery | 1 |
| External decorations | 1 |
| Conservatories/porches | - |
| Communal areas | 1 |
| Garages and permanent outbuildings | 1 |
| Outside areas and boundaries | 1 |
| Ceilings | 1 |
| Internal walls | 1 |
| Floors including sub-floors | 1 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces | 1 |
| Internal decorations | - |
| Cellars | - |
| Electricity | 1 |
| Gas | 1 |
| Water, plumbing and bathroom fittings | 1 |
| Heating and hot water | 1 |
| Drainage | 1 |

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

| | | |
|--|---|--|
| 1. Which floor(s) is the living accommodation on? | Third floor | |
| 2. Are there three steps or fewer to a main entrance door of the property? | Yes <input type="checkbox"/> | No <input checked="" type="checkbox"/> |
| 3. Is there a lift to the main entrance door of the property? | Yes <input type="checkbox"/> | No <input checked="" type="checkbox"/> |
| 4. Are all door openings greater than 750mm? | Yes <input type="checkbox"/> | No <input checked="" type="checkbox"/> |
| 5. Is there a toilet on the same level as the living room and kitchen? | Yes <input checked="" type="checkbox"/> | No <input type="checkbox"/> |
| 6. Is there a toilet on the same level as a bedroom? | Yes <input checked="" type="checkbox"/> | No <input type="checkbox"/> |
| 7. Are all rooms on the same level with no internal steps or stairs? | Yes <input checked="" type="checkbox"/> | No <input type="checkbox"/> |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes <input checked="" type="checkbox"/> | No <input type="checkbox"/> |

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be outright ownership. The management and service charge details have not been inspected and it is assumed it does not contain onerous provisions which would adversely affect valuation.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

It would be advisable to contact the Common Factor to verify if there are any outstanding repairs or statutory notices affecting the property at this time.

The property is situated in an area of past mining activity. Legal adviser(s) to obtain a mining report from the coal authority and ensure that the requirements of the Coal Mining Subsidence Acts have been complied with.

Estimated reinstatement cost for insurance purposes

£250,000 (Two hundred and fifty thousand pounds).

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 18th October 2023 is £225,000 (Two hundred and twenty five thousand pounds sterling).

Signed

Security Print Code [460129 = 4132]O
Electronically signed

Report author

Andrew G Scrimgeour

Company name

Harvey Donaldson And Gibson

Address

Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

Single Survey

| | |
|-----------------------|-------------------|
| Date of report | 23rd October 2023 |
|-----------------------|-------------------|

Mortgage Valuation Report



HARVEY
DONALDSON
& GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

Property Address

Address Flat 3/1, 74 Dundrennan Road, Glasgow, G42 9SG
Seller's Name Mr D Farrell, Miss H Dunn
Date of Inspection 18th October 2023

Property Details

Property Type ☐ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette
☐ Purpose built flat ☐ Converted flat ☒ Tenement flat ☐ Flat over non-residential use
☐ Other (specify in General Remarks)

Property Style ☐ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☐ High rise block ☒ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☐ Yes ☒ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) ☐ Yes ☒ No

Garage / Parking / Outbuildings

☐ Single garage ☐ Double garage ☐ Parking space ☒ No garage / garage space / parking space
Available on site? ☐ Yes ☒ No

Permanent outbuildings:

No permanent outbuildings.

Mortgage Valuation Report

Construction

Walls ☐ Brick ☒ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)
Roof ☒ Tile ☐ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☒ Yes ☐ No

If Yes, is this recent or progressive? ☐ Yes ☒ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Heating fuel: Gas
Heating type: Radiators

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☐ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

Location

☐ Residential suburb ☒ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

Roads

☒ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☐ Unadopted

Mortgage Valuation Report

General Remarks

The general condition of the property appears consistent with its age and type of construction. There are some items requiring attention, however these are of a relatively minor nature and capable of remedy by routine maintenance.

The property has been affected by structural movement in the past. This appears to be of a longstanding nature, and the risk of further movement is remote.

Internally the rooms are spacious and all rooms are well presented.

The property is situated in an area of past mining activity. The conveyancer should obtain a mining report from The Coal Authority to provide information as to historical and future mining activity and whether the property has been the subject of any compensation claims, ensuring that the property is not adversely affected. The valuation assumes the content will reveal nothing adverse.

Essential Repairs

None

Estimated cost of essential repairs £

Retention recommended? ☐ Yes ☒ No

Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure.

Valuations

Market value in present condition £ 225,000

Market value on completion of essential repairs £

Insurance reinstatement value £ 250,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

Declaration

Signed Security Print Code [460129 = 4132]O
Electronically signed by:-

Surveyor's name Andrew G Scrimgeour

Professional qualifications Bsc MRICS

Company name Harvey Donaldson And Gibson

Address Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

Telephone 0141 204 0808

Fax 0203 880 9193

Report date 23rd October 2023

Energy Performance Certificate (EPC)

Dwellings

Scotland

FLAT 3/1 , 74 DUNDRENNAN ROAD, GLASGOW, G42 9SG

Dwelling type: Top-floor flat
Date of assessment: 18 October 2023
Date of certificate: 19 October 2023
Total floor area: 83 m²
Primary Energy Indicator: 321 kWh/m²/year

Reference number: 9288-1917-7200-4347-3200
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*

£7,230


See your recommendations report for more information

Over 3 years you could save*

£3,480

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

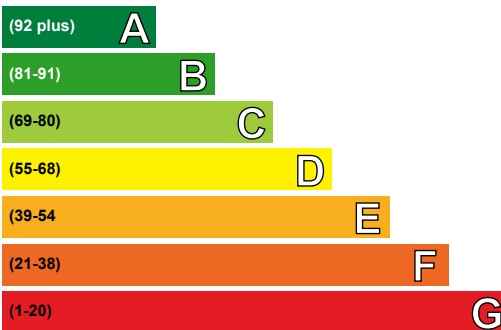

| Current | Potential |
|---------|-----------|
| 59 | 77 |


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (59)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

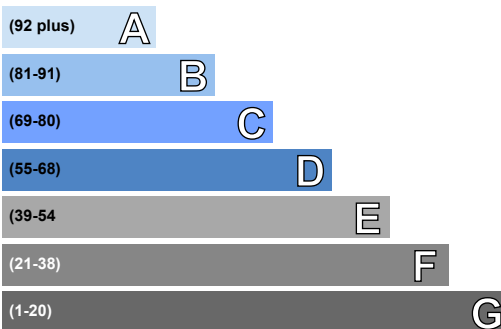

| Current | Potential |
|---------|-----------|
| 52 | 76 |

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (52)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years |
|--|------------------|------------------------------|
| 1 Increase loft insulation to 270 mm | £100 - £350 | £1626.00 |
| 2 Internal or external wall insulation | £4,000 - £14,000 | £1560.00 |
| 3 Condensing boiler | £2,200 - £3,000 | £294.00 |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|---|-------------------|---------------|
| Walls | Sandstone or limestone, as built, no insulation (assumed) | ★★☆☆☆ | ★★☆☆☆ |
| | Solid brick, as built, no insulation (assumed) | ★★☆☆☆ | ★★☆☆☆ |
| Roof | Pitched, 25 mm loft insulation | ★★☆☆☆ | ★★☆☆☆ |
| Floor | (another dwelling below) | — | — |
| Windows | Fully double glazed | ★★★★☆ | ★★★★☆ |
| Main heating | Boiler and radiators, mains gas | ★★★★☆ | ★★★★☆ |
| Main heating controls | Programmer, room thermostat and TRVs | ★★★★☆ | ★★★★☆ |
| Secondary heating | Room heaters, mains gas | — | — |
| Hot water | From main system | ★★★★☆ | ★★★★☆ |
| Lighting | Low energy lighting in 87% of fixed outlets | ★★★★★ | ★★★★★ |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 57 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.







Estimated energy costs for this home

| | Current energy costs | Potential energy costs | Potential future savings |
|---------------|----------------------|------------------------|---|
| Heating | £5,883 over 3 years | £2,502 over 3 years |  |
| Hot water | £876 over 3 years | £777 over 3 years | |
| Lighting | £471 over 3 years | £471 over 3 years | |
| Totals | £7,230 | £3,750 | |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures | Indicative cost | Typical saving per year | Rating after improvement | |
|---|------------------|-------------------------|---|---|
| | | | Energy | Environment |
| 1 Increase loft insulation to 270 mm | £100 - £350 | £542 |  |  |
| 2 Internal or external wall insulation | £4,000 - £14,000 | £520 |  |  |
| 3 Replace boiler with new condensing boiler | £2,200 - £3,000 | £98 |  |  |

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Air or ground source heat pump
- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 10,727 | (3,245) | N/A | (3,121) |
| Water heating (kWh per year) | 2,139 | | | |

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

| | |
|-----------------------------|--|
| Assessor's name: | Mr. Andrew Scrimgeour |
| Assessor membership number: | EES/016076 |
| Company name/trading name: | Harvey Donaldson & Gibson Chartered Surveyors |
| Address: | Suite 3/7 Standard Buildings 94 Hope Street Glasgow G2 6PH |
| Phone number: | 0141 2040808 |
| Email address: | frances.wilson@hdg.co.uk |
| Related party disclosure: | No related party |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Property Questionnaire

| | |
|-------------------------|--|
| Property Address | 3/1 74 Dundrennan Road GLASGOW G42 9SG |
|-------------------------|--|

| | |
|------------------|-----------------------------|
| Seller(s) | Mr D Farrell Miss H Dunn |
|------------------|-----------------------------|

| | |
|--|------------|
| Completion date of property questionnaire | 19/10/2023 |
|--|------------|

1 Length of ownership

How long have you owned the property?

3.5 years

2 Council tax

Which Council Tax band is your property in?

C

3 Parking

What are the arrangements for parking at your property?

(Please tick all that apply)

Garage ☐

Allocated parking space ☐

Driveway ☐

Shared parking ☐

On street ☒

Resident permit ☐

Metered parking ☐

Other (please specify)

4 Conservation area

Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

No

5 Listed buildings

Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?

No

6 Alterations/additions/extensions

- a.(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?

No

If you have answered yes, please describe below the changes which you have made:

- (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:

- b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

No

If you have answered yes, please answer the three questions below:

- (i) Were the replacements the same shape and type as the ones you replaced?
- (ii) Did this work involve any changes to the window or door openings?
- (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

7 Central heating

- a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there?

(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

Gas fired

If you have answered yes, please answer the three questions below:

- (i) When was your central heating system or partial central heating system installed?

Pre-dates our ownership

- (ii) Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance contract:

- (iii) When was your maintenance agreement last renewed?
(Please provide the month and year).

8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9 Issues that may have affected your property

- a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

No

- b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10 Services

Please tick which services are connected to your property and give details of the supplier:

Services**Connected Supplier**

| | | |
|-------------------------------------|-------------------------------------|-----------|
| Gas or liquid petroleum gas | <input checked="" type="checkbox"/> | So Energy |
| Water mains or private water supply | <input type="checkbox"/> | |
| Electricity | <input checked="" type="checkbox"/> | So Energy |
| Mains drainage | <input type="checkbox"/> | |
| Telephone | <input type="checkbox"/> | |
| Cable TV or satellite | <input type="checkbox"/> | |
| Broadband | <input checked="" type="checkbox"/> | EE |

b. Is there a septic tank system at your property?

No

(i) Do you have appropriate consents for the discharge from your septic tank?

No

(ii) Do you have a maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11 Responsibilities for shared or common areas

a. Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

Yes

If you have answered yes, please give details:

Monthly factor fees for cleaning and factoring services with Walker Sandford. £25 per month

b. Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Yes

If you have answered yes, please give details:

Walker Sandford fees. Any general repairs are split 8 ways

c. Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

Yes

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

Yes

If you have answered yes, please give details:

Shared garden. Roof repairs totalling £8k in Feb-21, instructed and driven by ourselves due to pre-existing issues when we purchased the property. All lead work along the chimney stack re-done, tiles along the chimney stack all replaced, old felt roof above our bay window removed and replaced with lead. No further issues since then, work performed to a very high standard.

e. As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

Yes

If you have answered yes, please give details:

Shared garden.

- f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

12 Charges associated with your property

- a. Is there a factor or property manager for your property?

Yes

Walker Sandford

- b. Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

13 Specialist works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14 Guarantees

a. Are there any guarantees or warranties for any of the following:

(i) Electrical work

No

(ii) Roofing

No

(iii) Central heating

No

(iv) National House Building Council (NHBC)

No

(v) Damp course

No

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

No

b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

(i) Electrical work

(ii) Roofing

(iii) Central heating

(iv) National House Building Council (NHBC)

(v) Damp course

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

c. Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details:

15 Boundaries

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16 Notices that affect your property

In the past three years have you ever received a notice:

a. advising that the owner of a neighbouring property has made a planning application?

No

b. that affects your property in some other way?

No

- c. that requires you to do any maintenance, repairs or improvements to your property?

No

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.