

YOUR ONESURVEY
HOME REPORT

ADDRESS

Oakbank
Fisherwood Road
Balloch
Alexandria, G83 8SW

PREPARED FOR

Paul Muir

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Corum - Bearsden

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Helensburgh - Allied Surveyors Scotland Ltd	01/05/2026
Mortgage Certificate	Final	Helensburgh - Allied Surveyors Scotland Ltd	01/05/2026
Property Questionnaire	Final	Mr. Paul Muir	19/05/2026
EPC	Final	Helensburgh - Allied Surveyors Scotland Ltd	30/04/2026

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	HH/5370
---------------------------	---------

Customer	Mr. Paul Muir
-----------------	---------------

Selling address	Oakbank Fisherwood Road Balloch Alexandria G83 8SW
------------------------	--

Date of Inspection	30/04/2026
---------------------------	------------

Prepared by	Russell Smith, MA MRICS Helensburgh - Allied Surveyors Scotland Ltd
--------------------	--

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a detached two storey house, which has been substantially altered and extended.
Accommodation	Ground floor: entrance vestibule, hallway, two bedrooms, shower room, living room, partially open plan to kitchen, with spiral staircase to upper level, gym with en-suite shower room, conservatory, giving access to rear extension, with bedroom, rear vestibule, and shower room. Upper floor: landing, master bedroom with dressing room and en-suite shower room, bedroom 2 with en-suite WC.
Gross internal floor area (m2)	232 sq mtrs approx. (including conservatory).
Neighbourhood and location	The subjects are located in the centre of Balloch and form part of the Loch Lomond and the Trossachs National Park. Fisherwood Road is an unmade private road, shared with adjacent houses which are of various different ages and styles. Local amenities and facilities are available within walking distance, and the local railway station is directly to the rear. More extensive amenities are available within the main towns of Helensburgh and Dumbarton.
Age	The original part of the house is assumed to date from the early 1900s. The main two storey extension on the right hand side, and the adjoining single storey extension, are estimated to be at least 50 years old. The single storey rear extension is understood to have been built around 2017.
Weather	Dry, warm and bright.
Chimney stacks	There is a small rendered chimney stack to the rear which is assumed to be of brick construction. The flashing is formed in lead. There is a modern upright metal flue to the front, which is assumed to serve the wood burning stove in the living room. Visually inspected with the aid of binoculars where required.

<p>Roofing including roof space</p>	<p>The roofs to the main house and two storey extension are pitched and clad with concrete tiles. There are small dormer projections to the front and rear.</p> <p>The single storey extension containing the gym has a monopitched roof which is also clad with concrete tiles.</p> <p>The single storey rear extension has a flat roof which has an external cladding of timber decking, although it is assumed that the main roof covering below is formed in bitumen or similar material.</p> <p>Only a limited 'head and shoulders' inspection of the main roof space was possible, due to a large wardrobe placed beneath the hatch in the dressing area off the master bedroom. The master bedroom has been altered in the past to create high sloping ceilings, and our inspection of this area was extremely limited. The roof is of conventional timber framed construction with timber sarking.</p> <p>We were also able to carry out a 'head and shoulders' inspection of the roof space above bedroom two within the extension. This roof is also timber framed with timber sarking.</p> <p>Very limited sight was possible of the small roof void above the gym. The roof is timber framed, although the sarking has been replaced in plywood/OSB.</p> <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</p> <p>Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p>
<p>Rainwater fittings</p>	<p>Gutters and downpipes are formed in cast iron and PVC.</p> <p>Visually inspected with the aid of binoculars where required.</p>
<p>Main walls</p>	<p>The outer walls to the original part of the house are of traditional solid stone construction with a painted finish to the rear elevation.</p> <p>The side extensions appear to be formed in brick with various rendered finishes externally.</p> <p>The rear extension appears to be timber framed, with an outer leaf of painted rendered masonry.</p> <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p>

<p>Windows, external doors and joinery</p>	<p>The majority of windows have been replaced in the past with PVC framed, double glazed units, although these are of different ages and styles.</p> <p>The master bedroom also has one Velux window to the front which is timber framed and double glazed.</p> <p>The gym in the side extension has two timber framed, sash and casement windows to the gable, which are fitted with double glazed panels, as well as a timber Velux. There are patio doors to the rear which are PVC framed and double glazed.</p> <p>On the lower level, the windows to the shower room and one of the bedrooms have been blocked up due to the addition of the rear extension. The bedroom has a modern 'tilt and turn' style window to the side, which is PVC framed and double glazed.</p> <p>The main external storm door to the front is formed in timber. There are PVC framed, double glazed patio doors leading from the conservatory into the kitchen and rear extension. The rear extension also has an external door to the side, which is formed in PVC with a double glazed panel.</p> <p>Fascia boards and soffits are a combination of timber and PVC.</p> <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p>
<p>External decorations</p>	<p>There are painted finishes to parts of the external walls, and to the eaves timbers and cast iron rainwater goods.</p> <p>Visually inspected.</p>
<p>Conservatories / porches</p>	<p>There is a large conservatory to the rear which can be accessed from both the kitchen and the rear extension. The base and rear corners appear to be of brick construction with painted render finishes externally. Remaining parts and the roof are PVC framed and double glazed.</p> <p>There are double patio doors to the side, and bi-fold style doors to the rear.</p> <p>The conservatory benefits from an air conditioning system, with the external Mitsubishi unit located in the lean-to storage area at the side of the gym.</p> <p>Visually inspected.</p>
<p>Communal areas</p>	<p>Not applicable.</p>

<p>Garages and permanent outbuildings</p>	<p>On the right hand side of the plot, there is a detached garage which is of brick construction with a pitched and tiled roof. The garage has been subdivided to create a storage area at the front, which is accessed via double timber doors.</p> <p>The rear part of the garage is currently being used as a bar. There are double patio doors to the rear elevation, and the brickwork is painted. We were unable to gain access into the bar at the time of inspection.</p> <p>There are lean-to storage areas on both sides of the house, and on the far side of the garage.</p> <p>Visually inspected.</p>
<p>Outside areas and boundaries</p>	<p>There is an attractive private garden to the front of the house, including a lawn with a large tree and water feature. There is a driveway with two entrances which leads to a parking area in front of the house. This is finished with both monoblock and gravel. The front boundary to Fisherwood Road is formed by a brick wall topped with metal railings.</p> <p>The back garden has areas of patio and artificial grass, and is enclosed by timber fencing. Part of the patio is covered by a modern timber pergola and houses a hot tub.</p> <p>There is a gate in the rear fence which gives access to a private path leading directly to the riverside. This is enclosed by timber fencing, and has a decked surface.</p> <p>Visually inspected.</p>
<p>Ceilings</p>	<p>Ceilings appear to be a combination of lath and plaster, and plasterboard.</p> <p>Visually inspected from floor level.</p>
<p>Internal walls</p>	<p>The internal walls are formed in lath and plaster, plaster on hard, and plasterboard.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>

<p>Floors including sub floors</p>	<p>The majority of flooring appears to be of suspended timber joist construction with timber or chipboard flooring. There are however solid floors within the kitchen and gym.</p> <p>Within the main bedroom, there is a small staircase leading down to a large window which gives access onto the decked flat roof of the rear extension. There is also a slightly raised platform which houses a stand-alone bath.</p> <p>Due to fitted floor coverings throughout the house, no detailed sight of the flooring was possible.</p> <p>There was no hatch readily available to provide access to any sub-floor area.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p>
<p>Internal joinery and kitchen fittings</p>	<p>Door frames and skirting boards etc. are formed in timber with painted and stained finishes.</p> <p>Kitchen fittings comprise a modern range of wall and floor mounted units, with a large gas range style cooker.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
<p>Chimney breasts and fireplaces</p>	<p>The main living room has a modern wood burning stove contained within a timber surround.</p> <p>There are also small traditional cast iron fireplaces within the main bedroom and upper landing, although it appears that these have been retained for decorative purposes only.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
<p>Internal decorations</p>	<p>There are painted and papered finishes to internal walls.</p> <p>Visually inspected.</p>
<p>Cellars</p>	<p>Not applicable.</p>
<p>Electricity</p>	<p>Mains supply, with circuit breakers and meter located behind a panel in the entrance vestibule.</p> <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>

<p>Gas</p>	<p>Mains supply.</p> <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p>
<p>Water, plumbing and bathroom fittings</p>	<p>Mains water supply. Visible plumbing beneath the kitchen sink is formed in copper, PVC, and flexible metal pipework.</p> <p>The ground floor shower room off the main entrance hallway has a wet room style shower (mixer) and a modern white two piece suite.</p> <p>There is a similar wet room off the gym in the right hand extension. This also has a mixer shower unit and a white two piece suite.</p> <p>There is a further shower room within the rear extension. This has a shower cubicle (mixer) and a white two piece suite.</p> <p>As noted above, there is a raised platform within the main bedroom which houses a stand-alone bath. The en-suite is accessed via a frosted glass door, and features a walk-in shower cubicle (mixer) and a white two piece suite.</p> <p>The smaller bedroom on the upper level has a semi-open plan en-suite WC, which has a white two piece suite.</p> <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Heating and hot water</p>	<p>There is a gas fired Ideal Atlantic 35 combination boiler located in the loft space above the second bedroom on the upper level. This boiler serves a variety of radiators throughout the house, and provides hot water.</p> <p>As noted above there is also a Mitsubishi electric heat pump on the right hand side of the gym, which serves an air conditioning/heating unit in the conservatory.</p> <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p>
<p>Drainage</p>	<p>Appears to be connected to the mains sewer.</p> <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p>

<p>Fire, smoke and burglar alarms</p>	<p>Several smoke alarms were noted throughout the house. There is also a mounting point for a heat detector in the kitchen.</p> <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<p>Any additional limits to inspection</p>	<p>The property was occupied and fully furnished at the time of inspection.</p> <p>An inspection for Japanese Knotweed was not carried out.</p> <p>This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property.</p> <p>Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p>

Sectional Diagram showing elements of a typical house





Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	
Notes:	<p>The building has, in common with similar properties, been affected by a degree of structural movement. There is cracking to stonework, particularly on the left hand elevation, and parts of the flooring are also off-level.</p> <p>Within the limits of our single site inspection, the movement evident would appear to be non progressive in nature and the likelihood of further significant movement seems remote. The rear extension does appear to have been affected by a degree of initial settlement movement.</p>

Dampness, rot and infestation	
Repair category:	
Notes:	<p>Internal walls were tested with an electronic moisture, and localised dampness were noted at the front corner of the front bedroom on the lower level. It was noted that a chemical damp-proof course has been installed in the past, and any relevant guarantees should ideally be exhibited.</p>

Chimney stacks	
Repair category:	
Notes:	<p>Whilst no significant defects were noted, the render to the remaining chimney is slightly crazed and stained. A degree of ongoing maintenance can be anticipated.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	<p>The tiled roofs have been cleared of vegetation and staining, and within the limits of our ground level inspection, no significant defects were noted. The Velux window to the front appears slightly squint.</p> <p>Concrete tiled roofs typically have a lifespan of around 40 years and this life can be shortened, either due to adverse weather conditions or a general lack of maintenance.</p> <p>No clear sight was possible of the main flat roof covering over the rear extension due to the presence of timber decking. The timber decking did however appear to be weathered. As with any flat roof, regular and ongoing maintenance will be necessary.</p> <p>Our inspection of the various roof spaces were very limited. Within the main roof spaces, we did however note damp staining and deterioration to timbers, particularly around gables and chimneys. There are signs of localised woodworm within the small loft space over the second bedroom, although this may be old or inactive.</p>

Rainwater fittings

Repair category:	1
Notes:	<p>Due to the weather conditions at the time of our inspection, we are unable to comment on the adequacy or otherwise of the rainwater conductors. On the basis of our visual inspection, no significant defects were noted. Cast iron sections are affected by typical light surface corrosion.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main walls	
Repair category:	1
Notes:	<p>The main outer walls are affected by typical weathering and staining, and a degree of further periodic repointing and refacing can be anticipated as part of an ongoing maintenance programme.</p> <p>There is cracking to stonework on the left hand gable elevation, and patch repairs have been undertaken around the apex of the roof.</p> <p>There is old ivy growth to the front elevation which should ideally be removed.</p> <p>Rendered finishes to the two storey side extension appear slightly crazed and stained.</p>

Windows, external doors and joinery	
Repair category:	2
Notes:	<p>The windows are of various different ages and styles, but are generally in a serviceable condition.</p> <p>There does appear to have been some localised water ingress around window openings, particularly at the front of the second bedroom in the extension. The affected areas were found to be dry when tested with a moisture meter.</p> <p>Some of the opening mechanisms were also noted to be stiff.</p> <p>A tall window has been installed to the side of the second bedroom on the lower level. The timber surrounds remain unpainted, and there is a small gap to the stonework directly above.</p> <p>A failed double glazing seal was noted to the small window to the en-suite area in the second bedroom.</p> <p>Double glazing, and particularly UPVC double glazing, can be problematic, and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance repairs will be required as part of an ongoing maintenance programme. Our valuation does assume that the installation of the windows does comply with the necessary regulations at the time of installation.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

External decorations	
Repair category:	1
Notes:	Generally satisfactory, although periodic redecoration can be anticipated to cast iron rainwater goods.

Conservatories / porches	
Repair category:	1
Notes:	The conservatory is generally well presented. The timber steps outside the bi-fold doors appear temporary, and are not fixed to the wall. The double patio doors to the side were noted to be slightly stiff to open and close.

Communal areas	
Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings	
Repair category:	2
Notes:	On the basis of our limited inspection, no significant defects were noted. There is however some typical staining to the roof timbers within the front part of the garage, and glazed panels to the roof appear slightly cracked in places. Fascias are weathered, and parts of the brickwork require repointing. There is staining to the plywood in the lean-to storage area on the right hand side of the garage.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Outside areas and boundaries	
Repair category:	1
Notes:	<p>The main garden grounds are generally well presented and are an attractive feature. Parts of the artificial grass at the rear were uneven at the time of inspection.</p> <p>There are several large mature trees within close proximity of the building which may require to be cut back periodically. The large tree in the front garden may, however, be covered by a Tree Preservation Order. The small water feature may pose a safety hazard for small children.</p> <p>The precise boundaries should be confirmed from the title deeds, particularly with regards to the path leading down to the River Leven. The decking on the path is weathered in places, and parts of the timber fencing are off-plumb.</p> <p>There is timber decking over the rear extension, which may have been used as balcony in the past. This area cannot be used as a deck at the present time, due to the lack of a suitable handrail. Access from the main bedroom is also difficult due to the relatively small size of the window/patio door.</p>

Ceilings	
Repair category:	1
Notes:	Ceilings are in a fairly typical condition for a property of this age and type, with some localised hairline cracking noted.

Internal walls	
Repair category:	1
Notes:	Internal plasterwork is generally satisfactory although again, some minor hairline cracking was noted. There is localised damage within the dressing room off the main bedroom.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Floors including sub-floors	
Repair category:	1
Notes:	<p>Within the limits of our inspection, the floors are generally in a satisfactory condition.</p> <p>The solid floor does however appear to be slightly off level within the kitchen, which can be attributed to the structural movement noted above.</p> <p>There is also a slight dip in the flooring next to the new side window in the rear left hand bedroom. although no dampness was noted to adjacent walls.</p> <p>Cracked floor tiles in the entrance vestibule should ideally be replaced.</p>

Internal joinery and kitchen fittings	
Repair category:	1
Notes:	<p>Internal joinery and kitchen fittings are generally satisfactory, although there are some areas of typical wear and tear.</p> <p>The upper level is only accessible via a metal spiral staircase, which may be difficult to navigate for some people.</p>

Chimney breasts and fireplaces	
Repair category:	1
Notes:	<p>No obvious defects were noted to the wood burning stove within the living room, although evidence of any recent testing or servicing should be exhibited. It was noted that the timber mantelpiece is not properly fixed to the wall.</p> <p>Any blocked fireplaces should be permanently ventilated in order to prevent dampness and subsequent timber decay. It should be ensured that all flues, whether in use or not, are regularly checked and serviced.</p>

Internal decorations	
Repair category:	1
Notes:	The property is generally well presented.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	1
Notes:	The electrical system appears to have been partially upgraded with the installation of a relatively modern consumer unit. It is recommended that electrical systems are tested every 5 to 10 years and, as such, a recent satisfactory test certificate should be exhibited.

Gas	
Repair category:	1
Notes:	Our valuation assumes that the gas installation complies with current Gas Safe regulations.

Water, plumbing and bathroom fittings	
Repair category:	1
Notes:	No obvious defects were noted to visible sections of plumbing. Bathroom fittings are generally modern, and no significant defects were noted. There is minor wear and tear to fittings in the shower room in the rear extension.

Heating and hot water	
Repair category:	1
Notes:	The central heating boiler is of modern design, and it should be confirmed whether it is covered by a manufacturer's guarantee. It should be confirmed whether the system has been annually serviced or is covered by a maintenance contract. In the absence of written confirmation of this, we would recommend that the system is serviced by a Gas Safe registered engineer.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage	
Repair category:	1
Notes:	There are no signs of any surface problems with regards to drainage.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	2
External decorations	1
Conservatories / porches	1
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and first floors
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>The building has been substantially altered and extended over the years, and was at one time sub-divided into two separate flats. The completing solicitor should be satisfied that all necessary valid permissions and approvals have been obtained.</p> <p>It does appear that a chemical damp-proof course has been installed in the past, and any relevant guarantees should be exhibited.</p> <p>The house is accessed via a shared private access road. It is assumed that there is a satisfactory right of access, and the extent of any shared maintenance liabilities should be confirmed.</p> <p>The precise boundaries should be confirmed from the title deeds. There is an access path leading down to the River Leven and it should be confirmed whether this is owned outright or whether there is simply a right of access.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
<p>£1,150,000 (ONE MILLION ONE HUNDRED AND FIFTY THOUSAND POUNDS)</p> <p>Building costs are currently increasing significantly above inflation due to material and labour shortages as well as Brexit and the Pandemic. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your Insurer.</p>	
Valuation (£) and market comments	
<p>£550,000</p> <p>In its present condition and with the current state of the property market our valuation of the property is in the region of £550,000 (FIVE HUNDRED AND FIFTY THOUSAND POUNDS)</p>	
Report author:	Russell Smith, MA MRICS
Company name:	Helensburgh - Allied Surveyors Scotland Ltd
Address:	13 Colquhoun Street Helensburgh G84 8AN
Signed:	Electronically Signed: 311846-99764b94-7ce5
Date of report:	01/05/2026

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report

Property:	Oakbank Fisherwood Road Balloch Alexandria G83 8SW	Client: Mr. Paul Muir Tenure: Absolute ownership
Date of Inspection:	30/04/2026	Reference: HH/5370/RJDS

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The subjects are located in the centre of Balloch and form part of the Loch Lomond and the Trossachs National Park. Fisherwood Road is an unmade private road, shared with adjacent houses which are of various different ages and styles. Local amenities and facilities are available within walking distance, and the local railway station is directly to the rear. More extensive amenities are available within the main towns of Helensburgh and Dumbarton.

2.0	DESCRIPTION	2.1 Age:	The original part of the house is assumed to date from the early 1900s. The main two storey extension on the right hand side, and the adjoining single storey extension, are estimated to be at least 50 years old. The single storey rear extension is understood to have been built around 2017.
-----	-------------	----------	--

The subjects comprise a detached two storey house, which has been substantially altered and extended.

3.0 CONSTRUCTION

The outer walls are a combination of traditional solid stone, rendered brick, and timber framed construction. The main roofs are pitched and tiled, and there is a flat roof over the rear extension.

4.0 ACCOMMODATION

Ground floor: entrance vestibule, hallway, two bedrooms, shower room, living room, partially open plan to kitchen, with spiral staircase to upper level, gym with en-suite shower room, conservatory, giving access to rear extension, with bedroom, rear vestibule, and shower room.

Upper floor: landing, master bedroom with dressing room and en-suite shower room, bedroom 2 with en-suite WC.

5.0	SERVICES (No tests have been applied to any of the services)						
------------	---	--	--	--	--	--	--

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
---------------	-------	---------------------	-------	-------------	-------	------------------	-------

Central Heating:	Gas fired
-------------------------	-----------

6.0	OUTBUILDINGS
------------	---------------------

Garage:	Detached garage building, sub-divided into bar and storage area.
----------------	--

Others:	-
----------------	---

7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>
------------	--

At the time of our inspection, undertaken in conjunction with a Home Report, the general condition of the property appeared consistent with its age and type of construction, but typical works of maintenance can be anticipated.

The building has been affected by a degree of structural movement. Within the limits of our single site inspection, the movement evident would appear to be non progressive in nature and the likelihood of further significant movement seems remote.

8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>
------------	--

-

8.1 Retention recommended:	-
-----------------------------------	---

9.0	ROADS & FOOTPATHS
------------	------------------------------

Private

10.0	BUILDINGS INSURANCE (£):	1,150,000	GROSS EXTERNAL FLOOR AREA	272	Square metres
-------------	---------------------------------	-----------	----------------------------------	-----	----------------------

	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
--	--	--	--	--	--

11.0	GENERAL REMARKS
-------------	------------------------

The building has been substantially altered and extended over the years, and was at one time sub-divided into two separate flats. The completing solicitor should be satisfied that all necessary valid permissions and approvals have been obtained.

It does appear that a chemical damp-proof course has been installed in the past, and any relevant guarantees should be exhibited.

The house is accessed via a shared private access road. It is assumed that there is a satisfactory right of access, and the extent of any shared maintenance liabilities should be confirmed.

The precise boundaries should be confirmed from the title deeds. There is an access path leading down to the River Leven and it should be confirmed whether this is owned outright or whether there is simply a right of access.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	£550,000	FIVE HUNDRED AND FIFTY THOUSAND POUNDS
12.2	Market Value on completion of essential works (£):	-	-
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	30/04/2026	
Signature:		Electronically Signed: 311846-99764b94-7ce5	
Surveyor:	Russell Smith	MA MRICS	Date: 01/05/2026
Helensburgh - Allied Surveyors Scotland Ltd			
Office:	13 Colquhoun Street Helensburgh G84 8AN	Tel: 01436 674 976 Fax: email: helensburgh@alliedsurveyorsscotland.com	

PART 3.

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	Oakbank Fisherwood Road Balloch Alexandria G83 8SW
-------------------------	--

Customer	Mr. Paul Muir
-----------------	---------------

Customer address	Oakbank Fisherwood Road Balloch Alexandria G83 8SW
-------------------------	--

Prepared by	Russell Smith, MA MRICS Helensburgh - Allied Surveyors Scotland Ltd
--------------------	--

Energy Performance Certificate (EPC)

Scotland

Dwellings

OAKBANK, FISHERWOOD ROAD, ALEXANDRIA, G83 8SW

Dwelling type: Detached house
Date of assessment: 30 April 2026
Date of certificate: 30 April 2026
Total floor area: 212 m²
Primary Energy Indicator: 252 kWh/m²/year


Reference number: 5216-2224-2200-0500-2272
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£10,884	See your recommendations report for more information
Over 3 years you could save*	£3,624	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

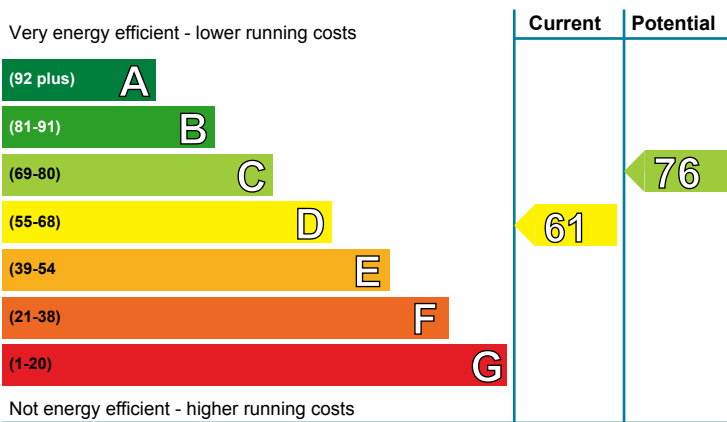


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

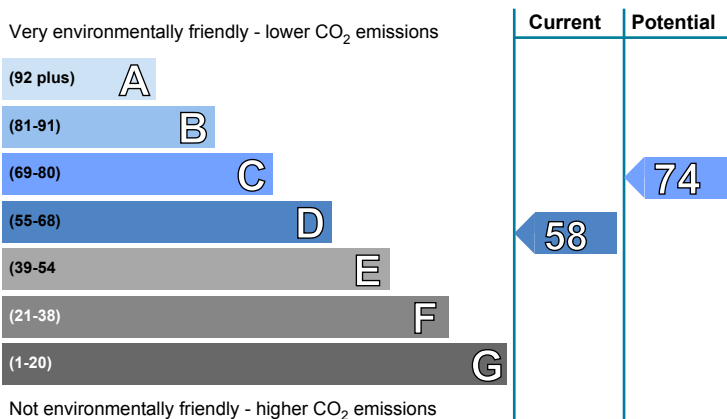

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (58)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£1089.00
2 Cavity wall insulation	£900 - £1,500	£453.00
3 Internal wall insulation	£7,500 - £11,000	£1233.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	Pitched, no insulation	★☆☆☆☆	★☆☆☆☆
	Pitched, 150 mm loft insulation	★★★★☆	★★★★☆
	Flat, insulated	★★★★☆	★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	Room heaters, wood logs	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Excellent lighting efficiency	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 42 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 8.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 3.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.













Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£9,927 over 3 years	£6,303 over 3 years	
Hot water	£687 over 3 years	£687 over 3 years	
Lighting	£270 over 3 years	£270 over 3 years	
Totals	£10,884	£7,260	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Flat roof or sloping ceiling insulation	£900 - £1,200	£363		
2 Cavity wall insulation	£900 - £1,500	£151		
3 Internal wall insulation	£7,500 - £11,000	£411		
4 Floor insulation (suspended floor)	£5,000 - £10,000	£171		
5 Upgrade heating controls	£220 - £250	£111		
6 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£235		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

4 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

5 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass secondary heating

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	35,491.97	N/A	N/A	N/A
Water heating (kWh per year)	2,768.44			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Russell Smith
Assessor membership number: EES/008352
Company name/trading name: Allied Surveyors Scotland Ltd
Address: 13 Colquhoun Street
Helensburgh
G84 8AN
Phone number: 01436 672654
Email address: helensburgh@alliedsurveyorsscotland.com
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

Oakbank
Fisherwood Road
Alexandria
G83 8SW

Seller(s)

Paul Muir

Completion date of property questionnaire

19/05/2026

Note for sellers

1.	Length of ownership
	<p>How long have you owned the property?</p> <p>15 years</p>
2.	Council tax
	<p>Which Council Tax band is your property in? (Please circle)</p> <p><input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input checked="" type="checkbox"/> G <input type="checkbox"/> H</p>
3.	Parking
	<p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input checked="" type="checkbox"/></p> <p>Allocated parking space <input checked="" type="checkbox"/></p> <p>Driveway <input checked="" type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify):</p>

property questionnaire

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[] YES [x] NO [] Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[] YES [x] NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[x] YES [] NO
	If you have answered yes, please describe below the changes which you have made: <i>Turned the 2 properties back into the original detached house, added 2 extensions one with bedroom, added spiral stair case, removed internal wall</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[x] YES [] NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: <i>My solicitor has the documents</i>	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[] YES [x] NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[] YES [] NO
	(ii) Did this work involve any changes to the window or door openings?	[] YES [] NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	

property questionnaire

a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). <i>Combo boiler and wood burner</i>	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? <i>1 year ago</i>	
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
10.	Services	

property questionnaire

a	Please tick which services are connected to your property and give details of the supplier:		
	Services	Connected	Supplier
	Gas or liquid petroleum gas	Y	Gas
	Water mains or private water supply	Y	
	Electricity	Y	
	Mains drainage	Y	
	Telephone	Y	
	Broadband	Y	
b	Is there a septic tank system at your property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the two questions below:		
	(i) Do you have appropriate consents for the discharge from your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
	(ii) Do you have a maintenance contract for your septic tank?		<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
11. Responsibilities for shared or common areas			
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

property questionnaire

f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
12. Charges associated with your property		
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	Is there a common buildings insurance policy?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13. Specialist works		
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

property questionnaire

14. Guarantees		
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input type="checkbox"/> NO <input checked="" type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15. Boundaries		
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16. Notices that affect your property		
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):	Paul Muir
Capacity:	<input checked="" type="checkbox"/> Owner <input type="checkbox"/> Legally Appointed Agent for Owner
Date:	20/05/2026