

Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION



Contents

- 1. Single Survey
- 2. Energy Performance Certificate







Scottish Single Survey



survey report on:

Broomlands Cottage Maybole KA19 7QF
Mr R Kelly (Executor)
Broomlands Cottage Maybole KA19 7QF
Shepherd Chartered Surveyors
12/12/2023



www.shepherd.co.uk

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by marking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller:
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether
 or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report².

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;

- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments

being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 <u>Category 2:</u> Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use

communal grounds, parking areas, and other facilities;

- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a detached bungalow.
Accommodation	Ground Floor - Entrance Vestibule, Hallway, Sitting Room, Dining Room, Bed/Study Room, Kitchen, Rear Vestibule, Two Bedrooms and Bath/Shower Room with WC.
Gross internal floor area (m²)	137 square metres or thereby.
Neighbourhood and location	The subjects have an isolated rural setting around two miles from the village of Crosshill where limited local amenities are available. The property is a short distance from one or two other houses and are otherwise surrounded by woodland and agricultural land.
Age	The original cottage is estimated to be 120 years old and later extended and altered to form the present accommodation.
Weather	Heavy rain.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. There is a single chimney of brick construction and roughcast and a second modern style flue outlet.

Roofing including roof space Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof has two pitches each of which have hipped profiles and there is a central flat roof which is assumed to be felt covered. Pitched areas are overlaid in natural slate. We were able to access both roof void areas via ceiling hatches where the roof construction was seen to be of timber framed construction overlaid with timber sarking boards. Rainwater fittings Visually inspected with the aid of binoculars where appropriate. PVC gutters and downpipes. Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. Original walls at the front section of house appear to be of substantial solid stone/rubble construction finished in roughcast. The rear areas appear to be of cavity brick construction also roughcast. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are mostly UPVC framed sealed unit double glazing although there are one or two timber casement single glazed units. Front and rear entrance doors are timber. There are some timber soffit boards at entrance door recesses.

External decorations	Visually inspected.
	Painted joinery.
Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	Visually inspected.
	There is a detached single garage which appears to be of timber framed construction with corrugated metal sheet claddings. There is a separate outbuilding of brick construction with a felt roof and adjoining greenhouse.
Outside areas and boundaries	Visually inspected.
	The property has private gardens to front, side and rear finished in various surfaces with two driveways. Boundaries are mixed style including timber fence.
[a.ii	I.o
Ceilings	Visually inspected from floor level.
	Plaster and plasterboard lined with some textured plaster ceiling coatings.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Mainly solid hard plaster with some lath plaster linings in places.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Flooring is of suspended timber throughout.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Skirtings and facings are timber. Internal doors are hollow panel units and partly timber frame/glazed. Kitchen fittings comprise older style wall and floor mounted units.

Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There is an enclosed solid fuel stove burner within the living
	room.
Internal decorations	Visually inspected.
	Wallpaper and paint with some textured plaster coatings in places.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Electricity appears to be from the mains supply with the meter and consumer unit located in bedroom three.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Gas is from a private LPG supply with bulk storage tank located in the garden.

Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Cold water may be from a private source although not fully identifiable. There appears to be a filter/treatment system within the rear vestibule. A cold water storage tank within the roof void appears to be formed in PVC but was not closely inspectable.

The sanitary arrangements comprise a four piece white suite in the bath/shower room.

Heating and hot water

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

The property has a system of central heating via radiators which is thought to be fired from the kitchen AGA style boiler and LPG gas. There is an insulated hot water cylinder located in a kitchen cupboard.

Drainage

Drainage covers etc. were not lifted.

Neither drains nor drainage systems were tested.

Foul drainage is assumed to be to a septic tank or similar arrangement although unconfirmed.

Fire, smoke and burglar alarms Visually inspected. No tests whatsoever were carried out to the system or appliances. All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbonfuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the

ownership.

purchasers responsibility to confirm that the property will comply with these standards following a change of

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

Windows and external doors were not all fully opened or tested.

No access was available to any sub-floor areas.

The had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. No access was available beneath sanitary or kitchen fittings.

We were able to partially inspect both roof void areas although full and safe access was prevented by a layer of insulation. Flat roof coverings were not inspectable.

We were not able to enter the outbuildings.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- (4) Flashing
- 5) Ridge ventilation
- 6 Ridge board
- 7 Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- 14) Trusses
- (15) Collar
- 16) Insulation
- (17) Parapet gutter
- 18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- 26) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- (33) Damp proof course
- (34) Base course
- (35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	•

Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation	
Repair category	2
Notes	One or two areas of damp ceiling plaster were noted thought to be due to recent roof leakage and repairs are required. Condensation staining was noted elsewhere, possibly related to the property being unoccupied at present. Traces of wood bore infestation were noted to roof timbers. A precautionary check of the entire property should be carried out by a reputable timber/damp specialist contractor prior to purchase and estimates obtained for any required remedial works.

Chimney stacks	
Repair category	1
Notes	Our inspection of chimneys was limited but they are of an age and style where a degree of regular ongoing maintenance should be anticipated.

Roofing including roof space	
Repair category	2
Notes	A number of loose and broken roof slates and components were noted. There was evidence of water ingress within the roof void including stained and soft timbers. There is an older style skylight window. Felt roof coverings will have a limited lifespan. The roof appears to require some patch repair and at least a degree of future regular ongoing maintenance. The advice of a reputable roofing contractor should be obtained.

Rainwater fittings	
Repair category	2
Notes	Gutters and downpipes appear to be in reasonable condition although at least one downpipe is thought to be blocked and overflowing. Gutters would benefit from being cleared of vegetation and debris.

Main walls	
Repair category	2
Notes	Some localised wear and tear items were noted. A vent cover at the rear elevation is missing and vermin ingress was noted within the property.

Windows, external doors and joinery	
Repair category	2
Notes	Some repairs required to areas of external joinery. Windows were in reasonable condition where opened/tested although not all units were checked and some wear and tear items were noted in places.

External decorations	
Repair category	1
Notes	Decoration required following repairs.

Conservatories/porches	
Repair category	N/A
Notes	

Communal areas	
Repair category	N/A
Notes	

Garages and permanent outbuildings	
Repair category	2
Notes	Outbuildings are in a neglected condition and will require to be fully overhauled.

Outside areas and boundaries	
Repair category	2
Notes	Some routine maintenance required to boundaries and garden surfaces. Several mature trees within the grounds of the property may require future professional maintenance.

Ceilings	
Repair category	2
Notes	Localised areas of damp and cracked plaster may require future repair.

Internal walls	
Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors	
Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.

Internal joinery and kitchen fittings	
Repair category	2
Notes	Kitchen and other internal joinery fittings are dated and due for replacement. Internal glazed doors should be checked for safety glass.

Chimney breasts and fireplaces	
Repair category	2
Notes	The stove burner appears to be damaged.
	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.

Internal decorations	
Repair category	2
Notes	Re-decoration required throughout.

Cellars	
Repair category	N/A
Notes	

Electricity	
Repair category	2
Notes	The electrical installation appears to be mainly on modern lines, however some additional socket outlets are required in places and further future upgrading may be required. A precautionary check should be carried out by a registered electrician.

Gas	
Repair category	1
Notes	There appears to be a private LPG supply.
	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings	
Repair category	2
Notes	The property may have a private water supply and this should be confirmed. The source and purity of the supply have not been confirmed as part of our report and any purchaser will require to fully satisfy themselves in this respect prior to conclusion of missives. Sanitary fittings are dated in places and due for upgrading.

Heating and hot water		
Repair category	2	
Notes	The heating system appears to be fired by an LPG stove boiler in the kitchen. This is of an older style and may be due to for replacement. The advice of a reputable heating contractor should be obtained.	

Drainage	
Repair category	2
Notes	Foul drainage is assumed to be to a septic tank or similar which is not been identified or checked. SEPA consents are assumed to be available.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	2
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	1
Conservatories/porches	N/A
Communal areas	N/A
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	2
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	N/A
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	2

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Wherea lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?		Gro	und	
2. Are there three steps or fewer to a main entrance door of the property?	Yes	X	No	
3. Is there a lift to the main entrance door of the property?	Yes		No	X
4. Are all door openings greater than 750mm?	Yes		No	X
5. Is there a toilet on the same level as the living room and kitchen?	Yes	X	No	
6. Is there a toilet on the same level as a bedroom?	Yes	X	No	
7. Are all rooms on the same level with no internal steps or stairs?	Yes	X	No	
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	X	No	

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property appears to have a private water supply. This should be confirmed and any purchaser should fully satisfy themselves with regard to the reliability and purity of the supply.

There are assumed to be SEPA consents in place for the private drainage arrangements.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £410,000 (FOUR HUNDRED AND TEN THOUSAND POUNDS STERLING)

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £180,000 (ONE HUNDRED AND EIGHTY THOUSAND POUNDS STERLING).

Signed	Graeme Stewart Electronically signed :- 04/01/2024 12:51
Report author	Graeme Stewart
Company name	J & E Shepherd Chartered Surveyors
Address	22 Miller Road Ayr KA7 2AY
Date of report	12/12/2023



www.shepherd.co.uk

Property Address	
Address Seller's Name Date of Inspection	Broomlands Cottage, Maybole, KA19 7QF Mr R Kelly (Executor) 12/12/2023
Property Details	
Property Type House Purpose built flat	X Bungalow Purpose built maisonette Converted maisonette Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style X Detached Back to back	Semi detached Mid terrace End terrace High rise block Low rise block Other (specify in General Remarks)
Does the surveyor believe that the partial military, police? Flats/Maisonettes only Floor(s) on what Approximate Year of Construction	property was built for the public sector, e. g. local authority, No. of floors in block No. of units in block 1900 No. of units in block
Tenure	
X Absolute Ownership	Other
Accommodation	
Number of Rooms 2 Living room 1 Bathroom(s	
Gross Floor Area (excluding garage	es and outbuildings) 137 m² (Internal) m² (External)
Residential Element (greater than 4	0%) X Yes No
Garage / Parking / Outbuildings	
X Single garage Double gar	rage Parking space No garage / garage space / parking space
Available on site?	No
Permanent outbuildings:	
None.	

Construction
Walls Brick X Stone Concrete Timber frame Other (specify in General Remarks) Roof Tile X Slate Asphalt Felt Other (specify in General Remarks)
Titol Education Education Education Education
Special Risks
Has the property suffered structural movement?
If Yes, is this recent or progressive?
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in Yes X No the immediate vicinity?
If Yes to any of the above, provide details in General Remarks.
Service Connections
Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks
Drainage Mains X Private None Water X Mains Private None
Electricity X Mains Private None Gas Mains X Private None Central Heating X Yes Partial None
Brief description of Central Heating and any non mains services:
LPG fired central heating via radiators - not tested.
Site
Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.
Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)
Location
Residential suburb Residential within town / city Mixed residential / commercial Shared service connections
Commuter village Remote village X Isolated rural property Other (specify in General Remarks)
Planning Issues
Has the property been extended / converted / altered? Yes X No If Yes provide details in General Remarks.
Roads
Made up road Unmade road Partly completed new road Pedestrian access only X Adopted Unadopted

General Remarks		
The subjects are located within a rural position several miles from all main amenities.		
At the time of inspection the property was found to be in need of extensive upgrading and refurbishment throughout.		
It assumed there are SEPA consents in place for private drainage arrangements.		
It should be confirmed if there is a private water supply as well as the reliability and purity of the source/treatment faciliti	es.	
Essential Repairs		
None.		
Estimated cost of essential repairs		
Retention recommended? Yes X No		
Retention amount		
Comment on Mortgageability		
The property may form suitable security for mortgage purposes subject to the specific lending criteria of any mortgage p	provider.	
Valuation		
Market value in present condition	£ 180,000	
Market value on completion of essential repairs	£	
Insurance reinstatement value	£ 410,000	
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)		
Is a reinspection necessary?	Yes X No	

Declaration

Signed Graeme Stewart

Electronically signed :- 04/01/2024 12:51

Surveyor's name Graeme Stewart
Professional qualifications DipSurv, MRICS

Company name J & E Shepherd Chartered Surveyors

Address 22 Miller Road, Ayr, KA7 2AY

Telephone 01292 267987

Email Address ayr@shepherd.co.uk

Date of Inspection 12/12/2023



Energy Performance Certificate



Energy Performance Certificate (EPC)

Dwellings

Scotland

BROOMLANDS COTTAGE, MAYBOLE, KA19 7QF

Dwelling type: Detached bungalow
Date of assessment: 12 December 2023
Date of certificate: 04 January 2024

Total floor area: 137 m²

Primary Energy Indicator: 464 kWh/m²/year

Reference number: 0017-0122-5639-2532-3296

Type of assessment: RdSAP, existing dwelling **Approved Organisation:** Elmhurst


Main heating and fuel: Boiler and radiators, LPG

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£16,653	See your recommendations report for more
Over 3 years you could save*	d save* £10,266	

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

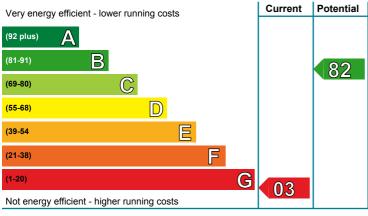


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band G (3)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

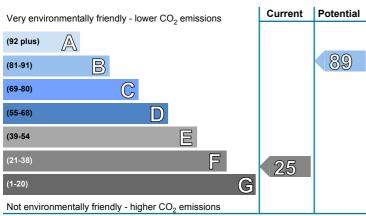

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (25)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£435.00
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£324.00
3 Cavity wall insulation	£500 - £1,500	£897.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	***	***
	Cavity wall, as built, partial insulation (assumed)	***	★★★☆☆
Roof	Pitched, 150 mm loft insulation Flat, limited insulation (assumed)	★★★☆ ★★☆☆☆	**** ***
Floor	Suspended, no insulation (assumed)	_	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, LPG	****	***
Main heating controls	Programmer, TRVs and bypass	***	★★★☆☆
Secondary heating	Room heaters, dual fuel (mineral and wood)	_	_
Hot water	From main system	****	***
Lighting	Low energy lighting in 33% of fixed outlets	***	★★★☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 101 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 14 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 11.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£13,803 over 3 years	£4,959 over 3 years	
Hot water	£1,938 over 3 years	£516 over 3 years	You could
Lighting	£912 over 3 years	£912 over 3 years	save £10,266
Totals	£16,653	£6,387	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving per year	Rating after improvement	
				Energy	Environment
1	Increase loft insulation to 270 mm	£100 - £350	£145	G 4	F 27
2	Flat roof or sloping ceiling insulation	£850 - £1,500	£108	G 6	F 28
3	Cavity wall insulation	£500 - £1,500	£299	G 9	F 30
4	Internal or external wall insulation	£4,000 - £14,000	£418	G 14	F 34
5	Floor insulation (suspended floor)	£800 - £1,200	£576	F 22	E 41
6	Add additional 80 mm jacket to hot water cylinder	£15 - £30	£32	F 22	E 41
7	Upgrade heating controls	£350 - £450	£325	F 27	E 45
8	Condensing boiler	£2,200 - £3,000	£1285	E 53	D 64
9	Solar water heating	£4,000 - £6,000	£91	D 56	D 66
10	Replacement glazing units	£1,000 - £1,400	£142	D 59	C 69
11	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£642	D 66	C 75
12	Wind turbine	£15,000 - £25,000	£1313	B 82	B 89

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation
- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

4 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

5 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

6 Hot water cylinder insulation

Increasing the thickness of existing insulation by adding an 80 mm cylinder jacket around the hot water cylinder will help maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. The jacket should be fitted over the top of the existing foam insulation and over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

7 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

8 Condensing boiler (separate from the range cooker)

A condensing boiler is capable of higher efficiencies than other types of boiler, meaning it will burn less fuel to heat the property. It is recommended to install a separate condensing boiler, independent of the range cooker, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

9 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

10 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

11 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

12 Wind turbine

A wind turbine provides electricity from wind energy. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Wind turbines are not suitable for all properties. The system's effectiveness depends on local wind speeds and the presence of nearby obstructions, and a site survey should be undertaken by an accredited installer. Planning permission might be required and building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for a wind turbine, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	21,564	(702)	(1,435)	(2,004)
Water heating (kWh per year)	2,983			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:
Assessor membership number:
Company name/trading name:
Address:

Mr. Graeme Stewart
EES/012602
J & E Shepherd
13 Albert Square
Dundee

DD1 1XA 01382 200454

Phone number: 01382 200454 Email address: dundee@shepherd.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT







Property address	Broomlands Cottage Maybole KA19 7QF
Seller(s)	Mr R Kelly (Executor)
Completion date of property questionnaire	22/12/2023

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property?
2.	Council tax
	Which Council Tax band is your property in?
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	• Driveway
	Shared parking
	On street
	Resident permit
	Metered Parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?

5.	Listed buildings			
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?			
6.	Alterations/additions/extensions			
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?			
	If you have answered yes, please describe below the changes which you have made:			
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?			
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.			
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:			
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?			
	If you have answered yes, please answer the three questions below:			
	(i) Were the replacements the same shape and type as the ones you replaced?			
	(ii) Did this work involve any changes to the window or door openings?			
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):			
	Please give any guarantees which you received for this work to your solicitor or estate agent.			
7.	Central heating			
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).			
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).			

	If you have answered yes, ple	ease answer the three questio	ns below:	
	i) When was your central heating system or partial central heating system installed?			
	(ii) Do you have a maintenand	ce contract for the central hea	ting system?	
	If you have answered yes, ple you have a maintenance con	ease give details of the compa tract:	ny with which	
	(iii) When was your maintena (Please provide the month ar	nce agreement last renewed? nd year).		
8.	Energy Performance Certification	ate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?			
9.	Issues that may have affected your property			
a.	Has there been any storm, flood, fire or other structural damage to the property while you have owned it?			
If you have answered yes, is the damage the subject of any outstanding insurance claim?			outstanding	
b.	Are you aware of the existend	ce of asbestos in your propert	y?	
	If you have answered yes, ple	ease give details:		
10.	Services			
a. Please tick which services are connected to your property and give details supplier:			and give details of the	
	Services	Connected	Supplier	
	Gas or liquid petroleum gas			
	Water mains or private water supply			
	Electricity			
	Mains drainage			
	Telephone			
	Cable TV or satellite			

	Broadband			
b.	Is there a septic tank system at your property?			
	If you have answered yes, please answer the two questions below:			
	(i) Do you have appropriate consents for the discharge from your septic tank?			
	(ii) Do you have a maintenance contract for your septic tank?			
	If have answered yes, details of the company with which you have a maintenance contract:			
11.	Responsibilities for shared or common areas			
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?			
	If you have answered yes, please give details:			
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?			
	If you have answered yes, please give details:			
C.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?			
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?			
	If you have answered yes, please give details:			
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?			
	If you have answered yes, please give details:			
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)			
	If you have answered yes, please give details:			
12.	Charges associated with the property			
a.	Is there a factor or property manager for your property?			

	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:		
b.	Is there a common buildings insurance policy?		
	If you have answered yes, is the cost of the insurance included in monthly/annual factor's charges?		
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.		
13.	Specialist work		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?		
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.		
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?		
	If you have answered yes, please give details:		
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?		
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.		
	Guarantees are held by:		
14.	Guarantees		
a.	Are there any guarantees or warranties for any of the following?		
	(i) Electrical work		
	(ii) Roofing		
	(iii) Central heating		
	(iv) National House Building Council (NHBC)		
	(v) Damp course		
	(vi) Any other work installations? (for example, cavity wall installation, underpinning, indemnity policy)		

b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):		
C.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:		
15.	Boundaries		
	So far as you are aware, has any boundary of your property been moved in thelast 10 years?		
	If you have answered yes, please give details:		
16.	Notices that affect your property		
	In the past three years have you ever received a notice:		
a.	advising that the owner of a neighbouring property has made a planning application?		
b.	that affects your property in some other way?		
C.	that requires you to do any maintenance, repairs or improvements to your property?		
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

Declaration by the seller(s)/or other authorised body or person(s)

This PQ could not be completed, the vendor is absentee and does not hold any information on the history of the property and has never stayed in the subject property

Name(s): Robert kelly

Date: 22/12/2023

Residential

Home Report

Mortgage & Re-Mortgage Valuation Home & Flat Buyer Report

Energy Performance Certificate (EPC)

Private Sale Valuation

Inheritance Tax Valuation

Capital Gains Tax Valuation

Separation Valuation

Driveby Valuation

Desktop Valuation

New Build, Development & Plot Valuation

Extension & Alteration Valuation

Portfolio Valuation

Rental Valuation

Expert Witness Report

Council Tax Appeal

Aberdeen▲ ▲ 01224 202800

△ 01292 267987

Coatbridge △ 01236 436561

Cumbernauld

Dalkeith

Dumbarton

△ 01236 780000

△ 0131 663 2780

△ 01389 731682

Bespoke Condition Report

Commercial

Commercial Valuation

Commercial Agency

Acquisitions & Disposals

Commercial Lease Advisory

Rent Reviews

Asset Management

Project Consultancy

Development Appraisals

Elgin ▲ 01343 553939

△ 01324 635 999

Fraserburgh △ 01346 517456

△ 01896 750150

△ ▲ 0141 331 2807

Glasgow South

△ 0141 649 8020

Galashiels

Glasgow

Falkirk

Commercial Property Auctions

Property Management

Professional Services Licensed Trade / Leisure

Glasgow West End

△ 0141 353 2080 Greenock

△ 01475 730717

Hamilton △ 01698 897548

Inverness

△ ▲ 01463 712239

Kilmarnock

△ 01563 520318

Kirkcaldy △ 01592 205442

Livingston△ 01506 416777

Property &

Quantity Surveying

Building Surveying

Principal Designer

Clerk of Works

Commercial EPC

Fire Engineering

Employer's Agent

Housing Services

Energy Department

Mediation Services

Development Monitoring

Project Management

Construction

Health & Safety Management

Dispute Resolution Support Services

Montrose △ 01674 676768

Motherwell △ 01698 252229

Musselburgh

△ 0131 653 3456

Oban △ 01631 707 800

Paisley
△ 0141 889 8334

Perth

△ 01738 638188

▲ 01738 631631

Peterhead ▲ 01779 470766

St Andrews

△ 01334 477773

▲ 01334 476469

Saltcoats △ 01294 464228

Stirling

△ 01786 450438 ▲ 01786 474476

SHEPHERD



Dumfries▲ ▲ 01387 264333

△ 01382 200454

▲ 01382 220699

▲ 01383 731841

△ 01355 248535

△ 0131 2251234

▲ 0131 557 9300

East Kilbride

Edinburgh

Dunfermline

Dundee



