

YOUR ONESURVEY HOME REPORT

ADDRESS

15 Ashton Road
Glasgow
G12 8SP

PREPARED FOR

T S Anderson Ltd

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Corum - West End

HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Single Survey	Final	Glasgow North - Allied Surveyors Scotland Ltd	11/04/2025
Mortgage Certificate	Final	Glasgow North - Allied Surveyors Scotland Ltd	11/04/2025
Property Questionnaire	Final	T S Anderson Ltd	10/04/2025
EPC	FileUploaded	Glasgow North - Allied Surveyors Scotland Ltd	15/04/2025
Additional Documents	FileUploaded		

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	GF/9470
---------------------------	---------

Executry Of	T S Anderson Ltd
--------------------	------------------

Selling address	15 Ashton Road Glasgow G12 8SP
------------------------	--------------------------------------

Date of Inspection	09/04/2025
---------------------------	------------

Prepared by	Grant Robertson, FRICS Glasgow North - Allied Surveyors Scotland Ltd
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property under report comprises a substantial two storey over lower ground floor mid terraced townhouse which forms part of terrace of similar quality properties within the Hillhead district of Glasgow, close to all local amenities and facilities.
Accommodation	Ground Floor: Entrance vestibule hallway, living room, dining room, kitchen. First Floor: Four bedrooms, bathroom. Lower Ground Floor: Sitting room, kitchen, utility room, bathroom.
Gross internal floor area (m2)	258 sq. metres.
Neighbourhood and location	The property is located in the Hillhead district of Glasgow, forming part of the Glasgow West Conservation Area. The property takes access from the rear off Ashton Lane for off street car parking which forms part of the vibrant network of lanes with restaurants and other hospitality businesses. Hillhead Underground Station is within close walking distance.
Age	The property is understood to have been built in 1862 and is listed Category B.
Weather	Weather conditions at the time of inspection was dry and bright.
Chimney stacks	The chimney stacks which are mutual to the adjoining property, number 4 and are of either stone or stone with brick and render finishes, concrete or stone coping stones and clay pots. Flashings, where seen, are formed in lead. <i>Visually inspected with the aid of binoculars where required.</i>

Roofing including roof space	<p>The main roof is double pitched and slate clad with a central valley section which is unseen from street level, assumed to be finished in lead. There is also a small section of flat roof finish above the bay window stack on the front elevation and within a section of the central valley gutter. These areas are unseen from ground level or roof level.</p> <p><i>Sloping roofs were visually inspected with the aid of binoculars where required.</i></p> <p><i>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.</i></p> <p><i>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</i></p> <p><i>Roofs are prone to water penetration during adverse weather but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</i></p>
Rainwater fittings	<p>The rainwater fittings are typical of a property of this type being lead lined parapet gutters to the front elevation with cast iron box downpipes, also to the rear elevation there is PVC gutter with cast iron downpipes.</p> <p><i>Visually inspected with the aid of binoculars where required.</i></p>
Main walls	<p>The main outer walls are of solid stone construction with dressed finishes to the front elevation only.</p> <p><i>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</i></p>
Windows, external doors and joinery	<p>The windows are replacement uPVC double glazed design to both the front and rear elevations with timber external storm doors to the front elevation and double glazed internal door and a solid timber door leading to the rear of the property.</p> <p><i>Internal and external doors were opened and closed where keys were available.</i></p> <p><i>Random windows were opened and closed where possible.</i></p> <p><i>Doors and windows were not forced open.</i></p>
External decorations	<p>Painted finishes to external ironmongery and the stone facing around the front entrance door.</p> <p><i>Visually inspected.</i></p>
Conservatories / porches	Not applicable.
Communal areas	Not applicable.

Garages and permanent outbuildings	<p>There are no permanent outbuildings. There is a timber shed within the rear garden.</p> <p>Visually inspected.</p>
Outside areas and boundaries	<p>There is a small forecourt garden planted with rhododendron and whilst to the rear the garden is laid out to slabs, rhododendron bushes with brick boundary walls to the gable property.</p> <p>Visually inspected.</p>
Ceilings	<p>The ceiling finishes within the property are formed generally in traditional wood, lath and plaster with ornate Angel plaster detailing in the first floor former drawing room.</p> <p>Visually inspected from floor level.</p>
Internal walls	<p>Internal wall finishes are wood, lath and plaster and plaster on hard.</p> <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p>
Floors including sub floors	<p>The floors are generally suspended timber joist construction to the upper levels whilst part of the lower ground floor has solid floor finishes. No access to the sub floor area was possible at the time of inspection.</p> <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p>
Internal joinery and kitchen fittings	<p>Timber internal joinery is generally original to the property with some renewal. The kitchen provides a basic range of wall and floor units.</p> <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p>
Chimney breasts and fireplaces	<p>There are no working fireplaces within the property with gas fires installed within the three fireplaces and no open fires currently in use.</p> <p>Visually inspected. No testing of the flues or fittings was carried out.</p>
Internal decorations	<p>Painted and/or papered wall and ceiling finishes throughout.</p> <p>Visually inspected.</p>
Cellars	Not applicable.

Electricity	<p>Mains supply. 13 amp supply with modern distribution board in the utility room on the front elevation at lower ground floor level.</p> <p><i>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
Gas	<p>Mains supply with meter adjacent to the distribution boards.</p> <p><i>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</i></p>
Water, plumbing and bathroom fittings	<p>Mains water supply. Copper, PVC and potentially lead plumbing where visible. The bathroom fittings which are at the first floor and lower ground floor are dated.</p> <p><i>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</i></p> <p><i>No tests whatsoever were carried out to the system or appliances.</i></p> <p><i>Concealed areas around baths and shower trays cannot be inspected however water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric.</i></p>
Heating and hot water	<p>The property does not benefit from central heating. There are individual gas fires which currently provide space heating and hot water is supplied from an electric immersion heater contained within an older style hot water cylinder in a cupboard off the kitchen.</p> <p><i>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</i></p> <p><i>No tests whatsoever were carried out to the system or appliances.</i></p>
Drainage	<p>Assumed to be by direct fall to the mains sewer.</p> <p><i>Drainage covers etc were not lifted.</i></p> <p><i>Neither drains nor drainage systems were tested.</i></p>

<p>Fire, smoke and burglar alarms</p>	<p>No alarm system in use at the time of inspection. Inadequate fire/smoke detectors.</p> <p><i>Visually inspected.</i></p> <p><i>No test whatsoever were carried out to any systems or appliances.</i></p> <p><i>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</i></p> <p><i>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</i></p> <p><i>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</i></p>
<p>Any additional limits to inspection</p>	<p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p><i>Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.</i></p>

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	<p>The building has in the past suffered from a degree of historic settlement. Within the limits of our inspection, no evidence was noted of any recent or progressive movement and any further significant movement is remote.</p> <p>There is a noticeable hairline crack at first floor level between the hall and rear bedroom but we would not consider this to be demonstrative of a significant issue.</p>

Dampness, rot and infestation	
Repair category:	3
Notes:	<p>Within the lower ground floor, evidence of rising damp is apparent as well as damp penetration apparent at first floor level to the right hand gable wall. An appropriate and detailed inspection by a reputable firm of roofing contractors and rot specialist should be undertaken to ascertain the extent and presence of penetrating damp which may have led to deterioration of supporting timbers and appropriate estimates prepared.</p>

Chimney stacks	
Repair category:	2
Notes:	<p>Evidence of water ingress from the chimney stacks is apparent within the property and appropriate external repairs need to be carried out in conjunction with the co-proprietors of the adjoining building.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Roofing including roof space

Repair category:	2
Notes:	The external roof coverings, where visible, from ground level show evidence of reasonable maintenance, however, the roof is of an age where regular and careful maintenance will be required and where re-slating and re-leading of the roof will also shortly be necessary. Within the first floor of the property and our limited inspection within the roof void, evidence of past water ingress is apparent.

Rainwater fittings

Repair category:	2
Notes:	A comprehensive overhaul of the rainwater fittings to both the front and rear elevations will be required with particular attention required to the eaves gutters to the rear and the parapet gutters to the front. There is evidence of past water staining to the rear wall indicative of recent and significant problems.

Main walls

Repair category:	2
Notes:	The external wall finishes to the front elevation are generally in sound condition, however, to the rear wall weathering and water staining has led to the requirement for refacing and repointing of sections of the stone.

Windows, external doors and joinery

Repair category:	2
Notes:	The replacement windows are generally inappropriate for a building of this listed status and appropriate consents for the installation of same should be exhibited. The window units are dated, not in very good order, and future replacement of the units and together with the external doors (internal door to the front), will be required.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

External decorations

Repair category:	2
Notes:	Renewal of external decorations shortly required.

Conservatories / porches

Repair category:	
Notes:	Not applicable.

Communal areas

Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings

Repair category:	
Notes:	Not applicable.

Outside areas and boundaries

Repair category:	2
Notes:	<p>Maintenance is required to the garden at both front and rear as well as attention to the brick boundary walls to the rear.</p> <p>The rear boundary wall has a set of wooden gates leading to Ashton Lane. They appear to be in satisfactory condition.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair category:	2
Notes:	<p>General overhaul of the ceiling finishes is now required. It is likely that sections of ceiling plaster, particularly at first floor level will require to be renewed.</p> <p>Within the sections of roof space, accessible above the bedroom and within the bathroom at first floor and within the hall cupboard at first floor, there is evidence of deteriorated plasterwork with large sections missing and appropriate repairs will now be required.</p> <p>Elsewhere the extent of the work required to the property is likely to lead to more ceiling plaster being replaced than originally anticipated.</p>

Internal walls	
Repair category:	2
Notes:	<p>A comprehensive overhaul of the internal wall finishes will be required with substantial areas of replastering necessary, particularly at lower ground floor level where damp proofing treatments will be required.</p>

Floors including sub-floors	
Repair category:	2
Notes:	<p>An overhaul of the floor finishes at all levels of the building will be required and it is likely that joinery repairs will be required at lower ground floor level following the damp treatment.</p>

Internal joinery and kitchen fittings	
Repair category:	2
Notes:	<p>General upgrading to internal joinery and replacement of the kitchen fittings is now required.</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney breasts and fireplaces

Repair category:	2
Notes:	A comprehensive overhaul of the chimney breasts, fireplace openings, flues etc. is now required.

Internal decorations

Repair category:	2
Notes:	The property will require a comprehensive redecoration following repair and modernisation works.

Cellars

Repair category:	
Notes:	Not applicable.

Electricity

Repair category:	2
Notes:	Whilst a modern distribution board has been installed, it would appear that large sections of the electrical installation are not compliant with current regulations and we anticipate full rewiring of the property will be necessary.

Gas

Repair category:	2
Notes:	We anticipate renewal of the gas installation, gas meter and pipework will be required.

Water, plumbing and bathroom fittings

Repair category:	2
Notes:	Renewal of water plumbing and bathroom fittings is required throughout.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water

Repair category:	2
Notes:	The installation of a heating system and renewal of the hot water system and removal of all existing gas appliances within the property is required.

Drainage

Repair category:	2
Notes:	Appropriate tests of the drainage will be required as part of the modernisation/refurbishment programme the building requires.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	
Outside areas and boundaries	2
Ceilings	2
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	
Electricity	2
Gas	2
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	2

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Lower Ground, Ground & First.
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer	
<p>We noted no internal alterations for which local authority consent will be required within the time frame of these works having been completed.</p> <p>The installation of double glazing would appear to be contrary to the building's listed status and appropriate consents for the installation of the double glazing should be exhibited. This would include the installation of a new inner entrance door at ground floor level.</p> <p>The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.</p>	
Estimated re-instatement cost (£) for insurance purposes	
£1,400,000 (One Million, Four Hundred Thousand Pounds).	
Valuation (£) and market comments	
The market value of the property, in its present condition, and with vacant possession is £850,000 (Eight Hundred and Fifty Thousand Pounds).	
Report author:	Grant Robertson, FRICS
Company name:	Glasgow North - Allied Surveyors Scotland Ltd
Address:	Herbert House 24 Herbert Street Glasgow G20 6NB
Signed:	Electronically Signed: 284280-B4F3F7A6-C5EE
Date of report:	11/04/2025

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	15 Ashton Road Glasgow G12 8SP	Executry of T S Anderson Ltd Tenure: Ownership
Date of Inspection:	09/04/2025	Reference: GF/9470/GR/LL

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is located in the Hillhead district of Glasgow, forming part of the Glasgow West Conservation Area. The property takes access from the rear off Ashton Lane for off street car parking which forms part of the vibrant network of lanes with restaurants and other hospitality businesses. Hillhead Underground Station is within close walking distance.

2.0 DESCRIPTION

2.1 Age:

The property is understood to have been built in 1862 and is listed Category B.

The property under report comprises a substantial two storey over lower ground floor mid terraced townhouse which forms part of terrace of similar quality properties within the Hillhead district of Glasgow, close to all local amenities and facilities.

3.0 CONSTRUCTION

Stone built outer walls with pitched and slate clad roof.

4.0 ACCOMMODATION

Ground Floor: Entrance vestibule hallway, living room, dining room, kitchen.

First Floor: Four bedrooms, bathroom.

Lower Ground Floor: Sitting room, kitchen, utility room, bathroom.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
Central Heating:	None.						

6.0 OUTBUILDINGS

Garage: None.

Others: None.

7.0	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.				
A comprehensive and detailed refurbishment of the external building fabric and internal fitting services and decoration is required.					
8.0	ESSENTIAL REPAIR WORK (as a condition of any mortgage or, to preserve the condition of the property)				
A detailed investigation by a timber specialist and roofing contractor should be carried out to give consideration to areas of penetrating and rising damp currently affecting the property.					
8.1 Retention recommended:					
9.0	ROADS & FOOTPATHS				
Understood to be made up and adopted.					
10.0	BUILDINGS INSURANCE (£):	1,400,000	GROSS EXTERNAL FLOOR AREA	310	Square metres
	<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>				
11.0	GENERAL REMARKS				
We noted no internal alterations for which local authority consent will be required within the time frame of these works having been completed.					
The installation of double glazing would appear to be contrary to the building's listed status and appropriate consents for the installation of the double glazing should be exhibited. This would include the installation of a new inner entrance door at ground floor level.					
The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.					
Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.					
12.0	VALUATION On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.				
12.1	Market Value in present condition (£):	£850,000	Eight Hundred and Fifty Thousand Pounds		
12.2	Market Value on completion of essential works (£):				
12.3	Suitable security for normal mortgage purposes?	Yes			
12.4	Date of Valuation:	09/04/2025			

Signature:		Electronically Signed: 284280-B4F3F7A6-C5EE		
Surveyor:	Grant Robertson	FRICS	Date:	11/04/2025
Glasgow North - Allied Surveyors Scotland Ltd				
Office:	Herbert House 24 Herbert Street Glasgow G20 6NB		Tel: 0141 337 1133 Fax: email: glasgow.north@alliedsurveyorsscotland.com	

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	15 Ashton Road Glasgow G12 8SP
-------------------------	--------------------------------------

Customer	T S Anderson Ltd
-----------------	------------------

Customer address	15 Ashton Road Glasgow G12 8SP
-------------------------	--------------------------------------

Prepared by	Grant Robertson, FRICS Glasgow North - Allied Surveyors Scotland Ltd
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

15 ASHTON ROAD, GLASGOW, G12 8SP

Dwelling type: Mid-terrace house
Date of assessment: 09 April 2025
Date of certificate: 15 April 2025
Total floor area: 248 m²
Primary Energy Indicator: 895 kWh/m²/year

Reference number: 0110-2051-3040-2105-3801
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Room heaters, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*

£33,579


See your recommendations report for more information

Over 3 years you could save*

£27,144

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

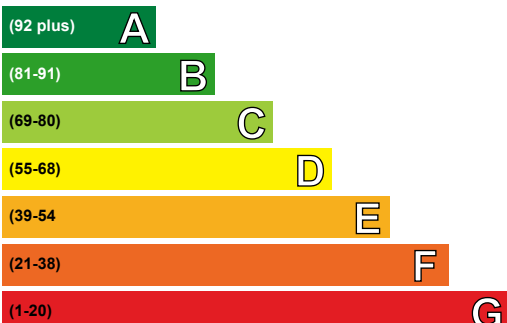

Current	Potential
	78
01	


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band G (1)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

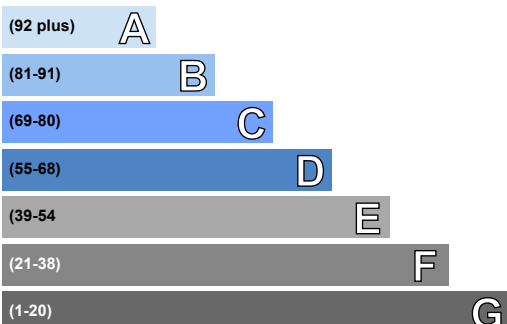

Current	Potential
	70
01	

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band G (1)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£4821.00
2 Internal or external wall insulation	£4,000 - £14,000	£4383.00
3 Floor insulation (suspended floor)	£800 - £1,200	£1461.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, no insulation	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Room heaters, mains gas	★☆☆☆☆	★☆☆☆☆
Main heating controls	Appliance thermostats	★★★★★☆☆	★★★★★☆☆
Secondary heating	Portable electric heaters (assumed)	—	—
Hot water	Electric immersion, standard tariff	★☆☆☆☆	★★☆☆☆
Lighting	Low energy lighting in all fixed outlets	★★★★★★	★★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 158 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 39 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 32.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£31,374 over 3 years	£5,391 over 3 years	
Hot water	£1,704 over 3 years	£543 over 3 years	
Lighting	£501 over 3 years	£501 over 3 years	
Totals	£33,579	£6,435	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£1607		
2 Internal or external wall insulation	£4,000 - £14,000	£1461		
3 Floor insulation (suspended floor)	£800 - £1,200	£487		
4 Change room heaters to condensing boiler	£3,000 - £7,000	£5493		
5 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£395		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Condensing boiler

A full central heating system using a condensing boiler will provide space and water heating at greater efficiency than gas room heaters, meaning it will burn less fuel to heat this property, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	36,677	(5,697)	N/A	(5,180)
Water heating (kWh per year)	2,348			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Grant Robertson
Assessor membership number:	EES/008401
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	24 Herbert Street Glasgow G20 6NB
Phone number:	01413309950
Email address:	glasgow.north@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address	15 Ashton Road Glasgow G12 8SP
Seller(s)	T S Anderson Ltd
Completion date of property questionnaire	10/04/2025
Note for sellers	

1.	Length of ownership
	How long have you owned the property? 40+ YEARS
2.	Council tax
	Which Council Tax band is your property in? (Please circle) <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input type="checkbox"/> F <input checked="" type="checkbox"/> G <input type="checkbox"/> H
3.	Parking
	What are the arrangements for parking at your property? (Please tick all that apply) Garage <input type="checkbox"/> Allocated parking space <input type="checkbox"/> Driveway <input checked="" type="checkbox"/> Shared parking <input type="checkbox"/> On street <input type="checkbox"/> Resident permit <input type="checkbox"/> Metered parking <input type="checkbox"/> Other (please specify): To rear of property off Ashton Lane

4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	[x]YES []NO []Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	[x]YES []NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	[]YES [x]NO
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	[]YES []NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	[]YES [x]NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	[]YES []NO
	(ii) Did this work involve any changes to the window or door openings?	[]YES []NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	
7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[]YES [x]NO []Partial

property questionnaire

	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).																									
	If you have answered yes, please answer the three questions below:																									
	(i) When was your central heating system or partial central heating system installed?																									
	(ii) Do you have a maintenance contract for the central heating system?	<input type="checkbox"/> YES <input type="checkbox"/> NO																								
	If you have answered yes, please give details of the company with which you have a maintenance contract																									
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).																									
8.	Energy Performance Certificate																									
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO																								
9.	Issues that may have affected your property																									
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO																								
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<input type="checkbox"/> YES <input type="checkbox"/> NO																								
b	Are you aware of the existence of asbestos in your property?	<input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know																								
	If you have answered yes, please give details:																									
10.	Services																									
a	Please tick which services are connected to your property and give details of the supplier:																									
	<table border="1"> <thead> <tr> <th>Services</th><th>Connected</th><th>Supplier</th></tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td><td>Y</td><td></td></tr> <tr> <td>Water mains or private water supply</td><td>Y</td><td>Scottish Water</td></tr> <tr> <td>Electricity</td><td>Y</td><td>Scottish Power</td></tr> <tr> <td>Mains drainage</td><td>Y</td><td>Scottish Water</td></tr> <tr> <td>Telephone</td><td>Y</td><td>Was Virgin (Now Disconnected)</td></tr> <tr> <td>Cable TV or satellite</td><td>N</td><td></td></tr> <tr> <td>Broadband</td><td>Y</td><td>As above telephone</td></tr> </tbody> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	Y		Water mains or private water supply	Y	Scottish Water	Electricity	Y	Scottish Power	Mains drainage	Y	Scottish Water	Telephone	Y	Was Virgin (Now Disconnected)	Cable TV or satellite	N		Broadband	Y	As above telephone	
Services	Connected	Supplier																								
Gas or liquid petroleum gas	Y																									
Water mains or private water supply	Y	Scottish Water																								
Electricity	Y	Scottish Power																								
Mains drainage	Y	Scottish Water																								
Telephone	Y	Was Virgin (Now Disconnected)																								
Cable TV or satellite	N																									
Broadband	Y	As above telephone																								
b	Is there a septic tank system at your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO																								

	If you have answered yes, please answer the two questions below:	
	(i) Do you have appropriate consents for the discharge from your septic tank?	[] YES [] NO [] Don't know
	(ii) Do you have a maintenance contract for your septic tank?	[] YES [] NO
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
11.	Responsibilities for shared or common areas	
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	[] YES [x] NO [] Don't know
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	[] YES [x] NO [] N/A
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[] YES [x] NO
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	[] YES [x] NO
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	[] YES [x] NO
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[] YES [x] NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[] YES [x] NO
b	Is there a common buildings insurance policy?	[] YES [x] NO [] Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	

c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[] YES [x] NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[] YES [x] NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[] YES [] NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
c	that requires you to do any maintenance, repairs or improvements to your property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): Kevin Thompson

Capacity: ☐ Owner
☒ Legally Appointed Agent for Owner

Date: 10/04/2025

Ref No: DB/0425/11746

Date: 17th April 2025

Report To: Corum Property
82 Hyndland Road
Glasgow
G12 9UT

Property Address: 15 Ashton Road
Glasgow
G12 8SP

Dear Mr Graham,

Following instructions, an inspection to the above property address regarding dampness to the upper floor and lower walls within the lower ground level was carried out on the 16th April 2025 and our observations are set out overleaf.

All designated areas are detailed as facing the front elevation of the property from the outside.

Our inspection was carried out as per your specific instructions. If there appears to be any omissions or if you believe that we may have misinterpreted your survey instructions, please inform us immediately.

Should you feel anything in the following report is unclear or you require any additional information, please do not hesitate to contact our office or Surveyor direct on **07960 169185** or email at **atds1@btconnect.com**.

To confirm acceptance of the enclosed estimate, please complete details on the acceptance form located to the rear of this report and return to our office. Acceptance can also be confirmed in the first instance by telephone. We will attempt to have Specialist repairs carried out to the preferred dates of the client. In addition, we respectfully request the client to carefully read our enclosed checklist and sign accordingly. This should be returned with any signed acceptance of quotations.

No allowance has been made in our enclosed estimate for any other works or treatments other than those detailed under Recommendations in this report or for disturbance/reinstatement to decoration i.e. tiles, wallpaper, paintwork, carpets, cornices etc.

Please note, should our estimate for the detailed repairs be accepted, we will require the removal of all furnishings, floor coverings and where applicable heating/plumbing goods to the areas subject to repairs, treatment and disturbance prior to our arrival on site.

Water ingress from the mutual wall at the rear right corner has caused plaster degeneration and excessively moisture meter readings to the upper section in the rear right room. We recommend the replacement of the affected wallplaster and a precautionary fungicidal treatment to the exposed wall prior to plaster reinstatement. We were unable to gain access to the roof void during the course of our inspection. Naturally, we cannot comment upon the condition of unseen or inaccessible timbers.

Excessively moisture meter readings indicative of rising dampness were obtained to the walls detailed on the enclosed drawing by the broken red line. We recommend the insertion of a new chemical damp proof course to these walls with the subsequent re-plastering/ventilated membrane system application one metre high where detailed.

RECOMMENDATIONS

Our tradesmen to carry out the undernoted:

1.
Remove skirtings as required and set aside for refitting. Skirtings are left in situ where possible.
2.
Strip detailed wallplaster up to heights indicated on the enclosed drawing.
3.
Drill and inject a chemical damp proof course to denoted walls with vertical isolations where detailed.
4.
Apply ventilated membrane system to indicated exposed wall surfaces and secure.
5.
Cover ventilated membrane system with gyproc and plaster skim finish to match.
6.
Strip detailed wallplaster to the upper level and treat exposed wall using a fungicidal solution as a precautionary measure.
7.
Reinstate disturbed wallplaster to match lines of existing.
8.
Refit existing skirtings.
9.
Clear all resultant debris and discard.

We would stress at this stage that the inspected areas of the property had fitted floor coverings and furniture at the time of our survey and this severely restricted our inspection.

Our report is based upon the evidence clearly visible at the time of our survey and without disruption to decoration, plasterwork, furnishings and fitted floor coverings.

Whilst we have been as thorough as possible during our inspection, we cannot guarantee that inaccessible, hidden or concealed timbers obscured by furnishings are free of decay or defect.

External timberwork exposed to normal weathering was not included in our inspection.

CLIENTS RESPONSIBILITIES/REPAIRS

- A. A minimum 13 amp electricity supply, together with normal lighting facility is to be made available.
- B. To ensure a active water supply.
- C. To clear all apartments listed for treatments/repairs of all furnishings and fitted floor coverings prior to our arrival on site and to protect other apartments from possible dust spread.

SAFE CONTRACTOR APPROVED

Alliance Timber & Damp Specialists Ltd assure our clients all works carried out by our Company meet all current Health & Safety standards and we are fully insured with regards public liability. All works will carry full risk assessment.

30 YEAR GUARANTEE

Our Company Guarantee Certificate will be issued upon the invoice being settled with cleared funds and will remain valid for a period of 30(Thirty) years.

ADDITIONAL CONSTRUCTION GUARANTEE PROTECTION

As Alliance Timber & Damp Specialists Ltd. are registered installers, we can offer a further 20 year protected guarantee. A separate cost of £990 + VAT would be payable with the invoice. Please inform our office should you wish to undertake this added guarantee protection.

Yours sincerely

D Brown

David Brown

Surveyor

ALLIANCE


15 ASHTON ROAD, GLASGOW

----- DAMP PROOF COURSE (DPC)

—— VERTICAL DPC

~~~~~ REPLASTER/MEMBRANE UP TO 1m HIGH

oooo REPLASTER/SURFACE TREAT WALL.

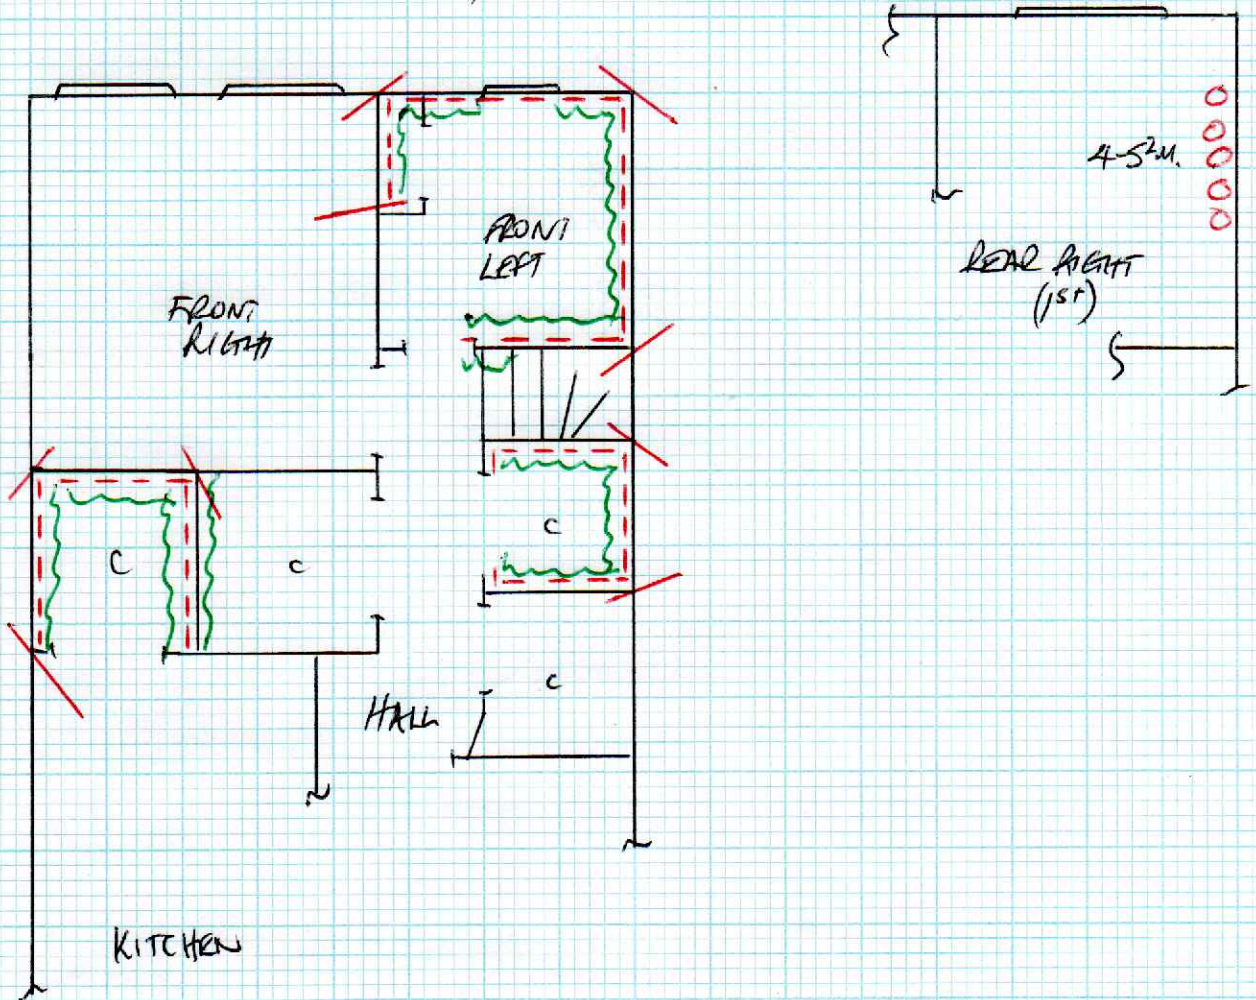

**ACCEPTANCE OF QUOTATION**

**Reference Number and Date:-** DB/0425/11746 17<sup>th</sup> April 2025

**Customer's Name and Address:-** .....

.....

.....

.....

**Property Address:** 15 Ashton Road  
Glasgow  
G12 8SP

**Quotation For Recommended Treatments:-** £8,550 + VAT

I accept your offer for carrying out the work detailed in the attached report at the price quoted and I instruct you to proceed. I have read and agree with the conditions below.

In the course of carrying out the detailed repairs, should further repairs be found be necessary, I understand that this should be subject to a further quotation and contract, to be prepared for my consideration.

I understand that full payment is due within seven (7) days of invoice date.

I accept responsibilities for ensuring that all electrical circuits and installations within the treatment area are safe and in good order prior to the commencement of this contract.

I understand that any structural defects referred to in this report as being a contributory cause of the outbreak of insect and/or fungal attack or which may become apparent during the course of the repairs will be remedied. I will maintain the building in a sound and weatherproof condition during the period covered by the Guarantee.

**Print Name**.....

**Signature**.....

**Date**.....**Telephone Number**.....

**Email Address**.....