

Roselea,
4 Castle Street,
IRVINE,
KA12 8RJ

Home Report



DM HALL

Roselea,
4 Castle Street,
IRVINE,
KA12 8RJ

Single Survey



DM HALL

Survey Report on:

Property Address	Roselea, 4 Castle Street, IRVINE, KA12 8RJ
Reference	1552123
Customer Name	Kay Bennett
Date of Inspection	29th April 2026
Surveyor's name, qualifications and office	Greg Fisher BSc (hons) MSc MRICS DM Hall LLP Chartered Surveyors Eldo House, Monkton Road, Prestwick, KA9 2PB Tel: 01292 286974 email: ayrshireresidential@dmhall.co.uk
Prepared By	DM Hall LLP

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party, they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report, it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and

- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional adviser or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction, after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;

- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2- DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the

property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 **Category 3:** Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 **Category 2:** Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 **Category 1:** No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, they may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market value" The estimated amount for which an asset or liability should exchange on the valuation date, between a willing buyer and a willing seller in an arm's length transaction,

after proper marketing and where the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Reinstatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The property is a three storey semi-detached house.
Accommodation	Ground Floor: Entrance Vestibule, Hallway, Lounge, Dining Room, Conservatory, Kitchen, Shower Room, Utility Room, WC, First Floor: Landing, 3 Bedrooms, WC Attic Floor: Landing, Bedroom, Bathroom
Gross Internal Floor Area (m2)	Approximately 157m ² .
Neighbourhood and Location	The property forms part of a mixed residential and commercial area in the town of Irvine. The surrounding properties in the immediate vicinity are generally of a differing age, style and use. A range of typical local amenities can be found within the town. The property is attached to a commercial property, currently used as a dry cleaners.
Age	Built around 1900.
Weather	It was dry and bright, following generally similar conditions.
Chimney Stacks	Visually inspected with the aid of binoculars where appropriate. There are several chimney stacks of stone construction, externally pointed.

<p>Roofing including Roof Space</p>	<p>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</p> <p>The roof is pitched and clad in slates.</p> <p>I was unable to inspect the roof space, as there is no access to the main roof structure, and access to secondary roof spaces was restricted due to the location of the access hatches.</p>
<p>Rainwater Fittings</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Gutters and downpipes are of PVC.</p>
<p>Main Walls</p>	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The external walls are of traditional solid stone construction, externally pointed. The rear extension is of traditional cavity brick construction with an external render finish.</p>
<p>Windows, External Doors and Joinery</p>	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of double glazed UPVC type.</p> <p>The front external door and the rear external door from the Utility room are of uPVC double glazed type.</p> <p>The external door from the sunroom is of Metal door double glazed type.</p> <p>The fascias are formed in timber.</p>
<p>External Decorations</p>	<p>Visually inspected.</p> <p>The external timbers are painted.</p>
<p>Conservatories and Porches</p>	<p>There are no conservatories or porches.</p>
<p>Communal Areas</p>	<p>There are no communal areas.</p>

Garages and Permanent Outbuildings	<p>There are no garages or permanent outbuildings.</p>
Outside Areas and Boundaries	<p>Visually inspected.</p> <p>There is a substantial mature garden to the side of the property. The garden areas are surfaced in grass, paving and planting.</p> <p>There is a drive and parking area surfaced in hardstanding.</p> <p>The boundaries are formed in stone walls.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings are formed in lath and plaster and plasterboard. There are traditional cornice and ceiling rose features in place in some rooms.</p> <p>There is an area with textured plaster finishes.</p> <p>There is an area of PVC panelling.</p>
Internal Walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls are a mixture of lath and plaster construction and plasterboard lined. There are areas with textured finishes. There are areas of tile wall finishes.</p>
Floors including Sub-floors	<p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub-floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are mostly of suspended timber construction.</p> <p>Some areas are of solid concrete construction.</p> <p>All floors are covered. No sub floor access was available.</p>
Internal Joinery and Kitchen Fittings	<p>Built-in cupboards were looked into, but no stored</p>

	<p>items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The kitchen is fitted with a range of base and wall mounted units with worktops. Further work units are located in the utility room.</p> <p>The internal doors consist of a timber panel and timber-glazed type.</p>
<p>Chimney Breasts and Fireplaces</p>	<p>Visually inspected.</p> <p>No testing of the flues or fittings was carried out.</p> <p>A gas fire is fitted in a tile fireplace in the Lounge. All other original fireplace openings have been removed.</p>
<p>Internal Decorations</p>	<p>Visually inspected.</p> <p>There are texture plaster finishes to the ceilings and walls.</p> <p>There are internal surfaces clad with tiling. The internal walls and ceilings have a papered and painted finish.</p> <p>The internal joinery is finished in paint.</p>
<p>Cellars</p>	<p>There are no cellars.</p>
<p>Electricity</p>	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed.</p> <p>The electricity fuseboxes are located in the entrance hall and store room.</p> <p>A range of 13amp sockets are distributed throughout the property.</p>
<p>Gas</p>	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern</p>

	<p>standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</p> <p>Mains gas supply installed.</p>
<p>Water, Plumbing and Bathroom Fittings</p>	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Water is presumed to be connected to the mains supply. The bathroom is fitted with a coloured WC, wash hand basin and bath.</p> <p>The shower room is fitted with a WC, wash hand basin and shower cubicle with electric shower.</p> <p>There is a toilet fitted with a WC and wash hand basin on the ground floor, and a second toilet with macerating toilet and WC.</p> <p>There is a sink unit in the kitchen and a wash hand basin/ vanity unit within a bedroom.</p>
<p>Heating and Hot Water</p>	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is a gas fired, Potterton combination boiler located within a cupboard in the attic landing. This supplies a system of radiators. The boiler supplies the domestic hot water.</p>
<p>Drainage</p>	<p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is connected to the main sewer.</p>
<p>Fire, Smoke and Burglar Alarms</p>	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There are smoke detectors fitted within the property.</p> <p>Legislation by the Scottish Government, which took effect</p>

from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any Additional Limits to Inspection

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

We have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation we have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns, you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

Concealed areas beneath and around sanitary fittings were not visible. Due to the presence of water, there is an inherent risk of leakage and resultant damage to concealed areas which may only become apparent when the building fabric is opened up for examination.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is outwith the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

The property was occupied, fully furnished and all floors were covered. Consequently, the inspection of the flooring and other elements was restricted.

In accordance with Health and Safety Guidelines, we have not disturbed insulation or furniture and floor coverings have not been moved. Where present, personal effects within cupboards and wardrobes have not been moved, therefore limiting the inspection.


We were unable to inspect the sub floor area as no suitable access hatch was available.

We were unable to inspect the sub floor area as no suitable access hatch was available.

The inspection of the roof covering was restricted from ground level and some parts were not visible.

We were unable to inspect the roof space due to the location and style of access hatch.

Sectional Diagram showing elements of a typical house

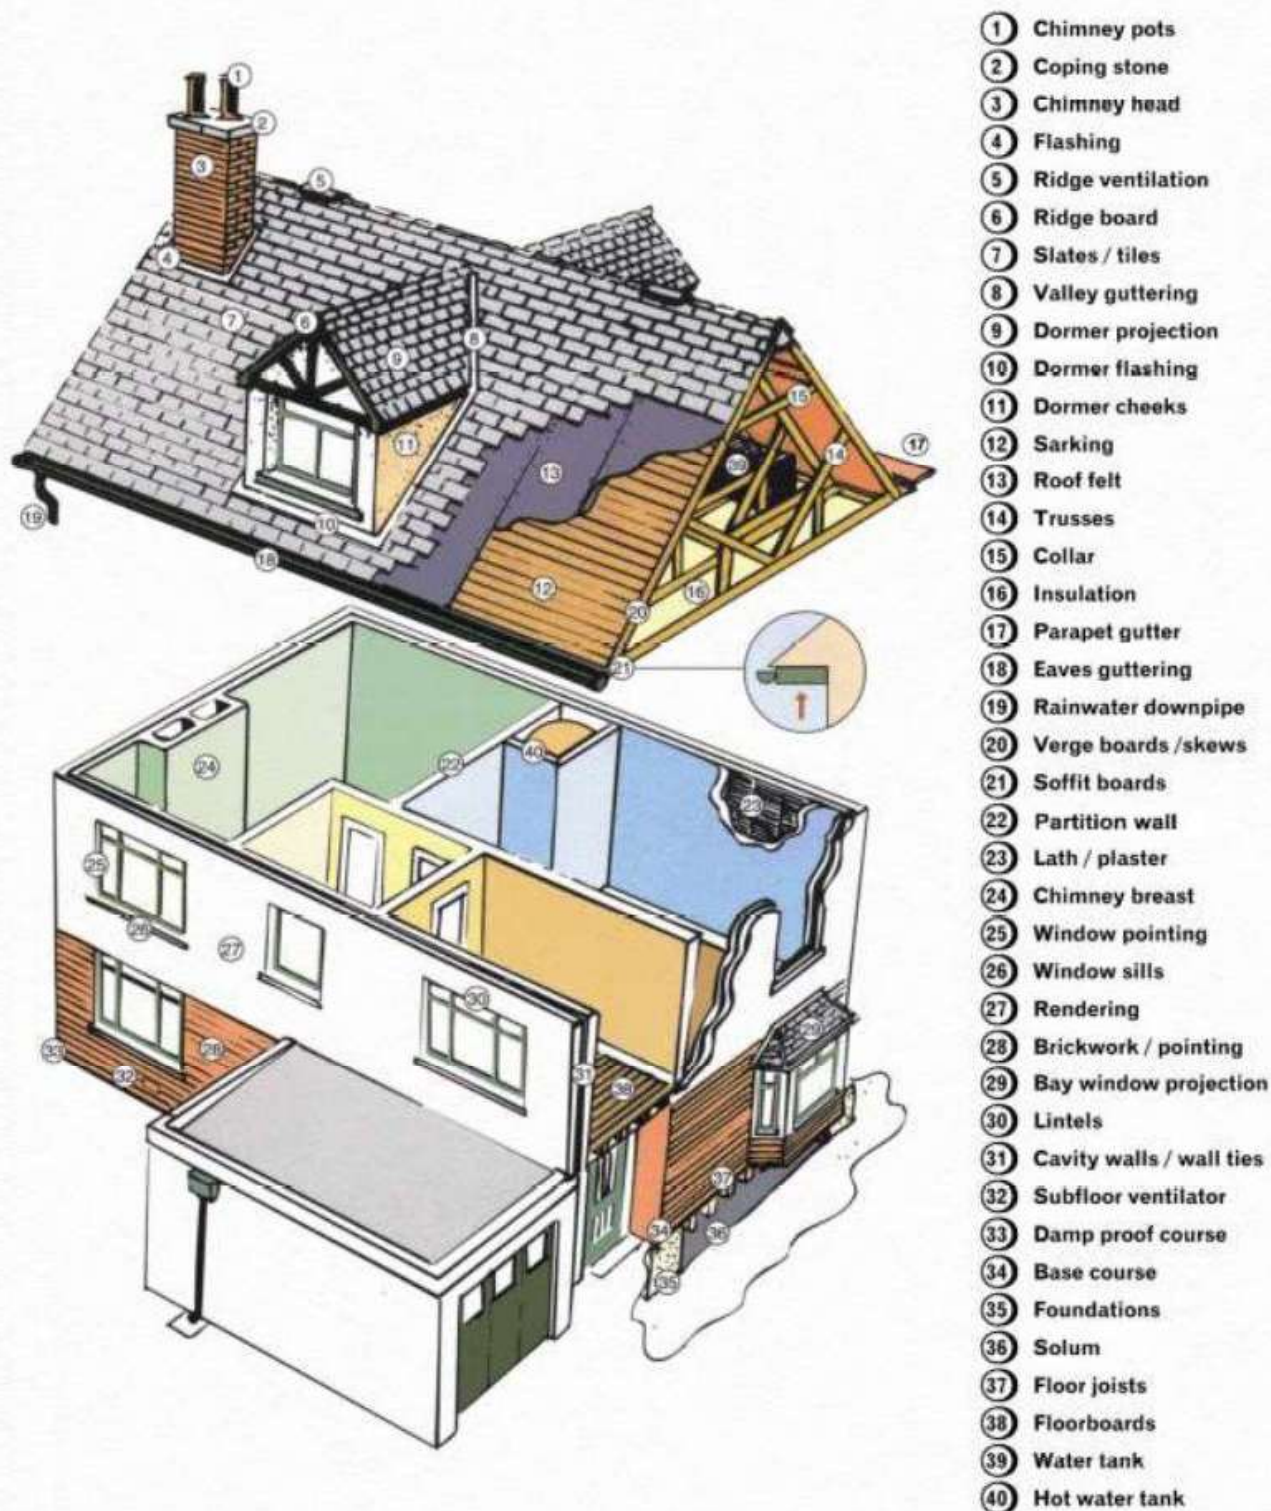

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
<p>Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.</p>	<p>Repairs or replacement requiring future attention, but estimates are still advised.</p>	<p>No immediate action or repair is needed.</p>

Structural Movement	
Repair Category	1
Notes	No obvious evidence of significant movement noted within the limitations of the inspection.

Dampness, Rot and Infestation	
Repair Category	3
Notes	There is evidence of dampness to walls in various locations, in particular along the party wall. Any concealed timbers in contact with dampness are at a risk of rot related defects. I am advised by the seller, the property has been inspected by 'Rowallan Specialist Surveys' and a report is available outlining the recommended repairs. That report can be read in conjunction with this Home Report.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Chimney Stacks	
Repair Category	2
Notes	<p>Chimneys appear to have been capped and are no longer functional.</p> <p>No significant defects noted from ground level, however, chimney stacks are frequently troublesome and are often the source of dampness/water ingress. On-going monitoring/maintenance can be anticipated. It may be prudent to have the chimney stack inspected prior to purchase. Inspection at close quarters may reveal defects not visible from ground level. A roofing/building contractor can advise further.</p>

Roofing including Roof Space	
Repair Category	2
Notes	<p>I was unable to inspect the rear elevation of the roof. Purchasers should satisfy themselves as to the condition of this area of roof.</p> <p>There are various loose, uneven, weathered and stained slates. Inspection at close quarters may reveal more extensive deterioration, especially where materials are original.</p> <p>The roof is of considerable age and is likely original. Regular and ongoing maintenance should be anticipated. A reputable roofing contractor can be asked to investigate and implement all required repairs.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater Fittings	
Repair Category	1
Notes	No significant defects evident. The effectiveness of the rainwater fittings cannot be commented on as it was not raining. Heavy rainfall can often reveal localised leakage and the need for maintenance attention.

Main Walls	
Repair Category	1
Notes	The main walls are in fair condition having regard to the age and construction type of the property.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Windows, External Doors and Joinery

Repair Category	2
Notes	<p>Doors and random windows are opened but not all and inspections can be restricted by window blinds, curtains, ornaments etc. Handles, locks and opening mechanisms can deteriorate through usage and repair or replacement can be anticipated on an ad hoc basis. No assurances can be provided that all window fittings are functional.</p> <p>Deterioration/corrosion is noted to the metal external door. Replacement can be envisaged in the short term. A glazing contractor can provide further advice.</p> <p>Window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather / daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions. There is a degree of general wear and tear to the installation consistent with age and use. It should be appreciated that double glazed replacement windows can be problematic and over time the operations can be affected and the opening mechanisms damaged. Ongoing maintenance should be anticipated.</p>

External Decorations

Repair Category	1
Notes	The renewal of paintwork can be anticipated in places in due course.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Conservatories and Porches	
Repair Category	N/A
Notes	Not applicable.

Communal Areas	
Repair Category	N/A
Notes	Not applicable.

Garages and Permanent Outbuildings	
Repair Category	N/A
Notes	Not applicable.

Outside Areas and Boundaries	
Repair Category	1
Notes	<p>No significant defects evident.</p> <p>Some deterioration to garden walls and open pointing / veg to boundaries.</p> <p>I am advised, by the seller, planning permission has been obtained to construct a 4 bedroom property within the rear most section garden. Further details can be obtained from the seller. For the avoidance of doubt, for the purposes of this Home Report and valuation, the land is valued as garden grounds only and does not include any development value.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Ceilings	
Repair Category	2
Notes	<p>There are original features and repair of these can be expensive even if only small areas are disturbed. This often leads to more extensive work being necessary.</p> <p>There are typical plaster cracks/blemishes consistent with the property age. The textured finishes may contain asbestos based material. See information on asbestos in the Limitations of Inspection section above.</p>

Internal Walls	
Repair Category	2
Notes	<p>There are typical plaster cracks/blemishes consistent with the property age. The textured finishes may contain asbestos based material. See information on asbestos in the Limitations of Inspection section above.</p> <p>Elevated moisture readings were recorded to some wall surfaces. See Section : Dampness, Rot and Infestation.</p>

Floors including Sub-floors	
Repair Category	1
Notes	<p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p> <p>No significant defects evident.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Internal Joinery and Kitchen Fittings	
Repair Category	2
Notes	<p>Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised safety standards.</p> <p>The kitchen units have previously been upgraded although general age related wear and tear is noted.</p>

Chimney Breasts and Fireplaces	
Repair Category	2
Notes	<p>The gas fire was not tested. It is assumed to have been suitably serviced throughout its history and a copy of relevant verifying documentation in this regard should be obtained. All gas fires should be tested for safety prior to use by a Gas Safe registered contractor.</p> <p>Flues should ideally be swept and tested on an annual basis.</p> <p>Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation.</p> <p>If disused fireplaces are to be reopened further advice should be sought to ensure that the chimney flue is intact and suitable for use.</p>

Internal Decorations	
Repair Category	2
Notes	Decorative finishes are worn and an incoming occupier can redecorate to their own personal taste.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair Category	N/A
Notes	Not applicable.

Electricity	
Repair Category	2
Notes	<p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>The electrical installation is dated including older cabling, sockets, switches and fuse box. An NICEIC/SELECT registered electrician can be engaged to examine the system and implement all necessary upgrading works.</p>

Gas	
Repair Category	1
Notes	No significant defects evident. Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, Plumbing and Bathroom Fittings	
Repair Category	2
Notes	The sanitary fittings are dated although appear in serviceable condition from our visual inspection. No tests were carried out. Given their age, there should be an expectation of ongoing maintenance and future upgrading.

Heating and Hot Water	
Repair Category	2
Notes	<p>The central heating boiler appears to have been installed c.2011. Informed opinion suggests that many boilers have a life expectancy of between 10 and 20 years. A suitably qualified heating engineer will be able to advise further on repairing requirements or whether replacement is likely to be a more viable solution.</p> <p>It is assumed that the heating and hot water systems have been installed in accordance with all relevant regulations and thereafter maintained on a regular basis. A copy of any relevant documentation in this regard should be obtained.</p> <p>It is common practice for purchasers to have systems checked by an engineer immediately upon taking ownership, as stated in most offers to purchase used by conveyancers.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Single Survey

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Drainage	
Repair Category	1
Notes	No significant surface defects evident.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural Movement	1
Dampness, Rot and Infestation	3
Chimney Stacks	2
Roofing including Roof Space	2
Rainwater Fittings	1
Main Walls	1
Windows, External Doors and Joinery	2
External Decorations	1
Conservatories and Porches	N/A
Communal Areas	N/A
Garages and Permanent Outbuildings	N/A
Outside Areas and Boundaries	1
Ceilings	2
Internal Walls	2
Floors including Sub-floors	1
Internal Joinery and Kitchen Fittings	2
Chimney Breasts and Fireplaces	2
Internal Decorations	2
Cellars	N/A
Electricity	2
Gas	1
Water, Plumbing and Bathroom Fittings	2
Heating and Hot Water	2
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair.

The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a Solicitor or Licensed Conveyancer

I am advised, by the seller, planning permission has been obtained to construct a 4 bedroom property within the rear most section garden. Further details can be obtained from the seller. For the avoidance of doubt, for the purposes of this Home Report and valuation, the land is valued as garden grounds only and does not include any development value.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Alterations noted include a rear extension. Within the limitations of our inspection these works appear to be historic, having taken place in excess of twenty years ago.

We are advised by the seller that timber/damp remedial works have taken place. It is assumed that appropriate guarantees exist and copies of all relevant documentation can be transferred and retained with the title deeds. This should be confirmed.

We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

Estimated Reinstatement Cost (£) for Insurance Purposes

Five Hundred and Sixty Thousand Pounds:
£560,000

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation (£) and Market Comments

Two Hundred and Thirty-Five Thousand Pounds:
£235,000

The stated market valuation reflects prevailing market conditions and recent sales evidence.

The opinion of Market Value is provided on the assumption that the cost of Category 3 repairs will not significantly exceed £5000. I reserve the right to re-consider the reported Market Value if subsequent estimates exceed this figure.

Report author:	Greg Fisher BSc (hons) MSc MRICS
Company name:	DM Hall LLP
Address:	DM Hall LLP Chartered Surveyors

	Eldo House, Monkton Road, Prestwick, KA9 2PB Tel: 01292 286974 email: ayrshireresidential@dmhall.co.uk
Signed:	
Date of report:	29th April 2026

Roselea, 4 Castle Street,
IRVINE, KA12 8RJ

Mortgage Valuation Report



DM HALL

Mortgage Valuation Report

Property Address: Roselea, 4 Castle Street, IRVINE, KA12 8RJ

Date of Inspection: 29th April 2026

Reference: 1552123

Location & Description

1. Location:

The property forms part of a mixed residential and commercial area in the town of Irvine. The surrounding properties in the immediate vicinity are generally of a differing age, style and use. A range of typical local amenities can be found within the town.

The property is attached to a commercial property, currently used as a dry cleaners.

2. Description:

The property is a three storey semi-detached house.

3. Age:

Built around 1900.

4. Main Construction:

Walls: Solid stone.

Roof: Pitched and slated.

5. Accommodation:

Ground Floor: Entrance Vestibule, Hallway, Lounge, Dining Room, Conservatory, Kitchen, Shower Room, Utility Room, WC,

First Floor: Landing, 3 Bedrooms, WC

Attic Floor: Landing, Bedroom, Bathroom

6. Floor Area - excluding garages and outbuildings:

Gross internal floor area: 157

Gross external floor area: 187

7. Garage and Outbuildings:

None.

Mortgage Valuation Report

Services / Roads

8 Main Service:

Water: Yes: No:

Electricity: Yes: No:

Gas: Yes: No:

Drainage: Yes: No:

For comments on non-mains services, see section 15.

8a. Heating:

Gas fired boiler.

9. Roads - assumed adopted (If no see section 15. General Remarks)

Yes: No:

General Condition

10. Essential Repairs - comments confined to defects which would materially affect the property and/or value/suitably for mortgage purposes.

There is evidence of dampness to walls in various locations, in particular along the party wall. Any concealed timbers in contact with dampness are at a risk of rot related defects. A timber/damp contractor should carry an inspection with a view to providing estimates and carrying out the necessary remedial repairs under cover of a long term guarantee. Best practice recommends an inspection of the whole property is carried out.

Retention: Yes: No:

Retention amount: £5,000

11. Subsidence, Settlement and Landslip:

No obvious evidence of significant movement noted within the limitations of the inspection.

12. General Condition:

The property appeared to be in a condition generally consistent with its age and type.

There is evidence of dampness within the property. I am advised, by the seller, the property has been inspected by 'Rowallan Specialist Surveys' and a report is available outlining the remedial repairs required to the property.

Mortgage Valuation Report

Legal & Other Matters

13. Alterations: Has the property been extended/converted/alterd? (If yes, see section 15)

Yes: ✓

No:

14. Tenure - assumed ownership with marketable title (If no, see section 15)

Yes: ✓

No:

15. General Remarks:

I am advised, by the seller, planning permission has been obtained to construct a 4 bedroom property within the rear most section garden. Further details can be obtained from the seller. For the avoidance of doubt, for the purposes of this Home Report and valuation, the land is valued as garden grounds only and does not include any development value.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Alterations noted include a rear extension. Within the limitations of our inspection these works appear to be historic, having taken place in excess of twenty years ago.

We are advised by the seller that timber/damp remedial works have taken place. It is assumed that appropriate guarantees exist and copies of all relevant documentation can be transferred and retained with the title deeds. This should be confirmed.

We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

16. Comments on Mortgageability:

The property is considered suitable for mortgage purposes subject, as always, to the policy of the individual lender.

Valuation & Insurance

17.1 Valuation in present condition (words and figures):

Two Hundred and Thirty-Five Thousand Pounds: £235,000

17.2 Valuation upon completion of any works required under section 9 (words and figures):

Two Hundred and Forty Thousand Pounds: £240,000

17.3 Insurance reinstatement: Approximate current reinstatement cost including site

Mortgage Valuation Report

clearance and professional fees, excluding VAT except on fees. (words and figures):

Five Hundred and Sixty Thousand Pounds: £560,000

18. Declaration:

Signed:



Valuer's name and Qualifications: Greg Fisher BSc (hons) MSc MRICS 6515082

Date: 28th April 2026

Office Address: DM Hall LLP Chartered Surveyors
Eldo House,
Monkton Road,
Prestwick,
KA9 2PB

Tel: 01292 286974

email: ayrshireresidential@dmhall.co.uk

DM Hall LLP, a Limited Liability Partnership registered in Scotland with Registration number SO301144

A full list of members can be obtained from the head office, 17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland and offices in Carlisle, Kendal and Cornwall

Regulated by RICS



RICS[®]

Registered
valuer

Roselea, 4 Castle
Street, IRVINE, KA12
8RJ

Property Questionnaire

Property Questionnaire

Property Address:

Roselea, 4 Castle Street, IRVINE, KA12 8RJ

Seller(s):

Kay Bennett and Isabelle Campbell

Completion Date of Property Questionnaire: 23/04/2026

Note for sellers.

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

Property Questionnaire

1. Length of ownership

How long have you owned the property? 65 years

2. Council Tax

Which Council Tax band is your property in? D

3. Parking

What are the arrangements for parking at your property? (Please indicate all that apply)

Garage	No	Allocated parking space	No	Driveway	Yes
Shared parking	No	On street	No	Resident permit	No
Metered parking	No	Other:	Parking for 4 cars through secure shattered gateway		

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)? Don't know

5. Listed Building

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)? No

6. Alterations/additions/extensions

A. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet or bedroom)? Yes

If you have answered yes, please describe the changes which you have made:

Extension comprising of sunroom/conservatory, shower room, utility room/workshop added

(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? Yes

If you have answered yes, the relevant documents will be needed by the purchaser, and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

B. Have you had replacement windows, doors, patio doors or double glazing installed in your property? Yes

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced? No

(ii) Did this work involve any changes to the window or door openings? No

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Single glazed sash windows replaced with tilt and turn double glazed windows approx 25 yrs ago

Please give any guarantees which you received for this work to your solicitor or estate agent.

7. Central Heating

A. Is there a central heating system in your property?

Yes

(Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you, have answered yes/partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)

Pottington combi gas boiler

If you have answered yes, please answer the 3 questions below:

B. When was your central heating system or partial central heating system installed?

Approx 25 years ago but boiler replaced about 10 yrs ago

C. Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

D. When was your maintenance agreement last renewed? (Please provide the month and year).

Property Questionnaire

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old? No

9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it? No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property? No

If you have answered yes, please give details:

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	Octopus
Water mains/private water supply	No	
Electricity	Yes	Octopus
Mains Drainage	Yes	Nothing Ayrshire council
Telephone	Yes	Now disconnected
Cable TV/Satellite	No	
Broadband	No	

Property Questionnaire

- b. **Is there a septic tank system at your property?** No

If you have answered yes, please answer the two questions below:

- c. **Do you have appropriate consents for the discharge from your septic tank?**
- d. **Do you have a maintenance contract for your septic tank?**

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for a Shared or Common Areas

- a. **Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?** No

If you have answered yes, please give details:

- b. **Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?** No

If you have answered yes, please give details:

- c. **Has there been any major repair or replacement of any part of the roof during the time you have owned the property?** Yes

- d. **Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?** No

Property Questionnaire

If you have answered yes, please give details:

- e. **As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?** No

If you have answered yes, please give details:

- f. **As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.)** No

If you have answered yes, please give details:

12. Charges associated with your property

- a. **Is there a factor or property manager for your property?** No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

- b. **Is there a common buildings insurance policy?** No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

- c. **Please give details of any other charges you must pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund.**

Property Questionnaire

13. Specialist Works

- a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? Yes

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

Damp membrane installed on gable wall of ground and first floor by Kerlaw damp specialists

- b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? No

If you have answered yes, please give details.

- c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? Yes

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees

A.	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	No
(ii)	Roofing	No
(iii)	Central heating	No
(iv)	NHBC	No
(v)	Damp course	No

Property Questionnaire

(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No
------	--	----

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

- B. Are there any outstanding claims under any of the guarantees listed above?** No

If you have answered yes, please give details:

15. Boundaries

- So far as you are aware, has any boundary of your property been moved in the last 10 years?** No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years have you ever received a notice:

- a. **Advising that the owner of a neighbouring property has made a planning application?** No
- b. **That affects your property in some other way.** No
- c. **That requires you to do any maintenance, repairs, or improvements to your property.** No

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Energy Performance Certificate



DM HALL

Energy Performance Certificate (EPC)

Scotland

Dwellings

4 CASTLE STREET, IRVINE, KA12 8RJ

Dwelling type: Semi-detached house
Date of assessment: 29 April 2026
Date of certificate: 19 May 2026
Total floor area: 153 m²
Primary Energy Indicator: 217 kWh/m²/year


Reference number: 0216-7724-6000-0631-2222
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£7,662	See your recommendations report for more information
Over 3 years you could save*	£1,605	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

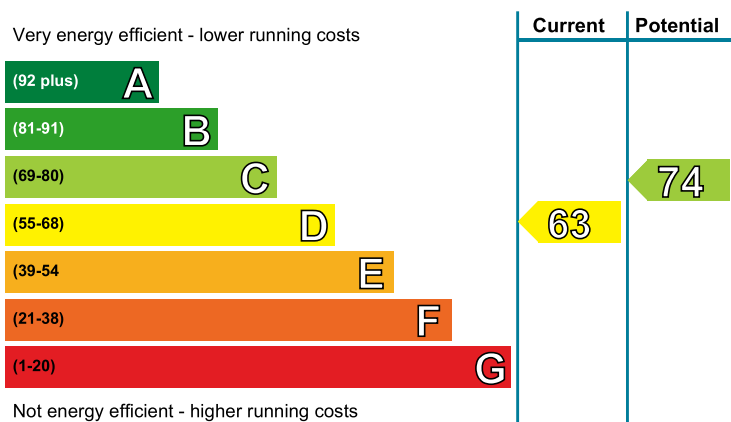


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

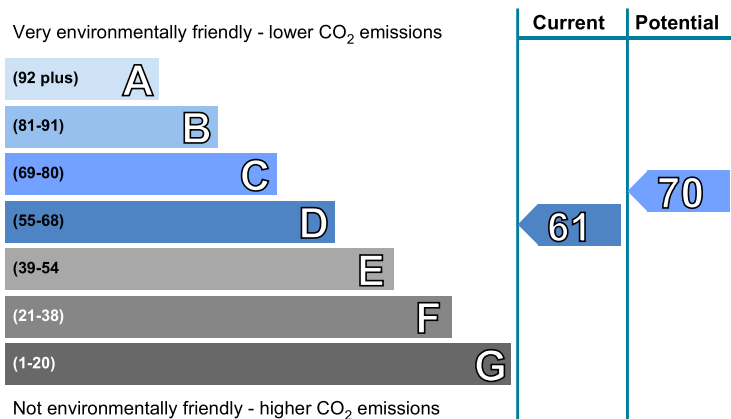

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (61)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£669.00
2 Floor insulation (suspended floor)	£5,000 - £10,000	£330.00
3 Low energy lighting	£960 - £1,120	£366.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Cavity wall, as built, insulated (assumed)	★★★★☆	★★★★☆
Roof	Pitched, insulated (assumed)	★★★★☆	★★★★☆
	Roof room(s), no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Floor	Suspended, no insulation (assumed)	—	—
	Solid, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★☆☆☆☆	★☆☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 39 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.











Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£6,006 over 3 years	£4,827 over 3 years	
Hot water	£987 over 3 years	£987 over 3 years	
Lighting	£669 over 3 years	£243 over 3 years	
Totals	£7,662	£6,057	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£223		
2 Floor insulation (suspended floor)	£5,000 - £10,000	£110		
3 Low energy lighting for all fixed outlets	£960 - £1,120	£122		
4 Replacement glazing units	£4,500 - £6,000	£79		
5 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£246		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

4 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	22,234.73	N/A	N/A	N/A
Water heating (kWh per year)	2,337.13			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Greg Fisher
Assessor membership number: EES/017520
Company name/trading name: D M Hall Chartered Surveyors LLP
Address: 45 Bank Street
Irvine
KA12 0LL
Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





**Independent Surveyors for Fungal Decay, Woodworm
Dampness and Basement Waterproofing**

30 John Finnie Street
Kilmarnock
KA1 1DD

01563 529716
info@rowallansurveys.co.uk
www.rowallansurveys.co.uk

SURVEY REPORT

Customer: Kay Bennett

Property: Roselea, 4 Castle Street
Irvine
KA12 8RJ

Surveyor: Michael Caldow

Survey Date: 05/05/2026

Ref No: ROW14143SVY

Report Date: 05/05/2026

Property Description: Attached House

May we take this opportunity to thank you for choosing Rowallan Timber and Damp Surveys to carry out this inspection. We confirm you have asked us to inspect the accessible areas for dampness.

Our objective in preparing this report for you is to ensure that you have full transparency of the problems identified, are aware of the costs involved and to provide you with the solutions to rectify these problems with the minimum of disruption.

So that you can be confident in our diagnosis, our surveyors are fully qualified to CSRT/ CSSW level.

Our inspection was restricted to the areas designated below and was of a non-disruptive nature. Should there be any other areas of concern to you that we have not commented on or if you would like a more detailed examination involving exposure works, we would be pleased to undertake this for you on receipt of further instruction (written permission will require to be obtained from the property owner). Parts of the property which cannot be accessed will not be reported upon and this will be stated in the report, however, should the surveyor suspect that a defect may exist, he may recommend that a further inspection is required.

All directions given in our report were taken from the outside of the property facing the front elevation wall.

Hall, Toilet, Dining Room and Kitchen

We have assumed/understand that remedial works will be undertaken in conjunction with a more substantial scheme of refurbishment and our specification has been prepared accordingly.

OBSERVATIONS

Inspection was generally restricted by furniture and floor coverings.

Floors to Hall, WC and understair cupboard and solid. Floors to Kitchen and adjacent Dining Room are timber. No sub-floor inspection was possible.

At the time of our survey visual and instrumental inspection indicated the presence of rising damp to those walls indicated for treatment on the attached sketch.

Following the installation of a remedial damp-proof course, residual hygroscopic salts may migrate to the surface of the wall and absorb atmospheric moisture which can continue to cause dampness problems (this makes it necessary for all contaminated plaster to be removed).

In addition, we suspect dampness to some higher areas in Kitchen and Dining Room are a result of moisture ingress from defective roofing and/ or rainwater goods to the attached dilapidated outbuildings of the adjacent property which should be attended to by others under a separate contract.

RECOMMENDATIONS

A sketch has been enclosed to assist in the identification of treatment areas.

Works by Specialist Contractor:

Carefully hack off and remove existing wall plaster to areas and heights as indicated.

Install a chemical damp-proof course using a silane diffusion method to those walls indicated in accordance with BS 6576.

Install a ventilated, lathed membrane to exposed surfaces of masonry to isolate substrate from plaster finish.

Gypsum bonding plaster or plasterboard is to be applied to membrane followed by finishing plaster.

Carefully lift flooring adjacent to damp wall in Kitchen and inspect exposed timbers, if sound, treat with fungicide/preservative. Otherwise arrange to provide supplementary report on condition.

Ancillary works required by others:

Temporarily disconnect and isolate wc, whb, sockets, radiator, kitchen units, etc and reinstate/ renew on completion.

Reinstate/ renew skirtings, etc.



GENERAL NOTES

We would draw your attention to the need for you to remove all fixtures, fittings, floor coverings, stored articles, etc from the areas designated for treatments, prior to works commencing on site.

Replacement timbers will be to standard stock items, sections and mouldings, unless otherwise specified.

Our cost assessment covers only those items specifically stated in the report to be undertaken by the Specialist Contractor. All other repairs and/or ancillary works are to be the responsibility of others, under separate contract.

No allowance has been made in our cost assessment for the removal and subsequent re-instatement of any electrical, plumbing or other services unless otherwise stated.

At the time of the inspection, it was not possible to ascertain the construction of the masonry or the nature of the mortar joints. Our cost assessment is therefore based on the masonry being level, in sound condition and bonded with mortar. If, during the course of the work specified, extra work is found to be necessary due to the poor condition of the masonry you will be notified.

It will be seen our specification includes for the removal of existing plaster. In removing plaster, it is not unusual for dust to find its way to the remotest parts of the property. Whilst the Specialist Contractor will take precautions to minimise this nuisance wherever practicable within the immediate area of the works, we respectfully suggest that you should also take some precautions to protect furniture and the like elsewhere in the property. No responsibility is likely to be accepted by the Specialist Contractor for cleaning or for any damage that may be caused by dust.

Our inspection is based upon a close, but not intimate, examination of the areas specified. Inevitably, there will be concealed timbers that could not be inspected fully, or at all, without opening up. We have, as far as possible, inspected accessible exposed surfaces available to us. Our recommendations are, therefore, subject to the qualification that further necessary works may be required once the fabric of the building or a particular element is exposed, this applies particularly to dry rot. Should you require a full exploratory examination, we would be pleased to quote. If you proceed on the present basis, we shall advise you of any further infestation or fungal decay discovered during the execution of the works and advise/assess accordingly.

You should be aware that we have reported upon problems evident to us at the time of our visit, we are not commenting in any general sense on the risk of fungal decay or any other defect not evident at this time or that may develop in the future.

Where we have drawn your attention to other defects, these should be regarded as helpful suggestions and not a full complete assessment of any problems that may exist. External weathered timbers (eg, windows, fascias, etc) and outbuildings are not covered by the scope of our survey.

About Rowallan Timber and Damp Surveys

We are a local, independent company providing professional advice and remedial solutions in relation to timber and damp problems in buildings.



Our reliability, professionalism and integrity have been proven by our many repeat customers and referrers. A small selection of our testimonials can be viewed on our website www.rowallansurveys.co.uk.

We would like to thank you once again for choosing us to carry out this survey for you. Our customer's opinions and satisfaction are very important to us and we believe in offering an exceptional service. We will, for that reason, follow up with a brief online survey from a specialist customer research company and would be delighted if you could provide us with your feedback. In the meantime, if you would like to comment on any aspect of our service, please feel free to call our office or drop us an email at info@rowallansurveys.co.uk.

Cost Assessment

We advise that a competitive cost to undertake **Works by Specialist Contractor** as specified in this survey report would be:

	£	3950
VAT @ 20%	£	790
Total	£	4740

Whilst we do not undertake remedial works directly, we can introduce you to a **Specialist Contractor** to carry out the works directly for you. Although any contract will be between the customer and the Specialist Contractor, we select the Specialist Contractors we introduce carefully and you can be confident that work will be undertaken in accordance with our specification by skilled and experienced technicians complying with stringent industry standards in terms of workmanship and health and safety. The Specialist Contractor will aim to complete the works with the minimum of disruption and within the cost assessed by ourselves (subject to a reasonable period for acceptance and fluctuations in material costs).

Please contact ourselves should you wish us to introduce you to a Specialist Contractor and we will provide them all the necessary information for them to contact you directly and arrange mutually convenient work dates.

If works are undertaken by a **Specialist Contractor**, upon final payment of the contract, a 10 year Guarantee will be issued by them in respect of specialist works, offering you peace of mind by protecting your property for the future.


The surveyor who has been dealing with this property is Michael Caldow and can be contacted on telephone number 01563 529716 or mobile 07976 251978 or by e:mail at mc@rowallansurveys.co.uk.










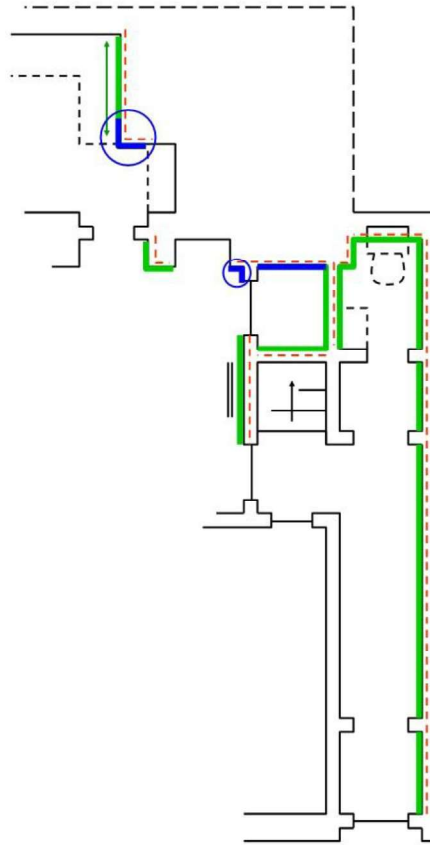


M Caldow

Michael Caldow BSc CSRT CSSW



Part Ground Floor Plan



	Chemical DPC		Renew flooring, deaffening and joist sections		Clear, treat and seal solum		Renew lintel
	Membrane and plaster -approx 1.0m high		Renew joist sections		Renew ceiling		Renew beam
	Membrane and plaster - approx 2.0m high		Radiator (others)		Inspect/ treat joists		Inspect/ treat lintel



DM Hall LLP, a Limited Liability Partnership registered
in Scotland with Registration number SO301144

A full list of members can be obtained from the head office,
17 Corstorphine Road, Edinburgh EH12 6DD. 0131 477 6000

DM Hall has a network of offices across Scotland,
Cumbria and the Southwest of England.

DM HALL



RICS[®]

Registered
valuer